Instruction Manual

D810
D811

True RMS Multimeter

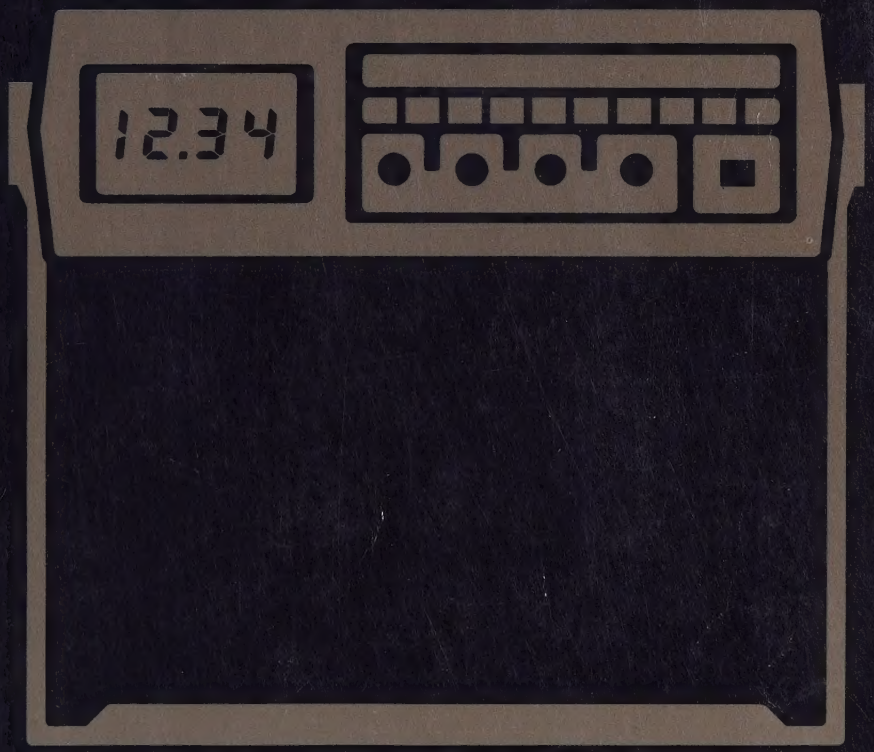

FLUKE®

NOTE

This manual documents the Model D 810 and D 811 and their assemblies at the revision levels shown in Appendix 7A. If your instrument contains assemblies with different revision letters, it will be necessary for you to either update or backdate this manual. Refer to the supplemental change/errata sheet for newer assemblies, or to the backdating sheet in Appendix 7A for older assemblies.

See Section 7 for a complete listing of Fluke Service Centers.

D810
D811

True RMS Multimeter

Instruction Manual

P/N 583617
October 1980

FLUKE®

Dear Customer:

Congratulations! We at Fluke are proud to present you with the D 810 and D 811 Multimeters. These instruments represent the very latest in integrated circuit and display technology. As a result, the end products are rugged and reliable instruments whose performance and design exhibit the qualities of finely engineered lab instruments. They also provide some unique measurement capabilities in addition to those normally found in an ordinary multimeter.

To fully appreciate and protect your investment, we suggest that you take a few moments to read the manual. As always, Fluke stands behind your instrument with a full one-year warranty and a worldwide service organization. If the need arises, please don't hesitate to call on us.

Thank you for your trust and confidence.

JOHN FLUKE MFG. CO., INC.

Table of Contents

SECTION		TITLE	PAGE
1		**INTRODUCTION AND SPECIFICATIONS**	**1-1**
	1-1.	INTRODUCTION	1-1
	1-4.	UNPACKING YOUR INSTRUMENT	1-1
	1-6.	GETTING ACQUAINTED	1-2
	1-11.	USING YOUR METER	1-2
	1-13.	The LCD	1-2
	1-15.	Power Switch	1-2
	1-17.	AC/DC Select	1-2
	1-19.	Voltage Measurements	1-2
	1-24.	Current Measurements	1-3
	1-28.	10A Current Measurement	1-4
	1-30.	Resistance Measurements	1-4
	1-33.	Conductance Measurements	1-4
	1-35.	SPECIFICATIONS	1-4
2		**OPERATING INSTRUCTIONS**	**2-1**
	2-1.	INTRODUCTION	2-1
	2-3.	OPERATING NOTES	2-1
	2-5.	Input Power	2-1
	2-7.	Display Readings	2-1
	2-11.	Input Connections to Common	2-2
	2-13.	Input Overload Protection	2-2
	2-15.	Fuse Replacement	2-3
	2-17.	Making Voltage Measurements	2-3
	2-30.	Making Current Measurements	2-5
	2-33.	Making Resistance Measurements	2-6
	2-37.	Making Conductance Measurements	2-6
	2-43.	AC Measurement Considerations	2-8
	2-63.	OPERATION	2-10
	2-65.	APPLICATIONS	2-10
	2-67.	Transistor Tester	2-11
	2-72.	Leakage Tester	2-11
	2-78.	Relative Light Meter	2-11
3		**THEORY OF OPERATION**	**3-1**
	3-1.	INTRODUCTION	3-1
	3-3.	BASIC DESCRIPTION	3-1
	3-6.	DIGITAL VOLTMETER	3-1
	3-9.	A/D Converter	3-1

(continued on page ii)

TABLE OF CONTENTS, *continued*

SECTION		TITLE	PAGE
	3-20.	Digital Controller	3-4
	3-22.	Display	3-4
	3-24.	INPUT SIGNAL CONDITIONERS	3-4
	3-26.	True RMS Converter	3-4
	3-28.	Voltage Conditioner	3-4
	3-30.	Current Conditioner	3-6
	3-33.	Resistance Conditioner	3-6
	3-37.	Conductance Conditioner	3-6
	3-39.	Range Switches	3-6
	3-41.	MISCELLANEOUS CIRCUITRY	3-6
	3-42.	Meter Protection Circuits	3-6
	3-51.	Power Supply (D 810)	3-7
	3-53.	Power Supply (D 811)	3-7
	3-57.	Touch and Hold Circuit	3-7
4		**MAINTENANCE**	**4-1**
	4-1.	INTRODUCTION	4-1
	4-3.	SERVICE INFORMATION	4-1
	4-7.	GENERAL INFORMATION	4-1
	4-8.	Access Information	4-1
	4-15.	Cleaning	4-4
	4-17.	mA Backup Fuse Replacement	4-4
	4-19.	Battery Replacement (D 811 only)	4-4
	4-21.	Line Fuse Replacement (D 811 only)	4-4
	4-23.	PERFORMANCE TESTS	4-4
	4-26.	Display Test	4-5
	4-28.	Resistance/Conductance Test	4-5
	4-30.	DC Voltage Test	4-6
	4-32.	RMS Converter Offset Test	4-6
	4-34.	AC Voltage Test	4-6
	4-36.	DC Current Test	4-6
	4-38.	AC Current Test	4-7
	4-40.	10A Current Test	4-7
	4-42.	CALIBRATION PROCEDURE	4-7
	4-44.	Power Supply Check (D 810)	4-7
	4-46.	Power Supply Check (D 811)	4-8
	4-48.	DC Calibration Adjustment	4-8
	4-50.	RMS Converter Offset Adjustment	4-9
	4-52.	AC Calibration Adjustment	4-9
	4-54.	TROUBLESHOOTING	4-9
5		**LIST OF REPLACEABLE PARTS**	**5-1**
	5-1.	INTRODUCTION	5-2
	5-4.	HOW TO OBTAIN PARTS	5-2

(continued on page iii)

TABLE OF CONTENTS, *continued*

SECTION	TITLE	PAGE
6	**ACCESSORY INFORMATION**	6-1
	6-1. INTRODUCTION	6-1
	6-3. Carrying Case (Y8205)	6-1
	6-5. Temperature Probe (80T-150C/F)	6-1
	6-7. Specifications	6-1
	6-8. Touch & Hold Probe (Y8008)	6-1
	6-10. Specifications	6-3
	6-11. High Voltage Probe (80K-40)	6-3
	6-13. Specifications	6-3
	6-14. High Frequency Probe (81RF)	6-3
	6-16. Specifications	6-3
	6-17. AC Current Transformer (Y8101)	6-3
	6-19. Specifications	6-3
	6-20. AC/DC Current Probe (Y8100)	6-3
	6-22. Specifications	6-3
	6-23. Current Transformer (80I-600)	6-4
	6-25. Specifications	6-4
	6-26. Test Lead Set (Y8133)	6-4
	6-28. Specifications	6-4
	6-29. Test Lead Set (Y8140)	6-4
	6-31. Specifications	6-4
7	**GENERAL INFORMATION**	7-1
7A	**MANUAL CHANGE INFORMATION**	7A-1
8	**SCHEMATIC DIAGRAMS**	8-1

List of Tables

TABLE	TITLE	PAGE
1-1.	Specifications	1-5
2-1.	Input Overload Limits	2-2
4-1.	List of Recommended Test Equipment	4-2
4-2.	Decimal Point Location	4-5
4-3.	Resistance/Conductance Test	4-5
4-4.	DC Voltage Test	4-6
4-5.	AC Voltage Test	4-6
4-6.	DC mA Test	4-7
4-7.	Power Supply Voltages (D 810)	4-8
4-8.	Power Supply Voltages (D 811)	4-8
4-9.	Troubleshooting Guide	4-10
4-10.	Test Points	4-10

List of Illustrations

FIGURE	TITLE	PAGE
	D 810/D 811 Digital Multimeter	vi
1-1.	LCD	1-2
1-2.	Voltage Measurement	1-2
1-3.	mA Measurement	1-3
1-4.	10A Current Measurement	1-4
1-5.	Resistance Measurement	1-4
1-6.	Conductance Measurement	1-4
2-1.	Voltage Conversion	2-4
2-2.	Circuit Loading Error Calculations	2-5
2-3.	RMS Values	2-5
2-4.	Calculating Burden Voltage Error	2-6
2-5.	Conductance-to-Resistance Conversion	2-7
2-6.	Crest Factor	2-9
2-7.	Components of a Rectangular Waveform	2-9
2-8.	Example	2-10
2-9.	Transistor Beta Test Fixture	2-12
3-1.	Basic Block Diagram	3-2
3-2.	A/D Converter Simplified Schematic and Timing Diagram	3-3
3-3.	Input Signal Conditioners	3-5
4-1.	Removing the mA Input Line	4-3
6-1.	Model Y8205 Carrying Case	6-1
6-2.	Probe Accessories	6-2

D 810/D 811 True RMS Multimeter

Section 1
Introduction & Specifications

1-1. INTRODUCTION

1-2. The Fluke Models D 810 and D 811 are portable, bench-type, digital multimeters with 3-1/2 digit liquid crystal display (LCD). Both offer as standard measurement functions the five basic DMM functions (AC/DC voltage, AC/DC current, and resistance) and a new measurement function-conductance. The D 810 is operated from AC line power and the D 811 is operated from either AC line or internal rechargeable batteries. Other performance features are the same.

1-3. Your meter also has advantages that don't show on the outside. Some of these are:

- True RMS measurement of AC signals - the only accurate way to directly measure ac signals other than noise-free pure sine waves.
- 3-1/2 digit liquid crystal display - a high contrast display that can be read easily from across the room. No more worries about bent needles, parallax, etc.
- Each range has:

  Full auto-polarity operation.

  Overrange indication.

  Effective protection for overloads and transients.

  Dual slope integration measurement technique to insure fast, accurate, noise-free measurements.
- The conductance ranges allow accurate, noise-free measurement up to 10,000 MΩ.
- Long term calibration stability - 1 year. Easy calibration - few adjustments.
- A full line of accessories that extend the range and scope of your instrument:

  The Y8008 Touch and Hold Probe allows voltage, resistance and conductance readings to be held in the display.

  The 80I-600 High Current Probe allows your meter to measure from 2A to 600A.

  The 80K-40 High Voltage Probe allows your meter to measure from 1 kV to 40 kV dc or peak ac, 28 kV rms ac.

  The 81RF High Frequency Probe allows your meter to measure signals from 0.25V to 30V rms ac over a frequency range of 100 kHz to 100 MHz.

  The 80T-150 Temperature Probe allows your meter to measure temperature of -50°C to +150°C or -58°F to +302°F.

  NOTE

  For more information on these accessories, refer to the material presented in Section 6.

1-4. UNPACKING YOUR INSTRUMENT

1-5. The shipping container should contain this manual, your multimeter, and two test leads (one red and one black). If anything is wrong with your shipment or if the instrument was damaged during shipment, contact your nearest John Fluke Service Center immediately. There is a list of these service centers in Section 7. If reshipment is required, please use the original shipping container. The D 811 contains rechargeable batteries which must be charged before you can operate the DMM. Refer to Section 2 for instruction on charging the batteries.

1-6. GETTING ACQUAINTED

1-7. Let's take a brief look at your instrument before we discuss exactly how to operate it.

1-8. The meter is light (2 pounds and 6 ounces for the D 810) with a low profile that hugs the work bench. The case color goes with any decor and is made of rugged, high impact plastic. The handle can be rotated to eight positions to function as a handle for carrying the instrument or as a stand to tilt the front panel up for convenient operation. The handle can be rotated out of the way. To change the handle position, pull out on the round hubs where the handle joins the meter then rotate the handle to the desired position.

1-9. On the rear of the meter are a phillips screw and a power cord receptable. The phillips screw holds the outer cover in place.

1-10. The LCD (liquid crystal display) covers the left part of the front panel. The right hand portion of the front panel contains two horizontal rows of controls and connectors. The top row consists of ten pushbuttons - the four switches on the left determine the measurement function of your multimeter and the other six switches determine the range of measurement. The bottom row consists of controls and the input terminals.

1-11. USING YOUR METER

1-12. This portion of the text will discuss the operation and characteristics of your meter in detail for each measurement function. Exercises are included to familiarize you with the instrument controls and to insure that your instrument is functional.

1-13. The LCD

1-14. The LCD is a 3 1/2 digit display. As shown in Figure 1-1, this display is made up of four digits. The three digits on the right can each register a count of 0 to 9. Together they register from 000 to 999. The digit on the left can register the minus sign and a 1 overflow from the three digits on the right. This is the 1/2 digit. Together the four digits can count from -1999 to +1999. For convenience of discussion, we will round the 1999 to 2000.

1-15. Power Switch

1-16. The POWER switch is the green switch in the lower right corner of the front panel. As the decal indicates, the pushbutton is a two position switch, ON and OFF. To change from one condition to the other, push the switch (never pull). If the button is out, or in the OFF position, push it. The control will lock in the ON position. Push the control again and the button will pop out to the OFF position. When recharging the batteries of the D 811, the power switch should be at the OFF position.

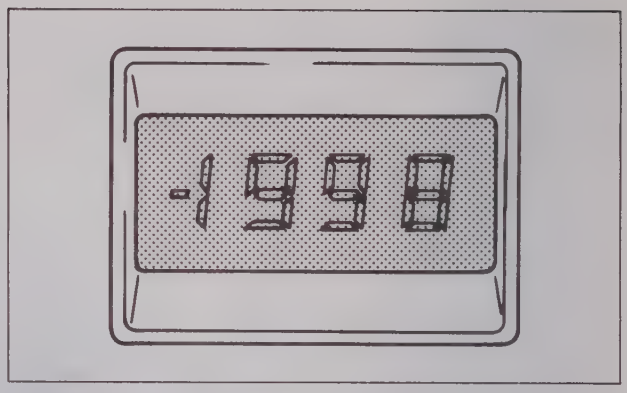

Figure 1-1. LCD

1-17. AC/DC Select

1-18. The position of the pushbutton at the left end of the upper row of controls determines whether your instrument will be set up to read dc or ac signals. Operation of this control is exactly like the POWER control. As the decal shows, if the pushbutton is in, ac-coupled measurement is selected. If the pushbutton is out, dc measurement is selected. This control will only affect your instrument when either a voltage or current function is selected.

1-19. Voltage Measurements

1-20. The controls and terminals used for making voltage measurements are highlighted in Figure 1-2. Starting at the top left is the AC/DC switch. Next is the V pushbutton. This pushbutton is interlocked with the other two measurement function select switches, mA/A and Ω/S. That is, if the V pushbutton is locked at the in position and either of the other two pushbuttons are pressed, the V pushbutton will pop to the out position. The pushbutton must be locked at the in position to determine measurement function. Push the V switch in.

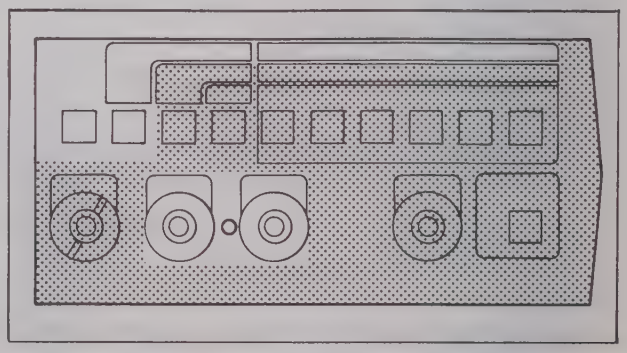

Figure 1-2. Voltage Measurement

1-21. The light green decal around the V control extends up and to the right. The five ranges of the voltage function are labeled in this band over their respective range selection switches. These switches are all interlocked in the same manner as the three measurement function switches. Select the 2V range.

1-22. The two input terminals highlighted in the bottom row are banana jack connectors. The one on the left is labeled COMMON and has a black decal. This terminal is common to all measurement functions and the black test lead should always be connected here. A curved line with a note goes to the left and down from the COMMON input terminal. This note is a reminder to not measure signals where the COMMON lead will be more than 500V above ground potential. The other input terminal is labeled V-Ω-S on a red decal. The red test lead is connected here for voltage, standard resistance, and conductance measurements. Between the two terminals is a hole and a thin connecting line with a subtended note. The note reminds the operator that signals exceeding 750V ac rms or 1000V dc should not be measured between the terminals. The hole is a key guide for the optional Touch and Hold Probe. Connect the test leads to the terminals.

1-23. Let's perform the following procedure.

1. Set the AC/DC switch to the DC position.

2. With the POWER switch in the OFF position, connect the power cord to the instrument and a line power outlet rated at the operating voltage and frequency of your instrument.

3. Press the POWER switch to ON. The LCD should flash a random number. Then count down rapidly to a reading of .000 (because the 2V range is selected).

4. Touch the sampling end of the red test lead to the far left terminal labeled mA. A firm contact must be made or the display may be in error. The LCD should display approximately 0.6V to 0.8V. This is the signal voltage for the optional Touch and Hold Probe. It is not an accurate voltage level and varies from instrument to instrument. This voltage is not present when a current measurement function is selected. For more information on the Touch and Hold Probe, refer to Section 6.

5. Place the AC/DC switch in the AC position. The LCD should count down to a reading that is typically .000 to .002 - the dc signal has been eliminated.

6. Remove the red test lead from the mA input terminal.

7. Select the 750V ac rms range.

WARNING

THE LOCAL LINE VOLTAGE IS MEASURED IN THE FOLLOWING STEP. BE CAREFUL NOT TO TOUCH THE PROBE TIPS WITH YOUR FINGERS OR TO ALLOW THE PROBE TIPS TO TOUCH EACH OTHER.

8. Insert the sampling ends of the test leads into the slots of a line power outlet. The LCD should display the local line voltage. This voltage probably will not be at the rated level but should be close.

9. Press the AC/DC switch to select DC measurements. This will reject the ac portion of the signal. There may be some dc voltage displayed due to nonlinear loads such as SCR light dimmers.

10. Remove the test leads from the line power outlet.

1-24. Current Measurements

1-25. The controls and terminals used for making current measurements are highlighted in Figure 1-3. The AC/DC switch and the mA switch determine the measurement function. The current switch is labeled mA/A because the same switch selects the high current measurement function also.

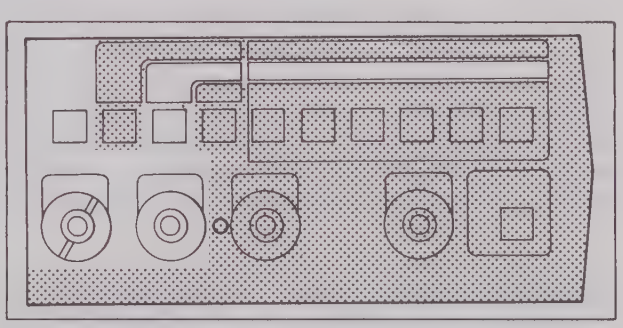

Figure 1-3. mA Measurement

1-26. The pink decal around the mA control extends up and to the right. The ranges of current measurement are labeled in this band above their respective range selection switches.

1-27. The two input terminals are the COMMON terminal and the mA terminal. There is a line between them with a note to remind the operator that current measurements over 2A should not be read between these terminals. The mA terminal is also the end of a protective fuse holder. The collar is slotted to facilitate fuse replacement. There is a curved arrow with a 2A fuse note to the left of the mA terminal to indicate how to remove the 2A fuse. For additional information on fuse replacement, refer to Section 2.

1-28. 10A Current Measurement

1-29. The controls and terminals used for the 10A current measurement function are highlighted in Figure 1-4. The AC/DC and mA switches and the last range switch on the right select the 10A current measurement function. The COMMON and 10A terminals are used for signal input. The 10A input terminal is labeled to remind the operator that the maximum current measured between these two terminals is 10A and that the function is not fuse protected.

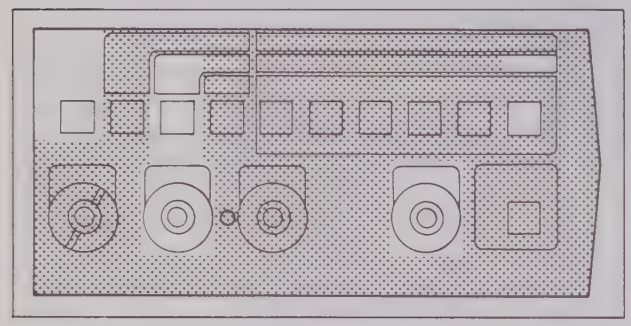

Figure 1-4. 10A Current Measurement

1-30. Resistance Measurements

1-31. The controls and terminals used for making resistance measurements are highlighted in Figure 1-5. The measurement function is selected by the Ω/S switch. The tan decal extends up and to the right with the six ranges of resistance in the standard resistance function labeled in this band over their respective range switches. The COMMON and V/Ω/S terminals are used for signal input.

1-32. Let's use the following procedure to exercise the resistance function and see how the range switches affect the position of the decimal point on the display.

1. Select the resistance function, 2000 kΩ range.

2. The LCD should display an overrange indication, a 1 with the three right hand digits blank.

3. Connect the test leads to the input terminals, black lead to COMMON and red lead to V/Ω/S.

4. Make a firm connection between the sampling ends of the test leads. The LCD should count down to a reading of 000.

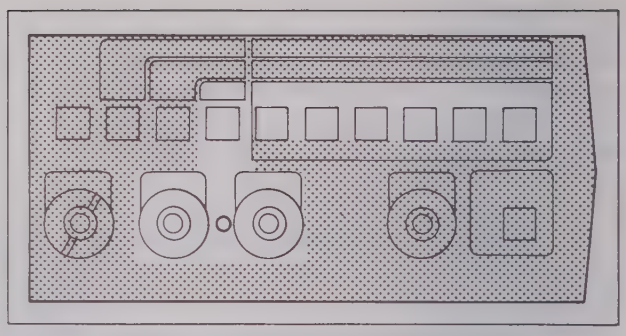

Figure 1-5. Resistance Measurement

5. Maintaining a firm contact between the sampling ends of the test leads, sequentially select the ranges starting with the 200Ω range switch. The decimal point for each should be as follows:

200Ω	00.0*	200 kΩ	00.0
2 kΩ	.000	2000 kΩ	000
20 kΩ	0.00	20 MΩ	0.00

*Display may display .1 or .2Ω of lead resistance.

1-33. Conductance Measurements

1-34. The controls and terminals for making conductance measurements are highlighted in Figure 1-6. With the exception of the selection of range, the controls and connections are exactly the same as for resistance measurements. There are three ranges of conductance. Each range is selected by simultaneously pushing in two range switches. The pairs of range switches required are indicated by the three decals below the range switches.

1-35. SPECIFICATIONS

1-36. Detailed specifications for both the D 810 and the D 811 are given in Table 1-1.

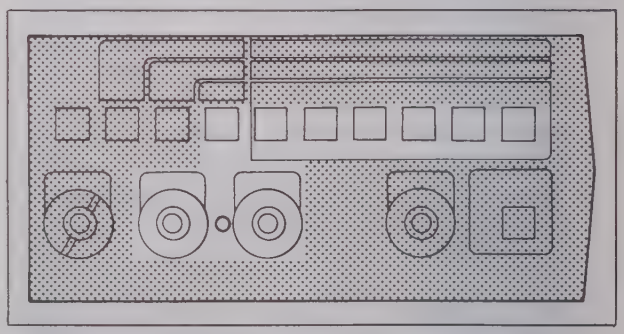

Figure 1-6. Conductance Measurement

Table 1-1. D 810/D 811 Specifications

ELECTRICAL: The electrical specifications given assume an operating temperature of 18°C to 28°C, humidity up to 80%, and a 1-year calibration cycle.

FUNCTIONS: DC Volts, AC Volts, DC Current, Resistance and Conductance

DC VOLTS:

RANGE	RESOLUTION	ACCURACY for 1-Year
±200 mV	100 μV	±(0.1% of reading + 1 digit)
±2V	1 mV	
±20V	10 mV	
±200V	100 mV	
±1000V	1V	

INPUT IMPEDANCE: 10 MΩ, all ranges.

NORMAL MODE REJECTION RATIO: >60 dB at 60 Hz.

COMMON MODE REJECTION RATIO (1 kΩ unbalance): >90 dB at dc, and 60 Hz.

OVERVOLTAGE PROTECTION: 1000V dc or peak ac on all ranges.

RESPONSE TIME: 1 second.

AC VOLTS (TRUE RMS RESPONDING AC COUPLED):

RANGE	RESOLUTION	ACCURACY: from 5% of range to full scale, 1-Year			
		45 Hz to 1 kHz	45 Hz to 10 kHz	10 kHz to 20 kHz	20 kHz to 50 kHz
200 mV	100 μV	±(0.5% of reading + 2 digits)		±(1.0% of reading +2 digits)	±(5% of reading +3 digits)
2V	1 mV				
20V	10 mV				
200V	0.1V				
750V	1V	±(0.5% of reading +2 digits)			

VOLT-Hz PRODUCT: 10^7 max (200V max @ 50 kHz).

EXTENDED FREQUENCY RESPONSE: Typically ±3 dB at 200 kHz.

COMMON MODE NOISE REJECTION RATIO (1 kΩ unbalance): >60 dB at 60 Hz.

CREST FACTOR RANGE: 1.0 to 3.0.

INPUT IMPEDANCE: 10 MΩ in parallel with < 100 pF.

OVERLOAD PROTECTION: 750V rms or 1000V peak continuous not to exceed the volt-hertz product of 10^7 (except 10 seconds maximum on 200 mV, 2V ranges).

RESPONSE TIME: 2 seconds maximum within a range.

Table 1-1. D 810/D 811 Specifications (cont)

DC CURRENT:

RANGE	RESOLUTION	ACCURACY for 1-Year	BURDEN VOLTAGE
20 μA	0.1 μA	±(0.3% of reading +1 digit)	0.3V max.
2 mA	1 μA		
20 mA	10 μA		
200 mA	100 μA		
2000 mA	1 mA		0.9V max.
10A	10 mA	±(0.5% of reading +1 digit)	0.5V max.

OVERLOAD PROTECTION: 2A/250V fuse in series with 3A/600V fuse (for high energy sources); 10 ampere range not fused, 12A maximum.

AC CURRENT (TRUE RMS RESPONDING AC COUPLED):

RANGE	RESOLUTION	ACCURACY: from 5% of range to full-scale, 1-Year			BURDEN VOLTAGE
		45 Hz to 2 kHz	45 Hz to 10 kHz	10 kHz to 20 kHz	
200 μA	0.1 μA	±(1% of reading +2 digits)		±(2% of reading +2 digits)	0.3V rms max.
2 mA	1 μA				
20 mA	10 μA				
200 mA	100 μA				
2000 mA	1 mA	±(1% of reading +2 digits)			0.9V rms max.
10A	10 mA				0.5V rms max.

OVERLOAD PROTECTION: 2A/250V fuse in series with 3A/600V fuse (for high energy sources); 10 ampere range not fused, 12A maximum.

CREST FACTOR RANGE: 1.0 to 3.0.

RESISTANCE:

RANGE	RESOLUTION	ACCURACY: for 1-Year	FULL-SCALE VOLTAGE	MAXIMUM TEST CURRENT
200 Ω	0.1Ω	±(0.2% of reading +1 digit)	<0.25V	1.3 mA
2 kΩ →|	1Ω		>1.0V	1.3 mA
20 kΩ	10Ω		<0.25V	10 μA
200 kΩ →|	100Ω		>1.0V	35 μA
2000 kΩ	1 kΩ	±(0.5% of reading +1 digit)	<0.25V	0.10 μA
20 MΩ →|	10 kΩ		>1.5V	0.35 μA

OVERLOAD PROTECTION: 500V dc/ac rms on all ranges.

OPEN CIRCUIT VOLTAGE: Less than 3.5V on all ranges.

RESPONSE TIME: 1 second, all ranges except 2000 kΩ and 20 MΩ ranges - 4 seconds these two ranges.

Table 1-1. D 810/D 811 Specifications (cont)

DIODE TEST: ⊣▶|

These three ranges have enough voltage to turn on silicon junctions to check for proper forward-to-back resistance. The 2 kΩ range is preferred and is marked with a larger diode symbol on the front panel of the instrument. The three non-diode test ranges will not turn on silicon junctions for in-range readings and therefor are capable of making in-circuit resistance measurements.

CONDUCTANCE:

RANGE	RESOLUTION	ACCURACY: for 1-Year	OPEN CIRCUIT VOLTAGE	MAXIMUM TEST CURRENT
2 mS	1 μS	±(0.4% of reading +1 digit)	<3.5V	1.3 mA
20 μS	10 nS		<1V	10 μA
200 nS	.1 nS	±(1% of reading +10 digits)	<1V	0.10 μA

OVERLOAD PROTECTION: 500 dc/ac rms on all ranges.

CONDUCTANCE UNITS: We use the international unit of conductance, the Siemen= S = 1/Ω. Another unit of conductance is the mho.

ENVIRONMENTAL:

TEMPERATURE COEFFICIENT: 0.1 times the applicable accuracy specification per °C for 0°C to 18°C and 28°C to 50°C (32°F to 64.4°F and 82.4°F to 122°F).

OPERATING CONDITIONS:

TEMPERATURE: (32 to 122 degree F) 0 to 50° C.

RELATIVE HUMIDITY: 0 to 80%, 0 to 35° C (32 to 95° F).
0 to 70%, 35-50° C (95 to 122° F).

STORAGE CONDITIONS:

TEMPERATURE: (D810): -40 to +60° C (-40 to +140° F).
(D811): -40 to +50° C (-40 to +122° F).

RELATIVE HUMIDITY: 0 to 90%, -40 to 50° C (-40 to +122° F).
0 to 90%, 50 to 60° C (122 to 140° F).

GENERAL:

MAXIMUM COMMON MODE VOLTAGE: 500V dc/or peak ac.

POWER REQUIREMENTS:

D810 90-132V, 50 or 60 Hz; 100-132V, 400 Hz; 2 watts.

D811 90-132V, 50 or 60 Hz; 100-132V, 400 Hz; 3.5 watts.
Batteries:
Type: NiCAD.
Operating Time: 15-40 Hrs depending on functions used.
Recharge Time: 14 Hrs with power switch off.

SIZE: 22 cm by 6 cm by 25 cm (8-1/2" by 2-1/2" by 10").

WEIGHT:

D810 1.08 kg (2 lb. 6 oz.).

D811 1.42 kg (3 lb. 6 oz.).

Section 2
Operating Instructions

2-1. INTRODUCTION

2-2. To use your Fluke multimeter fully, there are some additional factors to be considered. This section of the manual gives that information in the operating notes. Also included are some applications you may find useful. For example, a simple device plugged into your instrument will provide direct reading dc-current gain (Beta) measurements for both NPN and PNP transistors.

2-3. OPERATING NOTES

2-4. The operating notes contain information about measurement considerations, peculiarities of your instrument and some simple maintenance procedures. Every person using your instrument should be familiar with these operating notes.

2-5. Input Power

2-6. Both the D 810 and the D 811 can be operated from the AC power line. The D 811 can also be operated from the internal rechargeable batteries. The batteries are being charged whenever the instrument is connected to AC line with the power switch off.

2-7. Display Readings

NOTE

The liquid crystal display used in your instrument is rugged and reliable. With proper care, it will give you years of satisfactory service. The chemicals that make this advanced type of display possible require certain practices. To extend the life of the display and to make sure that the display will be ready to operate at a moment's notice, observe the following practices:

1. Protect the display from extended exposure to bright sunlight.

2. Keep the instrument out of high temperature and high humidity environments such as the dashboard of a car on a hot, sunny day.

3. Keep the instrument out of low temperature environments. Operation or storage at temperatures below -15° C (5° F) may result in the display being sluggish until the instrument is returned to normal operating temperature.

2-8. The display on your meter will provide continuous readings during normal operation and indicate an overrange (overload) condition. The overrange indication is a 1 followed by three blank digits. (A decimal point may be present, depending upon the range selected.) This overrange indication doesn't necessarily mean that the input will damage your instrument. For example, when measuring resistance the overrange indication is displayed to indicate an open input condition.

2-9. During normal operation, the display will be between zero and 1999. The position of the decimal point is determined by the range selected and is not affected by the measurement function selected. An indication of polarity is valid for voltage and current measurements. The minus sign indicates that the input voltage or current is negative with respect to the COMMON input terminal. Voltage or current inputs that are positive with respect to COMMON are indicated by the absence of a minus sign.

2-10. There are two other conditions that will cause the negative sign to be displayed. Neither indicates a valid display. When your instrument comes out of an overrange condition, the minus sign may flash momentarily. This is most likely seen when reading resistance. When the test leads are not connected to anything, the meter will indicate

an open condition (overrange indication). When the test leads are connected to an in range resistance, the meter will come out of the overrange condition and the minus sign may flash. If you are reading resistance and the minus sign remains on, there is still energy in the circuit being measured. The circuitry may still have power applied, a capacitor may still be charged, etc. You will only get this indication of an energized circuit if the voltage in the circuit is negative with respect to the COMMON input terminal. If the voltage in the circuit is positive with respect to the COMMON input terminal, an erroneous resistance will be displayed. If there is any doubt about whether there is energy remaining in the circuit you are reading, read the resistance, then reverse the test lead positions. If a minus sign is displayed in either case, the remaining energy must be removed from the circuit before correct resistance readings can be made.

2-11. Input Connections to Common

WARNING

TO AVOID ELECTRICAL SHOCK AND/OR INSTRUMENT DAMAGE DO NOT CONNECT THE COMMON INPUT TERMINAL TO ANY SOURCE OF MORE THAN 500 VOLTS DC OR PEAK AC ABOVE EARTH GROUND.

2-12. Your instrument can be operated with the COMMON input terminal at a potential above earth ground of up to 500V dc or 500V peak ac. If this limit is exceeded, instrument damage may occur. This may present a safety hazard to the operator - you.

2-13. Input Overload Protection

CAUTION

Exceeding the maximum input overload limits can damage your instrument. The transient overload protection circuit is intended to protect against short duration high energy pulses. The components used limit the protection to approximately five pulses per second for 6 kV, 10 microsecond pulses, and about 0.6 watts average for lower pulses. Fast rep rate pulses as from a TV set can damage the protection components; RV1-RV3, R1, and R2, if replaced, use only Fluke replacement parts to maintain product safety.

2-14. There are protection circuits for each measurement function and its associated ranges. Table 2-1 lists the overload limits for each function and range.

Table 2-1. Input Overload Limits

FUNCTION SELECTED		RANGE SELECTED	INPUT TERMINALS	MAXIMUM INPUT OVERLOAD
V	DC	ALL RANGES	V/Ω/S and COMMON	1000 Vdc or peak ac
	AC	20V, 200V, 750V		750V rms continuous
		2V, 200 mV		750 rms for no longer than 10 seconds
mA	DC or AC	ALL RANGES	mA and COMMON	Double fuse protected (2A, 250V fuse in series with a 3A, 600V fuse) when measurements are made in circuits having open circuit voltage of 600V or less.
10A		N/A	10A and COMMON	12A maximum. Not fused.
Ω or S		ALL RANGES	V/Ω/S and COMMON	500 dc or ac rms.

2-15. Fuse Replacement

2-16. The mA input of your meter is protected by a 2A, 250V fuse in series with a 3A, 600V fuse. If measurements are made where the current exceeds two amps, one or both fuses may blow. The fuses may be checked from the front panel as follows:

1. Complete the set up steps for the DC volts function and select the 2V DC range.

2. Touch the red test lead to the mA input jack so that the V-Ω-S input and the mA input are connected together.

3. If the display reads approximately .700 volts, both fuses are good.

4. If the display reads zero, one or both fuses need replacement.

5. The 2A/250V fuse located behind the front panel should blow first. Use the following procedure to change it:

   a. Disconnect the test leads.

   b. Insert a large coin or your thumbnail in the slot in the collar of the mA input terminal.

   c. Turn the collar about 1/4 turn counterclockwise. (The direction shown by the arrow to the left of the mA input terminal). The collar should pop out about 1 cm.

   d. Pull the collar out of the instrument. The 2A/250V fuse is in the holder on the back of the collar. Replace it with an AGX 2A/250V fuse or the European equivalent (see Section 5).

   e. Insert the collar/fuse assembly back into the front panel.

   f. With your fingertip, push the collar all the way into the front panel and turn it clockwise until the collar will turn no farther (about 1/4 turn).

6. The 3A/600V fuse is located in a clip holder on the Main PCB inside the instrument. See Section 4 for replacement instructions.

2-17. Making Voltage Measurements

2-18. In Section 1, we discussed the operation of the controls and terminals used to make voltage measurements. To use your instrument effectively, there are other factors of which you should be aware. Some of these factors will not normally affect your instrument and will be covered later as AC Measurement Considerations.

2-19. Your instrument has five ac voltage and five dc voltage ranges: 200 mV, 2V, 20V, 200V and either 750V ac or 1000V dc. All of these ranges present an input impedance of 10 MΩ. On the ac ranges, this input impedance is shunted by less than 100 pF. When you make the voltage measurements, be sure you do not exceed the overload limits listed in Table 2-1.

2-20. CONVERTING VOLTAGE MEASUREMENTS

2-21. Your instrument is one of the family of Fluke meters that actually measure the true rms value of an ac signal. This is a feature that allows accurate measurement of standard waveforms like distorted or mixed frequency sine waves, square waves, sawtooths, noise, pulse trains (with a duty cycle of at least .1), etc. In the past, the methods of ac measurement used have introduced large errors in the readings. Unfortunately, we've all grown used to these erroneous voltage readings and depend upon them to indicate whether or not a piece of equipment is working correctly. The data contained in Figure 2-1 should help you to convert between different measurement methods for the waveforms shown.

2-22. CIRCUIT LOADING ERROR

2-23. Connecting any voltmeter to a circuit changes the operating voltage of the circuit (loads the circuit down). As long as the circuit resistance (source impedance) is small compared to the input impedance of the meter, the error is not significant. For example, when measuring voltage with your meter, as long as the source impedance is 10 kΩ or less, the error will be $\leq$ 0.1%. If circuit loading does present a problem, the percentage of error can be calculated using the appropriate formula in Figure 2-2.

2-24. COMBINED AC AND DC SIGNAL MEASUREMENT

2-25. The waveform shown in Figure 2-3 is a simple example of an ac signal riding on a dc level. To measure waveforms such as these, first measure the rms value of the ac component using the AC function of your meter. Measure the dc component using the DC function of your instrument. The relationship between the total rms value of the waveform and the ac component and the dc component is:

$$\text{RMS Total} = \sqrt{(\text{ac component rms})^2 + (\text{dc component})^2}$$

AC-COUPLED INPUT WAVEFORM	PEAK VOLTAGES		METERED VOLTAGES			DC AND AC TOTAL RMS
			AC COMPONENT ONLY		DC COMPONENT ONLY	
	PK-PK	0-PK	RMS CAL*	D 810 D 811		TRUE RMS = $\sqrt{ac^2 + dc^2}$
SINE 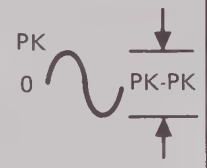	2.828	1.414	1.000	1.000	0.000	1.000
RECTIFIED SINE (FULL WAVE) 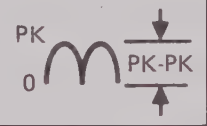	1.414	1.414	0.421	0.435	0.900	1.000
RECTIFIED SINE (HALF WAVE)	2.000	2.000	0.764	0.771	0.636	1.000
SQUARE	2.000	1.000	1.110	1.000	0.000	1.000
RECTIFIED SQUARE 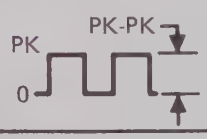	1.414	1.414	0.785	0.707	0.707	1.000
RECTANGULAR PULSE 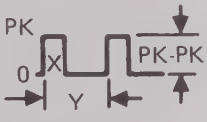 $D = X/Y$ $K = \sqrt{D - D^2}$	2.000	2.000	2.22K	2K	2D	$2\sqrt{D}$
TRIANGLE SAWTOOTH 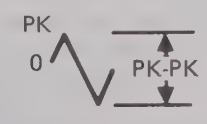	3.464	1.732	0.960	1.000	0.000	1.000

* RMS CAL IS THE DISPLAYED VALUE FOR AVERAGE RESPONDING METERS THAT ARE CALIBRATED TO DISPLAY RMS FOR SINE WAVES

Figure 2-1. Voltage Conversion

1. DC VOLTAGE MEASUREMENTS

Loading Error in % = $100 \times Rs \div (Rs + 10^7)$

Where: Rs = Source resistance in ohms of circuit being measured.

2. AC VOLTAGE MEASUREMENTS

First, determine input impedance, as follows:*

$$Zin = \frac{10^7}{\sqrt{1 + (2\pi F \cdot Rin \cdot C)^2}}$$

Where: Zin = effective input impedance
Rin = 10^7 ohms
Cin = 100×10^{-12} Farads
F = frequency in Hz

Then, determine source loading error as follows:*

$$\text{Loading Error in \%} = 100 \times \frac{Zs}{Zs + Zin}$$

Where: Zs = source impedance
Zin = input impedance (calculated)
Rs = source resistance

*Vector algebra required

Figure 2-2. Circuit Loading Error Calculations

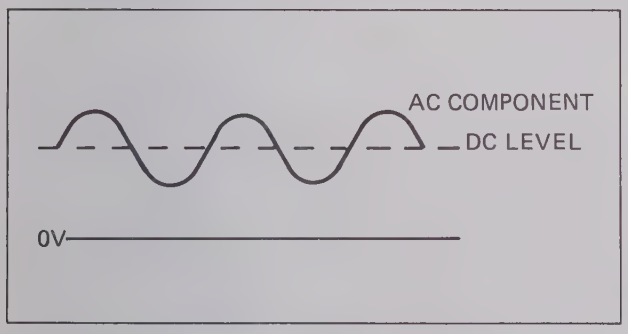

Figure 2-3. RMS Values

2-26. OFFSET

2-27. If you short the input of your meter while the AC voltage function is selected, you may have a reading of one or two digits on the display. This minute offset is caused by the action of amplifier noise and offset of the true rms converter. This offset will not significantly affect any readings until you try to measure signals almost at the floor of the meter. For example:

GIVEN: An offset over twice the normal maximum or offset = 5 digits.

Input signal = 10 mV
Total RMS = $\sqrt{(10)^2 + (.5)^2}$
= $\sqrt{100.25}$
= 10.01 mV

but the meter will read this as:

Total RMS = 10.0 mV

or using a realistic offset for your instrument,

GIVEN: offset = 2 digits.

Input signal = 1 mV
Total RMS = $\sqrt{1^2 + .2^2}$
= $\sqrt{1 + .04}$
= $\sqrt{1.04}$
= 1.02 mV

The meter will read this as 1.0 mV.

2-28. NOISE ERRORS

2-29. Many noise errors in dc voltage measurements are due to the line power frequency coupling into the circuit. Design features of your instrument have a noise rejection of approximately 60 dB (cut the noise to 1/1000 of its original level).

2-30. Making Current Measurements

2-31. Both the D 810 and D 811 have six ac and six dc current ranges: 200 μA, 2 mA, 20 mA, 200 mA, 2000 mA, and 10A. In both instruments, the five lower ranges are diode protected up to 2 amps and fuse protected above 2 amps. If either or both of the protective fuses blow, refer to the Fuse Replacement information presented earlier in this section. The 10A function is unfused, but will safely carry currents up to 12A.

2-32. When a meter is connected in series with a circuit to measure current, you may have to consider an error caused by the voltage drop across the meter (in this case, across the protective fuses and current shunts). This voltage drop is called burden voltage. The full scale burden voltages for your instrument are: 0.3V for the four lowest ranges, 0.9V for the 2000 mA range, and 0.5V for the 10A range. These voltage drops can affect the accuracy of a current measurement if the current source is unregulated and the resistance of the shunt and fuse represents a significant part (1/1000 or more) of the source resistance. If burden voltage does present a problem, the percentage error can be calculated using the formulae in Figure 2-4. This error can be minimized by selecting the highest current range that provides the necessary resolution.

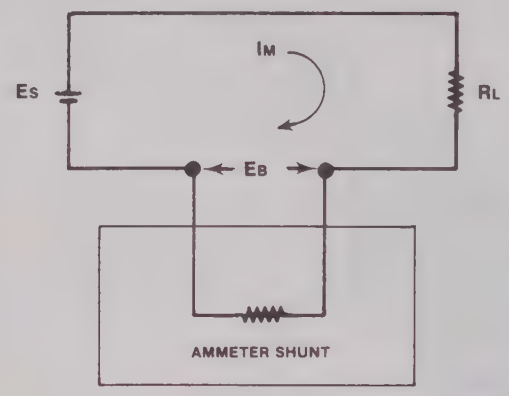

E_S = Source voltage
R_L = Load resistance + Source resistance
I_M = Measured current (display reading in amps)
E_B = Burden voltage (calculated), i.e.
Display reading expressed as a % of full scale (100 x $\frac{\text{READING}}{\text{FULL SCALE}}$) times full scale burden voltage for selected range. See table.

RANGE	F.S. BURDEN VOLTAGE
2 mA to 200 mA	0.3V
2000 mA	0.9V
10A	0.5V

Maximum current error due to Burden Voltage

$$\text{IN \%} = 100 \times \frac{E_B}{E_S - E_B}$$

$$\text{IN MILLIAMPS} = \frac{E_B \times I_M}{E_S - E_B}$$

Example: $E_S = 14V$, $R_L = 9\Omega$, $I_M = 1497mA$

$$E_B = 100 \times \frac{1497}{2000} \times 0.9 \text{ (from Table)} =$$

74.9% of 0.9 = 0.674V

$$\text{Maximum error in \%} = 100\,\frac{.674}{14-.674} = 100\,\frac{.674}{13.326} = 5.06\%$$

Increase displayed current by 5.06% to obtain true current.

$$\text{Error in milliamps} = \frac{.674 \times 1{,}497}{14-.674} = \frac{1009}{13.326} = 76mA$$

Increase displayed current by 76mA to obtain true current

Figure 2-4. Calculating Burden Voltage Error

2-33. Making Resistance Measurements

2-34. Both the D 810 and the D 811 have six direct reading resistance ranges: 200Ω , 2 kΩ , 20 kΩ , 200 kΩ , 2000 kΩ and 20 MΩ .

2-35. Your instrument uses the two wire measurement techniques, so the readings will be in error by the amount of the resistance of your test leads. A pair of standard test leads has a combined lead resistance on the order of 0.2Ω to 0.3Ω . This low resistance only effects readings on your meter in the ranges below 2 kΩ . The 200Ω range has no compensation for lead resistance. Short the sampling ends of the test leads together and read the lead resistance. When making resistance measurements, subtract the measured lead resistance and you will have an accurate resistance value.

2-36. The three resistance ranges with a diode symbol beside the range value have a high enough open circuit voltage to turn on a silicon junction. These ranges (2 kΩ , 200 kΩ , and 20 MΩ) can be used to check silicon diodes and transistors. The 2 kΩ range is preferred. It is marked with the largest diode symbol. On the other ranges, the in-range reading voltage is too small to turn on silicon junctions. Use these ranges to make in-circuit resistance measurements.

2-37. Making Conductance Measurements

2-38. There are three conductance ranges on your meter; 2 mS, 20μ S, and 200 nS. You can think of this function either as a new type of measurement or as another way to measure high resistances. As a high resistance meter, your Fluke offers many advantages over previous methods, including the ability to make these high resistance readings at voltages within the operating range of IC's and MOS devices. As a conductance meter, your instrument can measure directly inverse function components. For example, the resistance of a photo-diode decreases as the available light increases. When using conductance, both parameters change together allowing easier, less error prone applications. The display is in conductance units, Siemens. If resistance readings are desired, refer to the conductance-to-resistance conversion information in Figure 2-5.

2-39. The 200 nS range can be used for making resistance measurements from 5 MΩ to 10,000 MΩ . Since conductance is the inverse of resistance, as the resistance measured increases, accuracy and measurement decrease so resolution noise problems decrease. Using a standard high-resistance meter in this range requires careful shielding to prevent noise pick-up. With your meter, standard test leads are all you need. Except for high voltage stress testing, this range of conductance replaces the megger and can be used to check high value resistors and low leakage

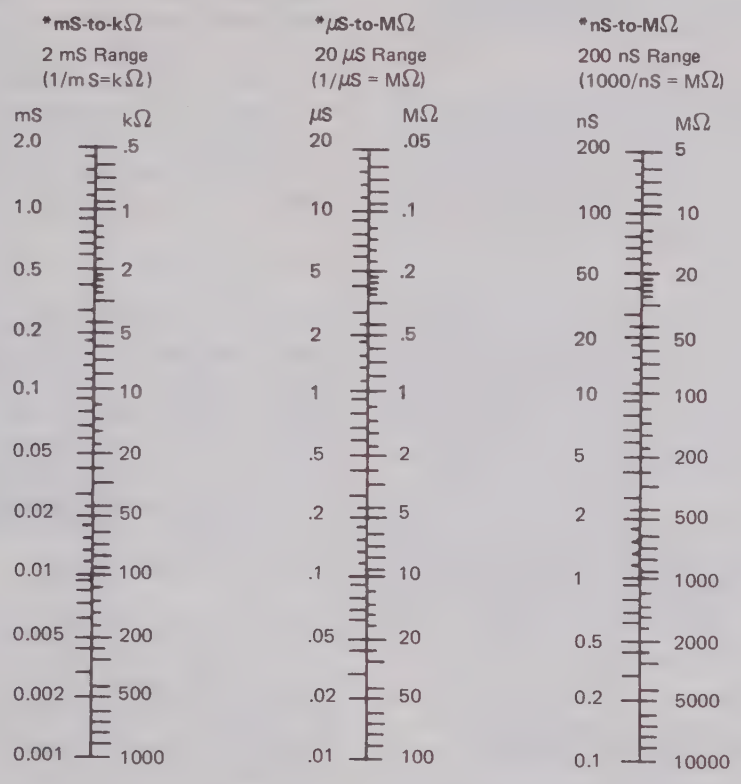

Conversion Scales

** S = siemens = 1/Ω = International unit of conductance fomerly known as the mho.*

Find the approximate resistance value using one of the conversion scales. Then, on the Interpolation Table, locate the most significant digit of the display reading on the vertical NO. column, and the next digit on the horizontal NO. row. The number at the intersecting coordinates represents the unknown resistance value. For example, a reading of 52.0 nS is equal to 19.2 MΩ. Decimal point location is determined from the scale approximation.

Interpolation Table (1/no.)

NO.	.0	.1	.2	.3	.4	.5	.6	.7	.8	.9
1	1	.909	.833	.769	.714	.667	.625	.588	.556	.526
2	.500	.476	.455	.435	.417	.400	.385	.370	.375	.345
3	.333	.323	.313	.303	.294	.286	.278	.270	.263	.256
4	.250	.244	.238	.233	.227	.222	.217	.213	.208	.204
5	.200	.196	.192	.187	.185	.182	.179	.175	.172	.169
6	.167	.164	.161	159	.156	.154	.152	.149	.147	.145
7	.143	.141	.139	.137	.135	.133	.132	.130	.128	.127
8	.125	.123	.122	.121	.119	.118	.116	.115	.114	.112
9	111	.110	.109	.108	.106	.105	.104	.103	.102	.101

Figure 2-5. Conductance-to-Resistance Conversion

components like diodes or capacitors. For more information, refer to the Applications material presented later in this section.

2-40. The 20 μS range can be used for making resistance measurements from 50 kΩ to 100 MΩ. This range of conductance is the one best suited for measuring inverse resistance components such as phototransistors. For more information, refer to the Applications material presented later in this section.

2-41. The 2 mS range can be used for making resistance measurements from 500Ω to 1 MΩ. It can be used either for resistance measurements or for such things as direct-reading dc current gain (Beta) measurements on transistors. Beta measurement require a special test fixture presented in the Applications material later in this section.

2-42. The three conductance ranges span resistance measurements of 500Ω to 10,000 MΩ. When using Ohm's law to determine current or power, it is sometimes necessary to divide by the resistance of the circuit or component. You may find it more convenient to measure conductance and multiply.

2-43. AC Measurement Considerations

2-44. When making precise measurements of ac signals, there are special parameters that must be considered such as the type of ac converter the meter uses (average, rms, etc.), crest factor, bandpass, noise, etc.

2-45. TRUE RMS

2-46. In order to compare dissimilar waveforms or calculate Ohm's law statements, or power relationships, you must know the effective value of a signal. If it is a dc signal, the effective value equals the dc level. If the signal is ac, however, we have to borrow the root mean square technique from the world of statistics in order to find the effective value of the signal. In electronics, this effective value is called the root mean square or rms value of the signal. Classically, the rms value of a current or voltage is defined as being numerically equal to the dc current or voltage that produces the same heating effect in a given resistance that the ac current or voltage produces.

2-47. In the past, average responding converters were the type of converter most widely used. Theoretically, the rms value of a sine wave is $1/\sqrt{2}$ of peak value and the average value is $2/\pi$ of the peak value. Since the meters converted to the average value, the rms value was $1/\sqrt{2} \div 2/\pi = \pi/2\sqrt{2} = 1.11$ of the average value when measuring a sine wave. Most meters used an average responding converter and multiplied by 1.11 to present true rms measurements of sine waves. As the signal being measured deviated from a pure sine wave the errors in measurement rose sharply. Signals such as square waves, mixed frequencies, white noise, modulated signals, etc. could not be accurately measured. Rough correction factors could be calculated for ideal waveforms if the signal being measured was distortion free, noise-free, and a standard waveform. The true rms converter in your meter provides direct, accurate measurement of these and other signals.

2-48. CREST FACTOR

2-49. Crest factor range is one of the parameters used to describe the dynamic range of a voltmeter's amplifiers. For an ac coupled voltmeter like the D 810 or D 811, the crest factor of a waveform is the ratio of the peak to the rms voltage with the dc component removed. In waveforms where the positive and negative half cycles have different peak voltages, the higher voltage is used in computing crest factor. Crest factors start at 1.0 for a square wave (peak voltage equals rms voltage).

2-50. Your instrument has a crest factor range of 1.0 to 3.0. If an input signal has a crest factor of 3.0 or less, voltage measurements will not be in error due to crest factor limitations. If crest factor of a waveform is not known and you wish to know if it falls within the crest factor range of your meter, measure the signal with both your meter and an ac coupled oscilloscope. If the rms reading on your meter is 1/3 of the peak voltage on the waveform or less, then the crest factor is less than 3.0.

2-51. The waveforms in Figure 2-6 show signals with increasing values of crest factor. As you can see from the series of waveforms, a signal with a crest factor above 3.0 is unusual.

2-52. Rectangular waves, as usual, have their own special formula. It is:

$$\text{Crest Factor} = \sqrt{1/D - 1}$$

Where D = duty cycle or the ratio of pulse width to cycle length. Using this formula backwards, we find that your meter can accurately measure pulse trains with a duty cycle above 10% without being limited by crest factor.

$$\begin{aligned} \text{Crest Factor} = 3.0 &= \sqrt{1/D - 1} \\ 9.0 &= 1/D - 1 \\ 10.0 &= 1/D \\ D &= 1/10 = 10\% \end{aligned}$$

2-53. BANDWIDTH

2-54. Bandwidth defines the range of frequencies where the response by the voltmeter's amplifiers is no more than 3 dB down (half power levels). Your instrument has a bandwidth of up to 200 kHz on the 200 mV and 20V ranges and

WAVEFORM	CREST FACTOR
SQUARE WAVE	1.0
SINE WAVE	1.414
TRIANGLE SAWTOOTH	1.732
MIXED FREQUENCIES	1.414 to 2.0
SCR OUTPUT OF 100% – 10%	1.414 to 3.0
WHITE NOISE	3.0 to 4.0
PULSE TRAIN (t_0, T, t_0 = 1/10 T)	3.0
SPIKE	> 9.0

Figure 2-6. Crest Factor

at least twice that on the 2V and 200V ranges. For brevity, let's call the bandwidth of your meter 200 kHz for these discussions.

2-55. SLEW RATE

2-56. Slew rate is also called the rate limit or the voltage velocity limit. It defines the maximum rate of change of the output of the amplifiers for a large input signal.

2-57. RISE AND FALL TIME EFFECT ON ACCURACY

2-58. The rise and fall times of a waveform are the length of time it takes a waveform to change between the points that are 10% and 90% of the peak value. When discussing these periods, we'll only mention rise time. Errors due to rise or fall time can be caused either by bandwidth of slew rate limitations. Slew rate should not affect your measurement with either the D 810 or the D 811.

2-59. A good rule-of-thumb for converting the effects of bandpass into a rise time limit is to divide 0.35 by the high frequency value at the 3 dB point. For your instrument this will be 0.35/200k = 1.75μ sec. The following example will help you to calculate errors due to this limitation when measuring rectangualr pulses. These calculations will be rough because ideal waveforms are used in the analysis.

2-60. Ideally, the rectangular pulses would have zero rise and fall times and would be the right angled waveform shown in Figure 2-7, Part A. In practice, every waveform has a rise and fall time and looks more like the waveform in Figure 2-7, Part B. When calculating the error caused by the bandpass of your instrument, we will assume worst case conditions, where the rise and fall times equal the effect caused by bandpass - 1.75μ sec. To do this, we will calculate the values for the theoretical signal with zero rise and fall times then calculate the values for a signal with the same period but with total slope periods equal to 1.75 μ sec. A comparison of the results will show the measurement error due to the bandpass.

2-61. Let's look at the waveform in Figure 2-7, Part B. When using your meter to measure the ac component of the signal, the display will indicate the rms value of the ac signal riding on the dc level. (This dc level is the average value of the waveform when considered from the baseline.) The total rms value of the waveform can be calculated using the relationship:

$$E_{total\ rms} = \sqrt{E_{ac\ rms}^2 + E_{dc}^2}$$

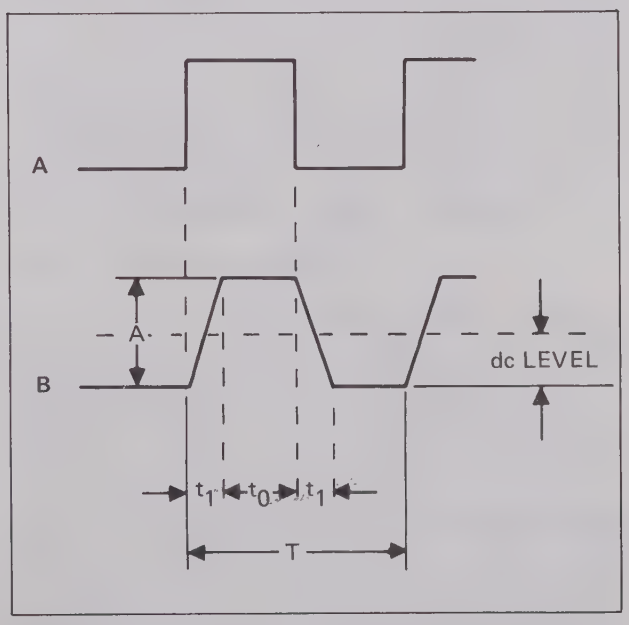

Figure 2-7. Components of a Rectangular Waveform

There are long established formulae for computing the dc level and total rms values. Using Figure 2-7, Part B, for a reference, these formulae are:

$$E \text{ total rms} = A \sqrt{\frac{3t_o + 2t_1}{3T}}$$

$$E \text{ dc} = A \left(\frac{(t_o + t)}{T}\right)$$

Since we can calculate two values, to find what your meter measures, use the formula:

$$E \text{ ac rms} = \sqrt{(E \text{ total rms})^2 - (Edc)^2}$$

2-62. For our example let's use a 10 kHz pulse train with 50μ sec pulses at a peak value of 1V. Ideally, the pulses would have a zero rise time as shown in Figure 2-8, A.

$$E \text{ total rms} = 1 \sqrt{\frac{3(50) + 2(0)}{3(100)}} = \sqrt{\frac{150 + 0}{300}} = \sqrt{\frac{1}{2}}$$

$$E \text{ total rms} = 0.707$$

$$E \text{ dc} = 1 \left(\frac{50 + 0}{100}\right) = \frac{50}{100} = 0.5$$

$$\text{So, the E ac rms} = \sqrt{(0.707)^2 - (0.5)^2} = \sqrt{0.50\text{-}0.25}$$

$$E \text{ ac rms} = \sqrt{0.25} = 0.5$$

When the maximum distortion in rise time of 1.75μ sec is assumed, the signal becomes the isoceles trapezoid waveform shown in Figure 2-8, Part B. In this case,

$$E \text{ total rms} = 1 \sqrt{\frac{3(48.25) + 2(1.75)}{3(100)}} = \sqrt{\frac{144.75 + 3.50}{300}}$$

$$E \text{ total rms} = \sqrt{\frac{148.25}{300}} = \sqrt{0.494} = 0.703$$

$$E \text{ dc} = 1 \left(\frac{48.25 + 1.75}{100}\right) = \frac{50}{100} = 0.50$$

$$\text{So, E ac rms} = \sqrt{(0.703)^2 - (0.50)^2} = \sqrt{0.494 - .25}$$

$$E \text{ ac rms} = \sqrt{0.244} = 0.494$$

Note that the E dc stayed the same.

So, the errors are:

In E total rms: - 0.6%
In E ac rms: - 1.2%

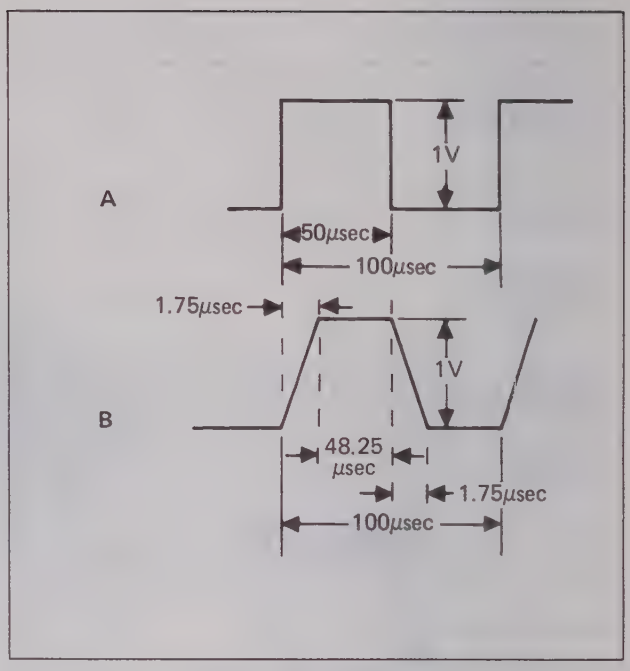

Figure 2-8. Example

2-63. OPERATION

2-64. Operation of your instrument is easy:

1. Set the POWER switch to ON.

2. Set the function and range switches to the correct position for the measurement being made. (Refer to Section 1.)

3. Connect the test leads to the appropriate terminals (Refer to Section 1.)

4. Contact the input signal with the sampling ends of the test leads and read the display.

5. For operating information on the battery equipped D 811, refer to Section 2.

2-65. APPLICATIONS

2-66. The test applications described in the following paragraphs are suggested as useful extensions of your meter's measurement capabilities. They are not meant to be the equivalent of manufacturer's recommended test methods. They are intended to provide you with repeatable, meaningful indications which will allow you to decide whether the device being tested is good, marginal, or defective.

2-67. Transistor Tester

NOTE

The transistor tester described in the following paragraphs provides approximate test information. Beta is measured using a VCE of about 2V and an I_C of about 200μ A. It is very useful for comparative measurements and matching.

2-68. Select the 2 mS range then plug the fixture shown in Figure 2-9 into the V-Ω-S and COMMON input terminals, and you have transformed your instrument into a transistor tester. Now, plug a transistor into the test socket and your meter will determine the following:

1. Transistor type (NPN or PNP).
2. Collector-to-emitter leakage (I_{CES}).
3. Beta from 10 to 1000 without changing range.

2-69. Transistor type is determined by setting the switch on the fixture to BETA and observing the display. If a very low reading (≤ 0.010) is obtained, reverse the test fixture at the input terminals. If the collector is now positioned at the COMMON input terminals, the transistor is a PNP type. An NPN type will have its collector positioned at the V-Ω-S input terminals. If the transistor is defective the indications will be as follows regardless of fixture position:

1. A shorted transistor will cause an overload indication.
2. An open transistor will read 0.001 or less.

2-70. After the transistor fixture is properly positioned, set the switch to I_{CES} for the leakage test. The transistor is turned off in this test (base shorted to emitter), and should appear as a very low conductance (high resistance) for collector-to-emitter. Therefore, the lower the reading, the lower the leakage. Silicon transistors that read more than 0.002 (6μ A) should be considered questionable.

2-71. Beta is determined by setting the fixture switch to BETA, and observing the display. Mentally shift the decimal point three places to the right and read beta directly. For example, a display reading of 0.127 indicates a dc current gain (beta) of 127.

NOTE

Beta is a temperature sensitive parameter. Therefore, repeatable readings can only be obtained by allowing the transistor to stabilize at the ambient temperature while being tested. Avoid touching the transistor's case with your fingers.

2-72. Leakage Tester

2-73. The 200 nS conductance range effectively extends the resistance measurement capability of the instrument (up to 10,000 MΩ) to the point where it can be used to provide useful leakage measurements on passive components. For example, you can detect leaky capacitors, diodes, cables, connectors, printed circuit boards (pcb's), etc. In all cases, the test voltage is <5V dc.

2-74. RESISTIVE COMPONENTS

2-75. Leakage testing on purely resistive components such as cables and pcb's is straight forward. Select the 200 nS range, install the test leads in the V-Ω-S and COMMON input terminals, connect the leads to the desired test points on the unit-under-test, and read leakage conductance. If an overrange occurs, select the resistance range that provides an on-scale reading.

NOTE

Under high humidity condition (>80%) conductance measurements may be in error. To ensure accurate measurement connect clean test leads to the instrument and (with the leads open) read the residual leakage in nanosiemens. Correct subsequent measurements by subtracting this residual from the readings. (Finger prints or other contamination on the pcb may also cause residual conductance readings.)

2-76. DIODES

2-77. Diode leakage (IR) tests require that the diode junction be reverse biased when being measured. This is accomplished by connecting the diode's anode to the COMMON input terminal and its cathode to the V-Ω-S input terminal. Leakage can then be read in terms of conductance. In the event of an overrange, select a resistance range that provides an on-scale reading.

2-78. Relative Light Meter

2-79. A photodiode or phototransistor soldered across a double banana connector can be plugged into the COMMON and V-Ω-S input terminals of your instrument. The 20μ S range on your instrument measures the inverse of the resistance range from 50 kΩ to 100 MΩ - the resistance range of most photodiodes and phototransistors. The resistance of the photo-sensitive device is inversely proportional to the available light. That is, as the available light increases, the resistance of the device decreases. By using conductance to keep track of the change in resistance, the readings are directly proportional to the change in available light. Experience will provide you with repeatable data ranges.

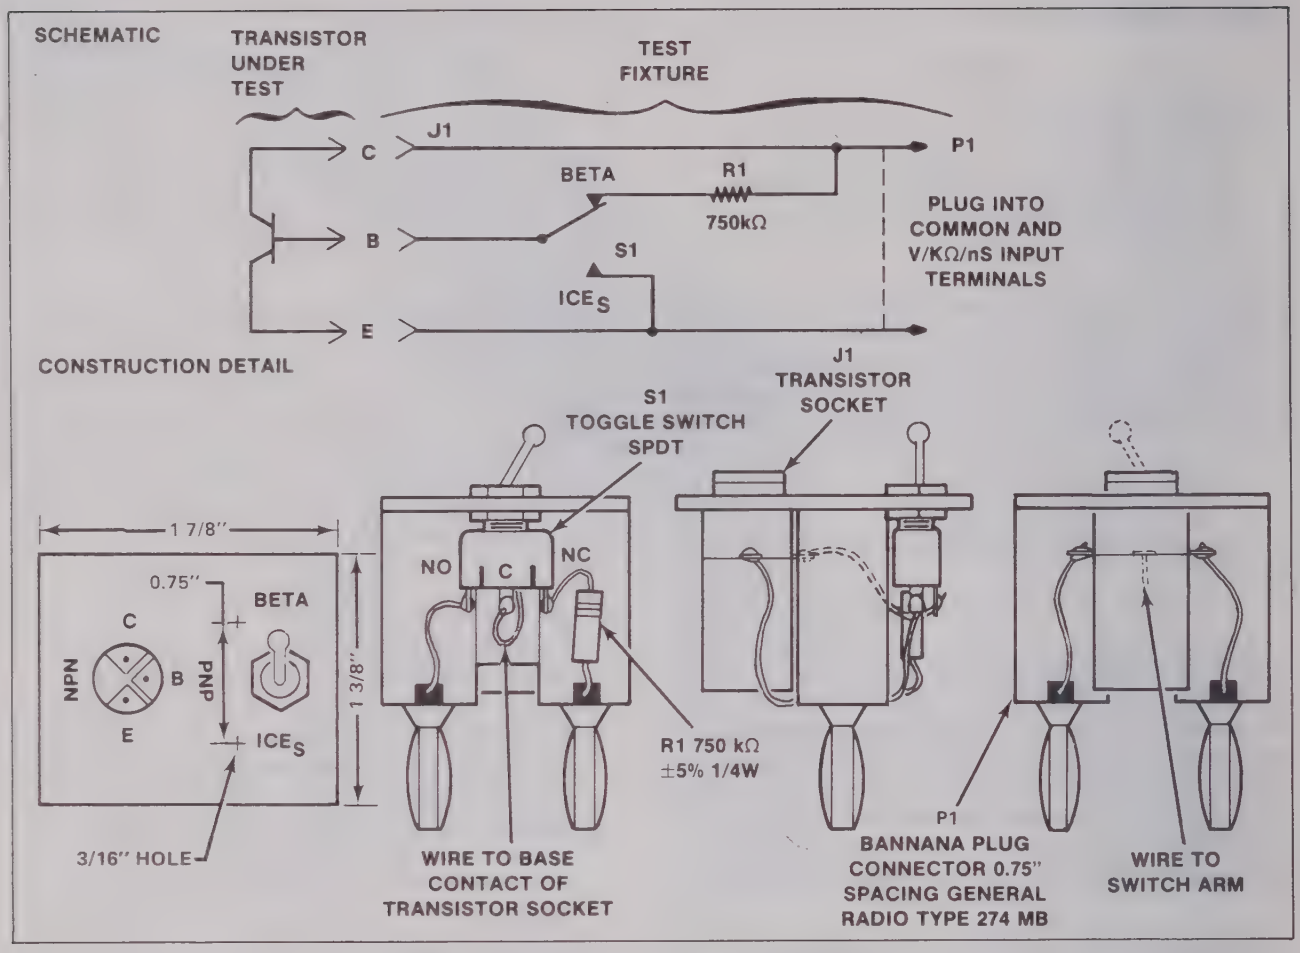

Figure 2-9. Transistor Beta Test Fixture

Section 3
Theory of Operation

3-1. INTRODUCTION

3-2. This section of the manual tells how your Fluke multimeter works. Even if you never repair or calibrate your own multimeter, understanding how it works will enable you to get the most out of your instrument. You'll find that the theory of operation is presented in two parts: a basic overall description of the functional sections of the instrument and a more detailed description of each functional section. The theory of operation of the battery powered D 811 is described in this Section.

3-3. BASIC DESCRIPTION

3-4. As Figure 3-1 shows, the heart of your Fluke multimeter is a digital voltmeter that can measure DC voltages from -2V to +2V or +200 mV to -200 mV very accurately. This voltmeter is composed of a custom IC and the LCD (Liquid Crystal Display). The custom IC contains an analog/digital converter, a controller, and the LCD drivers. An unknown analog voltage is converted to a digital representation by the a/d converter. The controller calculates the value of the input in units of the selected function and range and controls the a/d converter. The LCD drivers display the computed value of the unknown input on the LCD.

3-5. The input signal conditioners convert the various input signals into a DC voltage between ±2V or ±200 mV that is proportional to the input. The rest of the circuitry either protects the multimeter from overloads and transients or produces the basic operating voltages for the instrument.

3-6. DIGITAL VOLTMETER

3-7. The custom IC, U3, and the 3 1/2 digit LCD are the digital voltmeter that is the heart of your instrument. The custom IC contains an a/d converter, a digital controller, and the display logic for the LCD. To function properly, the IC, U3, depends upon some external components to establish basic timing and analog levels. Basic timing is established by a quartz crystal, Y1. Resistors, capacitors and an external voltage reference establish the analog levels for the a/d converter.

3-8. The digital voltmeter has two ranges of measurement. If you select either the 200 mV or 20V ranges or their equivalent ranges in other functions, the digital voltmeter can read voltages from -200 mV to +200 mV. Selection of any other range will enable the digital voltmeter to read +2V to -2V.

3-9. A/D Converter

3-10. The a/d converter uses the dual slope integration method. Dual slope integration takes advantage of the natural laws governing the charge and discharge of capacitors. Basically, in dual slope integration, an unknown voltage is applied to a capacitor for a specific length of time. Then a known voltage of the opposite polarity is applied to the capacitor and the time it takes for the capacitor to discharge is measured. The discharge time is proportional to the level of the unknown input voltage. This method is extremely accurate, fast and noise-free.

3-11. To see how your instrument performs dual slope integration, we'll assume a range selected that enables the ±2V measurement function of the internal voltmeter. Figure 3-2 contains a simplified schematic of the a/d converter at the top and a timing diagram at the bottom. The circled switches in the simplified schematic represent FET switches operated by the digital controller. These FET switches and the three operational amplifiers are located inside U3. All other components are external to U3. The timing diagram shows the operation of the FET switches for one conversion cycle with unknown voltage inputs of 1/2 range, full range and overrange. The conversion cycle is continuously repeated.

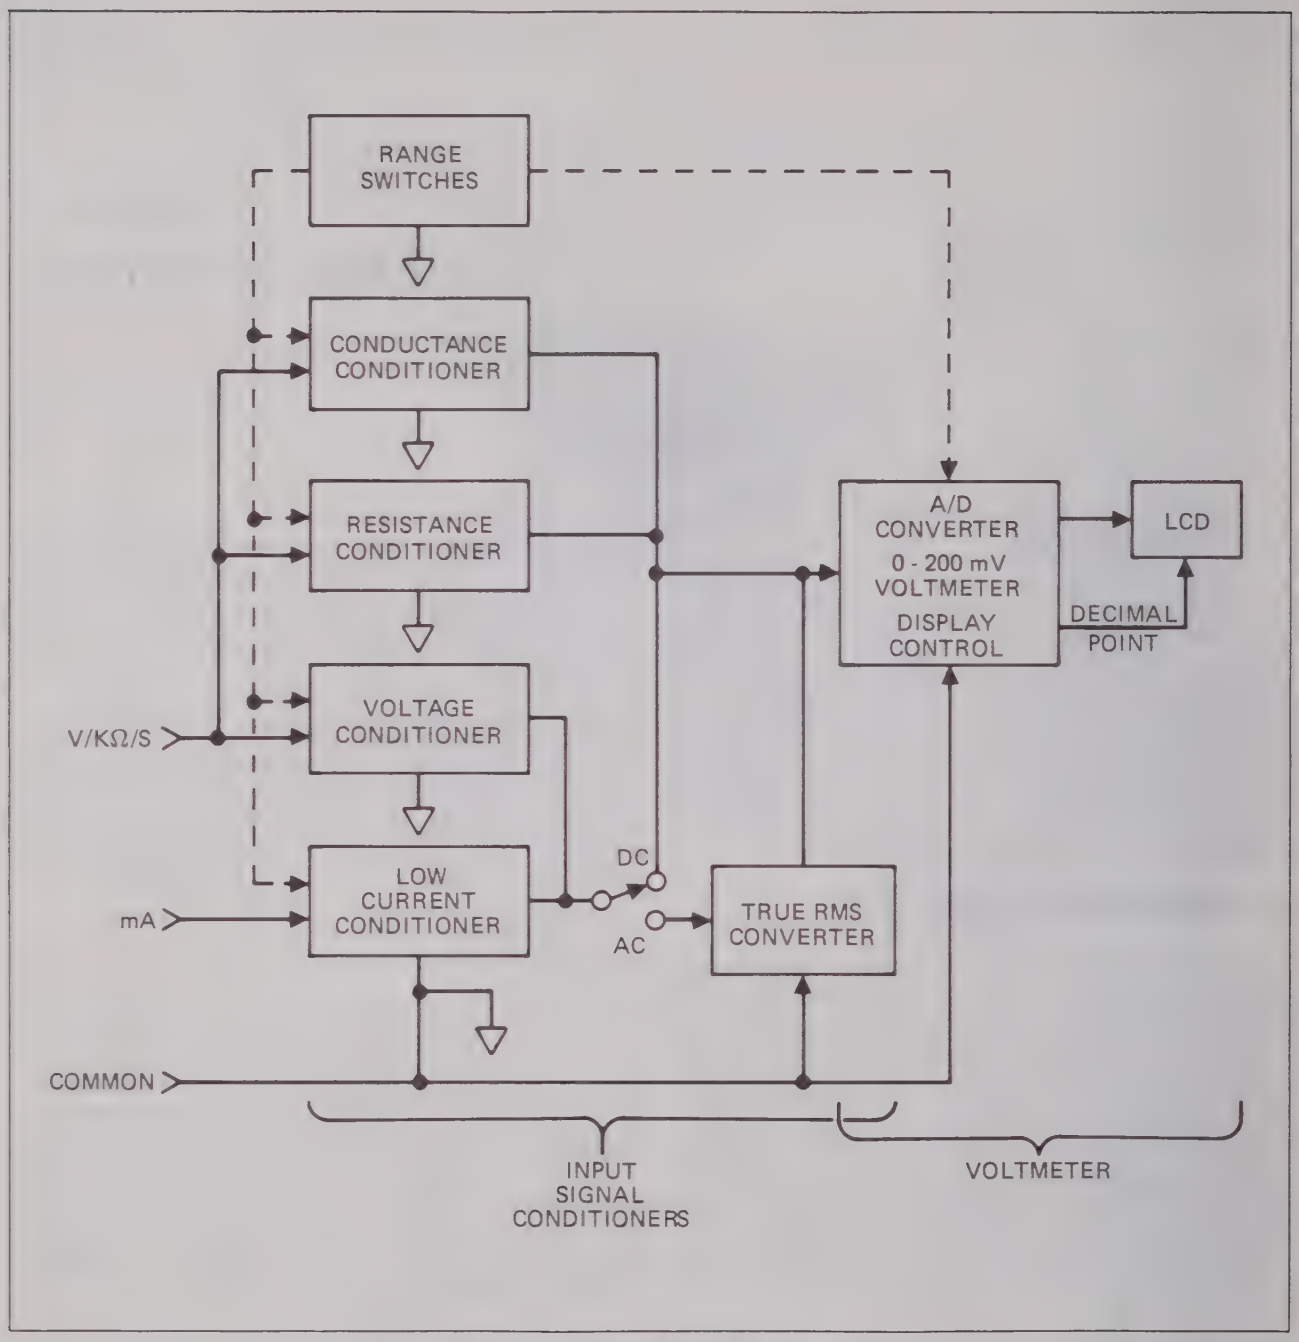

Figure 3-1. Basic Block Diagram

3-12. The basic clock frequency is 60 kHz. The 3.84 MHz from the quartz crystal is divided by 64 to produce the clock frequency. The timing diagram shown in Figure 3-2 uses the number of clock cycles counted as timing indicators. The conversion cycle is 20,000 cycles long or 1/3 of a second.

3-13. Let's put in an unknown voltage equal to 1/2 range and look at the a/d converter just before the integrate (INT) period begins. The auto-zero (AZ) is just ending so the a/d converter should be ready to receive a new input. The controller opens the AZ FETs and closes the INT FET. The input to the integrator and the comparator changes. The integration capacitor, C1, starts to charge. The comparator no longer has matched inputs so its output (CM) drops to a lower level. The integrate period lasts for a count of 1000. At the end of this time, the controller will open the INT FET and close the READ FET. At this time, C1 is charged to a level proportional to the level of the unknown input voltage.

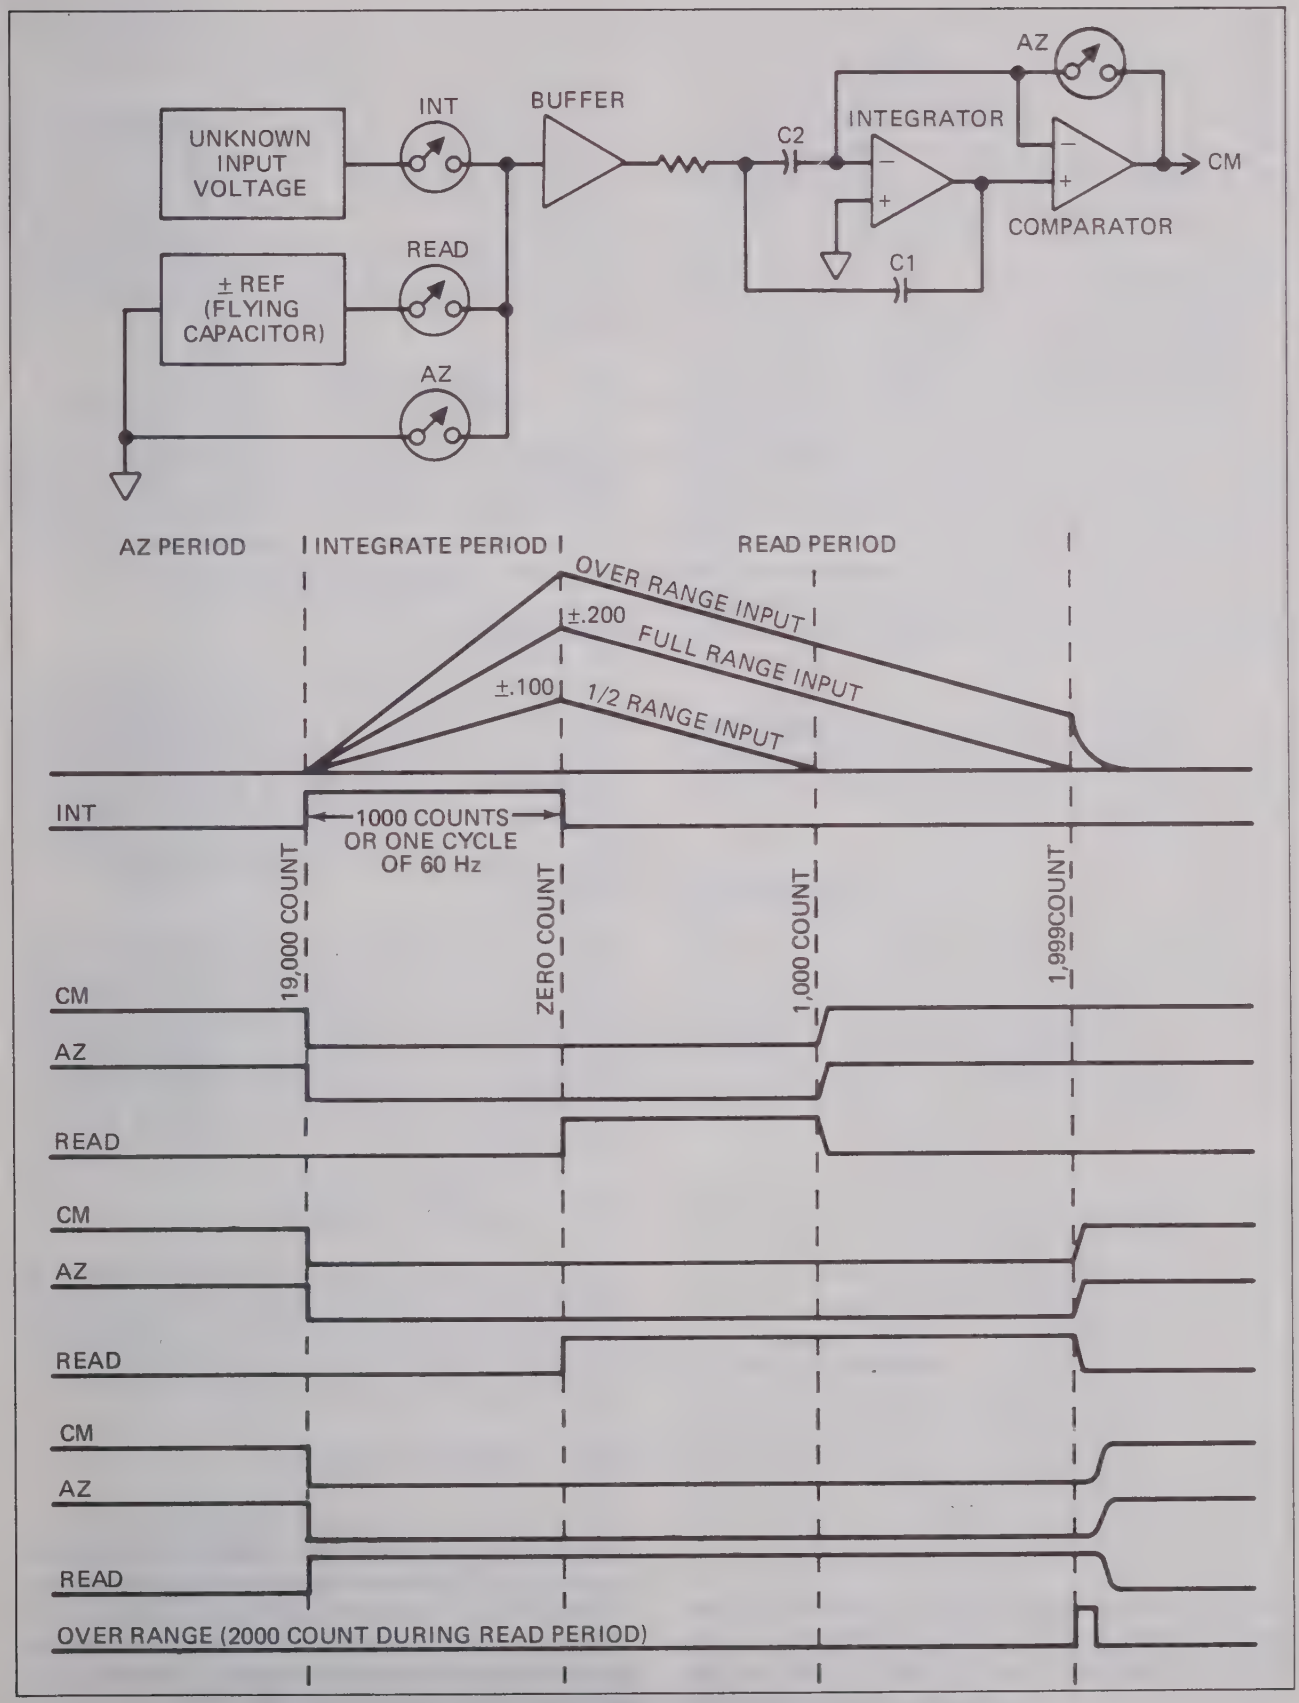

Figure 3-2. A/D Converter Simplified Schematic and Timing Diagram

3-14. Closing the READ FET applies the known reference voltage to the input of the integrator and the comparator. The polarity of this reference voltage is selected by the digital controller so that it is the opposite polarity of the unknown input voltage. C1 starts to discharge at a known rate. The digital controller starts to count clock pulses at the beginning of the read period. When C1 discharges to the level it was at when the integrate period started, the comparator reaches comparison and the CM level goes high. This CM level causes the controller to stop counting clock pulses, open the READ FET, and close the AZ FET. The controller now contains a digital count that is proportional to the level of the unknown input voltage. During the read period, the controller can count from 0 to 1999. Remember, when we discussed range, we rounded off to 2000 at the high end but it was actually 1999. Since we used an unknown input voltage equal to 1/2 range, the digital count will be 1000. The controller drives the display logic so that 1000 is displayed on the LCD. The location of the decimal point is determined by the position of the range switches. The LCD displays the unknown signal with the proper units.

3-15. Make the unknown input voltage equal full range. The read period is extended. At the time CM goes high, the digital controller has counted 1999 clock pulses. This is the maximum reading for any range.

3-16. Now, let's make the unknown input voltage some value that is greater than full range (overrange). Everything is normal until the digital controller counts 1999 clock pulses. At this time, C1 is still not discharged so the comparator output (CM) is still low. The digital controller counts one more clock pulse (2000 count). A count of 2000 generates an overrange pulse. This will display the overrange indication on the LCD and command the digital controller to start the auto-zero period.

3-17. During the auto-zero period, a ground reference is applied to the input of the a/d converter. Under ideal conditions, the output of the a/d converter would also go to zero. However, input-offset-voltage errors accumulate in the amplifier loop and appear at the comparator output as an error voltage. This error voltage is charged on C2 where it is stored for the rest of the conversion cycle. The stored level is used to provide offset voltage correction during the integrate and read periods. The auto-zero period starts at the end of READ and ends at the beginning of INT. The length of AZ can vary from a minimum of 17,000 counts (overrange) to a maximum of about 19,000 count (zero input).

3-18. The INT period is 1000 counts. With a clock frequency of 60 kHz, the INT period is exactly 1 cycle of 60 Hz long. We integrate all inputs to the a/d converter. So, the positive half cycle of the 60 Hz noise cancels out the negative half cycle of the 60 Hz noise. As we said before, this method is highly accurate, fast and noise-free.

3-19. If you select one of the ranges that enables the ±200 mV measurement function of the internal voltmeter, the a/d converter functions the same with two changes to the timing of the conversion cycle. The INT period is 10,000 counts long. Auto-zero is correspondingly shorter. At a clock frequency of 60 kHz, the 10,000 count length of the INT period means that it is 10 cycles of 60 Hz long. Noise is cancelled.

3-20. Digital Controller

3-21. The digital controller is an integral part of the custom IC. It uses the reference frequency from the crystal as the basic clock. It controls the a/d converter and LCD drivers. It also monitors for an overrange input and turns on the overrange indication when necessary.

3-22. Display

3-23. The LCD is located in a mounting bracket fastened to the Main PCB. Its drivers are contained inside the custom IC. Overrange indications and numerical values originate from the custom IC. The decimal point is controlled separately by the range switches and a CMOS IC.

3-24. INPUT SIGNAL CONDITIONERS

3-25. The a/d converter in your instrument needs an input voltage between -2V dc and +2V dc. Any other input will result in an overrange condition. If you are measuring a dc voltage that falls within this range, there is no problem - the input signal conditioners are not used, but your meter reads much higher voltages, current, ac signals, resistance and conductance. For these measurements, the input signal conditioners are used.

3-26. True RMS Converter

3-27. The rms converter in your Fluke meter is a hybrid circuit that converts the ac voltage from either the voltage or current conditioner into a dc voltage equal to the true rms value of the ac signal. This converter is designed to handle ac signals from 40 Hz to 50 kHz.

3-28. Voltage Conditioner

3-29. The voltage conditioner is a new design that provides wide bandpass with a very simple circuit. Part A of Figure 3-3 is a simplified schematic of the front end of your instrument when voltage measurements are being made. When either the 200 mV or the 2V range is selected, the input signal passes through the top range switch bypassing the voltage divider completely. (The appropriate

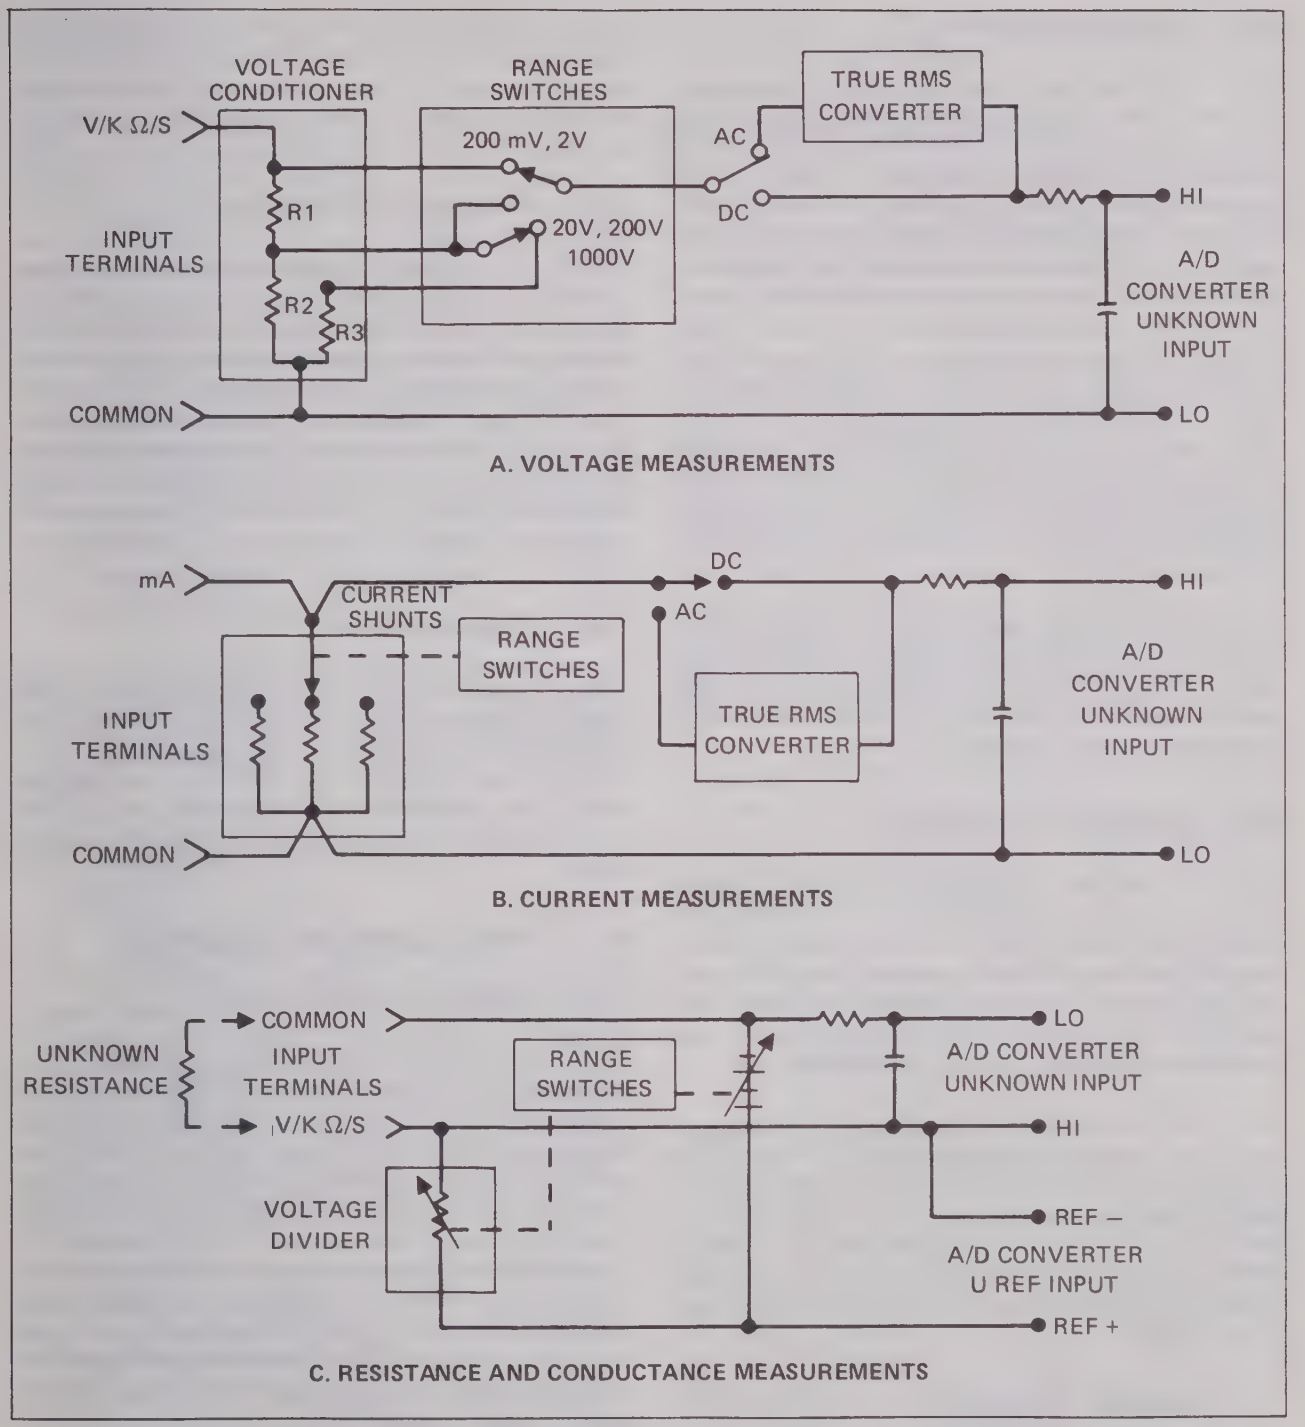

Figure 3-3. Input Signal Conditioners

measurement function of U3 will be enabled by the range switches too.) When either the 20V or 200V range is selected, the top range switch will be in the down position and the bottom range switch will be in the position shown. The portion of the input signal between R1 and R2 is used by your instrument. The voltage divider ratio is 1/100. Signals on the 20V range can now be measured by the 2V function of U3. When the 1000 VDC (750 VAC) range is selected, both range switches are in the down position. This places R3 in parallel with R2. The voltage divider ratio is now 1/1000. The input signals can now be measured by the 2V function of U3.

3-30. Current Conditioner

3-31. The current conditioner changes the current signal input into a voltage representation. This is done by passing the unknown current through a precision resistor and measuring the voltage developed across the resistor. If the proper resistance is selected, the voltage out of the current conditioner will be within the range required by the a/d converter. These resistors are a special type of high power precision resistors known as current shunts. (They route the current or shunt the current around the meter.) Part B of Figure 3-3 is a simplified schematic of your meter's front end when current measurements are being made. The range switches determine the combination of current shunts used for each range. The five current shunts are precisely 1000Ω, 100Ω, 1.00Ω and .100Ω. The position of the AC/DC switch will determine the route the voltage output of the current conditioner takes to reach the input of the a/d converter.

3-32. The 10 Amp function routes the current being measured from the 10A input jack through a special current shunt of 0.01Ω. The voltage developed across the shunt goes through the AC/DC switch just like the voltage output of the current conditioner.

3-33. Resistance Conditioner

3-34. The resistance conditioner is the same voltage divider used in voltage measurements. In measuring voltage or current the appropriate input signal conditioner did all the conversion of the input signal, the rest of the meter just measured the output of the signal conditioner. The resistance measurement is more complex. The resistance conditioner is just used as a reference resistor.

3-35. Your Fluke meter uses the ratio method to measure the value of an unknown resistance. Part C of Figure 3-3 is a simplified schematic of your instrument's front end when making resistance measurements. The reference resistor is placed in series with the unknown resistance and V SOURCE is applied across them. The ratio of the resistance equals the ratio of the voltage drops across the respective resistances:

$$\frac{R_{Unknown}}{R_{Reference}} = \frac{E_{Unknown}}{E_{Reference}}$$

If we use the a/d converter to measure the voltage ratio, the value of the unknown resistance can be calculated.

3-36. The voltage drop across the unknown resistance is applied to the HI and LO inputs of the a/d converter. The voltage drop across the reference resistor is used as the reference voltage for the a/d converter. The range switches select the reference resistance (from the voltage divider) and V SOURCE so that the inputs to the a/d converter stay within the proper range of U3. The reference resistance is designed so that the output of the a/d converter displayed on the LCD is the value of the unknown resistance.

3-37. Conductance Conditioner

3-38. The conductance conditioner is the same voltage divider that is used for measuring voltage or resistance. In fact, the whole method of measuring conductance is the same as for measuring resistance with one exception. The controller inside the custom IC commands the a/d converter to switch the unknown and reference voltage inputs. That is, the a/d converter will use the reference voltage during the integrate period and the unknown voltage during the read period. This inverts the voltage ratio so the reciprocal of resistance - conductance - is displayed in the LCD.

3-39. Range Switches

3-40. Though the range switches are not exactly input signal conditioners, we've seen that they do control the input signal conditioners so that the inputs to your meter can be processed properly. In addition to the functions we've already discussed, the range switches also position the decimal point so that the LCD display is the correct value.

3-41. MISCELLANEOUS CIRCUITRY

3-42. Meter Protection Circuits

3-43. Have you ever tried to measure voltage with a resistance range selected on your meter? Or have you tried to measure 6.5V on pin 15 only to find that someone had wired pin 15 to the 1200V source that should have been wired to pin 16? Most of us have. At times like these, meter protection circuits are essential. The protection circuits in your Fluke multimeter will allow your instrument to absorb an unreasonable amount of abuse without affecting its performance. With more catastrophic inputs, these protection circuits will fail safely, protecting the more vital sections of your meter. We'll use the schematic of the Main PCB located in Section 8 to illustrate the description of the meter protection circuitry.

3-44. VOLTAGE MEASUREMENT PROTECTION

3-45. When the voltage measurement function is selected, your Fluke meter can tolerate voltage inputs of slightly more than the highest input range no matter what range is selected. If the input voltage is higher than the limits of the range selected, an overrange indication will be displayed.

Once the input voltage exceeds about 1200V, the resistance of the three varistors (RV1, RV2, and RV3) drops, clamping the meter side of R2 to 1200V. These varistors can compensate for abusive transient voltage inputs of up to 6000V. Should the input voltage exceed even this unreasonable level and generate enough heat to destroy R2; R2 is a flame-proof resistor. R16 is a 1 MΩ, 1W, current limiting resistor that will protect U3 from dc voltage inputs of up to 1000V (handy if a low range is selected). R14 is a 100 kΩ, 2W, current limiting resistor that will protect the input buffer of the rms converter for inputs of 750V rms or 1000V peak continuous for the 200 mV and 2V ranges. On these two ranges, high level input applied for longer than the 10 second maximum listed in the Specification Table may cause damage to or failure of the resistor. The input divider attenuation provides additional protection on all other ranges.

3-46. RESISTANCE/CONDUCTANCE MEASUREMENT PROTECTION

3-47. Selecting either the resistance or conductance measurement function places Q1, Q2 and RT1 in parallel with the meter across the resistance input and common lines. These three components provide protection for inputs up to 500V.

3-48. CURRENT MEASUREMENT PROTECTION

3-49. The mA input is protected two ways. CR1 and U4 limit the voltage drop across the current shunts. F1 and F2 protect the current shunts from overcurrent conditions. F1 is a fast blowing fuse rated for 2A at 250V. It is the type with a wire thread in an evacuated glass envelope. Under moderately abusive overloads, F1 will blow protecting the circuitry. But if the overload voltage is high enough, the voltage will arc through the metal vapor caused by F1 blowing. F2 will blow in this case. F2 is rated for 3A at 600V.

3-50. The 10A function has no fuse protection circuitry. It can handle overloads of up to 12A.

3-51. Power Supply (D 810)

WARNING

LINE VOLTAGE POTENTIAL IS ON THE PRIMARY POWER CIRCUIT ANY TIME THE INSTRUMENT IS PLUGGED IN TO A LINE POWER OUTLET.

3-52. The D 810 power supply is made to operate from 115V, 60 Hz. This power supply provides all basic operating voltages for the instrument. These voltages are rectified and filtered but are not regulated. All regulated voltage needs are supplied either by U7 or by the custom IC, U3. The POWER switch opens the secondary circuit. The power supply transformer, T1, is a special self-limiting transformer so the input is not fused.

3-53. Power Supply (D 811)

3-54. The D 811 replaces the standard power supply of the D 810 with a power supply that either operates off of line power or off of an installed battery pack. As with the D 810, a crystal is used to reject 60 Hz noise. The theory of operation will be illustrated by the Main PCB schematic in Section 8.

3-55. The battery power supply is shown on the schematic in the lower left hand corner just above the standard power supply schematic. The D 811 power supply can be used with line voltages of 90V to 132V, 60 Hz. F3 provides fuse protection for the power supply. Line power input is rectified, filtered and regulated. The output of the power supply acts as a current source for the battery. The battery determines the voltage level into the low power oscillator. Don't operate your instrument with the battery removed. The low power oscillator uses the fly-back transformer technique to boost the output voltage, +VDD-(-VSS) to 10V. This in turn is converted to a +VA and -VA of ±11.5V.

3-56. When the battery voltage drops below 2.1V, the BT indicator will illuminate on the display. (This BT indicator will also illuminate briefly when the instrument is turned off.) After the BT indicator lights, you have at least 1/2 hour (typically) before the accuracy of the instrument will be effected. Battery power is low.

NOTE

The AC functions consume a lot more power the other functions. The battery charge may be too low for AC functions (BT displayed) and still be adequate for proper operation with other functions (BT not displayed).

3-57. Touch and Hold Circuit

3-58. The touch and hold circuit allows the use of the optional Touch and Hold Probe with your instrument. Look at the schematic of the Main PCB in Section 8. The CL2 line to the crystal Y1 continues to the left, passing through Q4 and Q3 to ground. This path allows the crystal to oscillate. If a ground is applied to the mA terminal, Q3 is cut off. This stops the instrument clock. The last value displayed on the LCD remains displayed until the ground is removed from the mA terminal.

CAUTION

The Touch and Hold function is meant to be used for intervals of no more than a few minutes. If the display is stopped for longer periods of time (1/2 hour, 1 hour, etc.) the outline of the digits will remain for a few hours after the display is started again. If the display is stopped for extremely long periods of time, the LCD may be permanently damaged.

static awareness

A Message From

John Fluke Mfg. Co., Inc.

Some semiconductors and custom IC's can be damaged by electrostatic discharge during handling. This notice explains how you can minimize the chances of destroying such devices by:

1. Knowing that there is a problem.
2. Learning the guidelines for handling them.
3. Using the procedures, and packaging and bench techniques that are recommended.

The Static Sensitive (S.S.) devices are identified in the Fluke technical manual parts list with the symbol "⊗"

The following practices should be followed to minimize damage to S.S. devices.

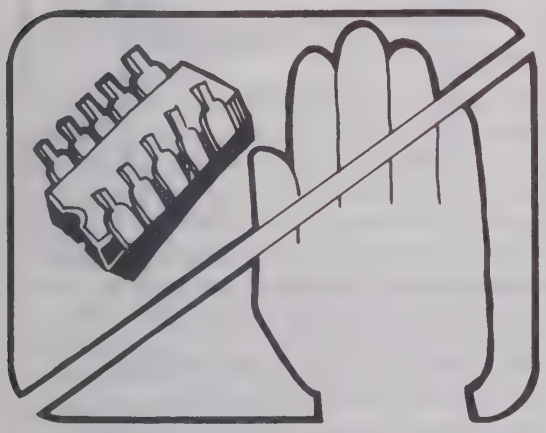

1. MINIMIZE HANDLING

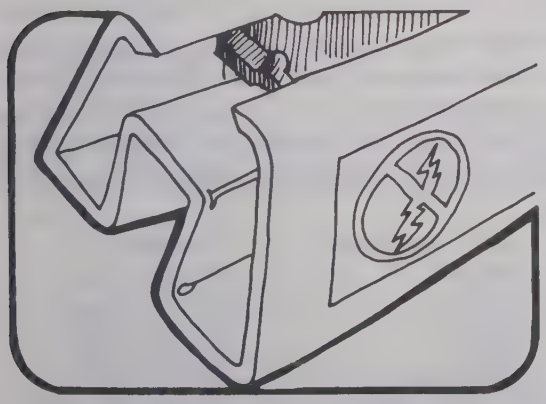

2. KEEP PARTS IN ORIGINAL CONTAINERS UNTIL READY FOR USE.

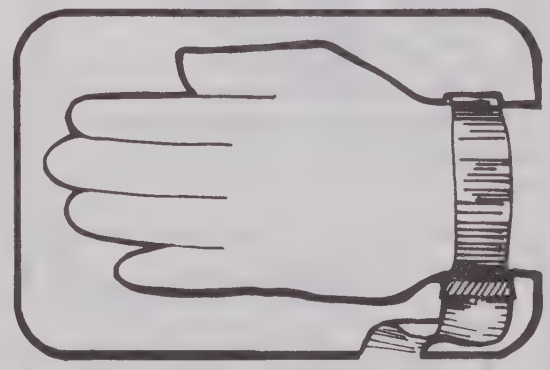

3. DISCHARGE PERSONAL STATIC BEFORE HANDLING DEVICES

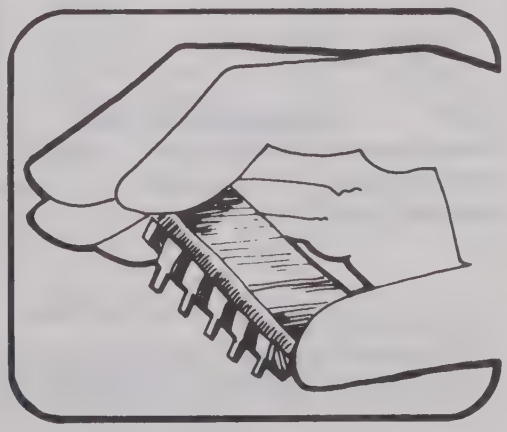

4. HANDLE S.S. DEVICES BY THE BODY

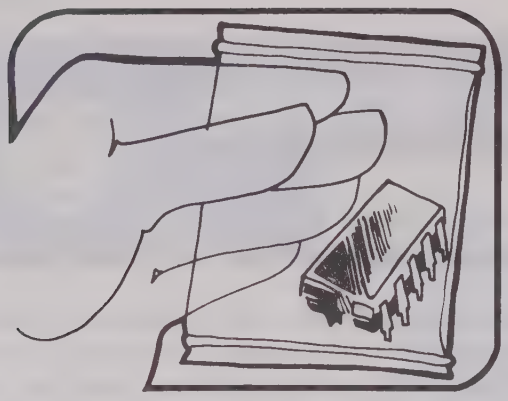

5. USE ANTI-STATIC CONTAINERS FOR HANDLING AND TRANSPORT

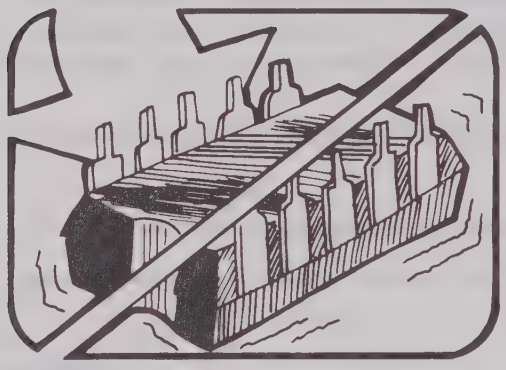

6. DO NOT SLIDE S.S. DEVICES OVER ANY SURFACE

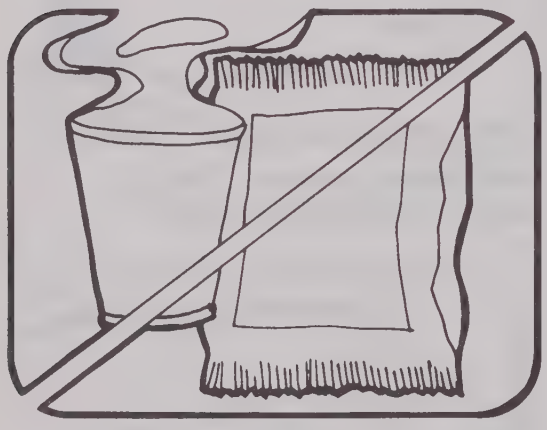

7. AVOID PLASTIC, VINYL AND STYROFOAM® IN WORK AREA

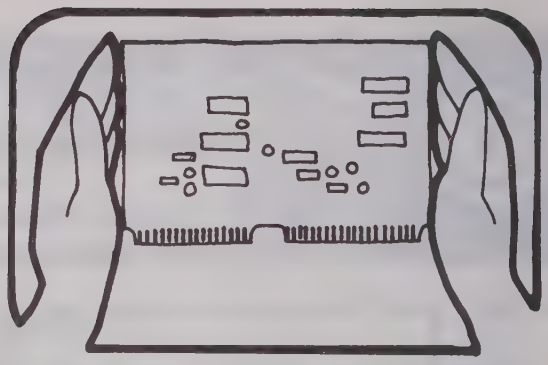

8. WHEN REMOVING PLUG-IN ASSEMBLIES, HANDLE ONLY BY NON-CONDUCTIVE EDGES AND NEVER TOUCH OPEN EDGE CONNECTOR EXCEPT AT STATIC-FREE WORK STATION. PLACING SHORTING STRIPS ON EDGE CONNECTOR USUALLY PROVIDES COMPLETE PROTECTION TO INSTALLED SS DEVICES.

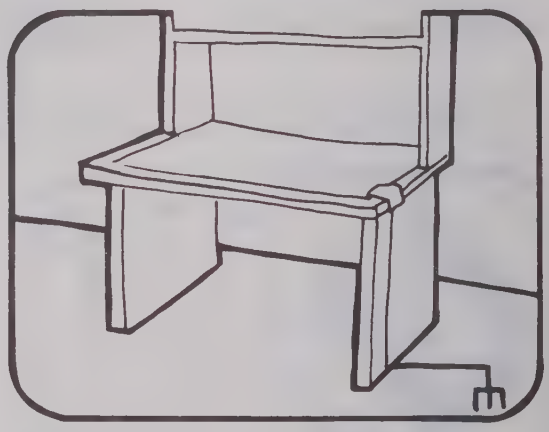

9. HANDLE S.S. DEVICES ONLY AT A STATIC-FREE WORK STATION
10. ONLY ANTI-STATIC TYPE SOLDER-SUCKERS SHOULD BE USED.
11. ONLY GROUNDED TIP SOLDERING IRONS SHOULD BE USED.

Anti-static bags, for storing S.S. devices or pcbs with these devices on them, can be ordered from the John Fluke Mfg. Co., Inc.. See section 5 in any Fluke technical manual for ordering instructions. Use the following part numbers when ordering these special bags.

John Fluke Part No.	Description
453522	6" X 8" Bag
453530	8" X 12" Bag
453548	16" X 24" Bag
454025	12" X 15" Bag
Pink Poly Sheet 30"x60"x60 Mil P/N RC-AS-1200 $20.00	Wrist Strap P/N TL6-60 $7.00

PORTIONS REPRINTED
WITH PERMISSION FROM TEKTRONIX, INC.
AND GENERAL DYNAMICS, POMONA DIV.

® Dow Chemical

J0089B-07U7810/SE EN Litho in U.S.A.

Section 4
Maintenance

WARNING

THESE SERVICE INSTRUCTIONS ARE FOR USE BY QUALIFIED PERSONNEL ONLY. TO AVOID ELECTRIC SHOCK, DO NOT PERFORM ANY SERVICING OTHER THAN THAT CONTAINED IN THE OPERATING INSTRUCTIONS UNLESS YOU ARE QUALIFIED TO DO SO.

4-1. INTRODUCTION

4-2. This section of the manual contains maintenance information for both the Model D 810 and the Model D 811 Digital Multimeters. This maintenance information is divided into service information, general maintenance, a performance test, a calibration procedure and troubleshooting. The performance test is recommended as an acceptance test when the instrument is first received, and later as a preventative maintenance tool to verify proper instrument operation. A 1-year calibration cycle is recommended to maintain the specifications given in Section 1. The test equipment required for both the performance test and calibration procedure is listed in Table 4-1. If the recommended equipment is not available, instruments having equivalent specifications may be used.

4-3. SERVICE INFORMATION

4-4. The D 810 and D 811 are both warranted for a period of 1-year upon delivery to the original purchaser. Conditions of the warranty are given at the rear of the manual.

4-5. Malfunctions that occur within the limits of the warranty will be corrected at no charge. Simply mail the instrument (post paid) to your nearest authorized (in-warranty) Fluke Technical Service Center. Shipping information and a complete list of service centers are provided in Section 7. Dated proof-of purchase will be required for all in-warranty repairs.

4-6. Factory authorized service centers are also available for calibration and/or repair of instruments that are beyond their warranty period. Contact your nearest authorized Fluke Technical Service Center for a cost quotation. Ship the instrument and your remittance using the instructions given. A list of service centers is given in Section 7.

4-7. GENERAL INFORMATION

4-8. Access Information

NOTE

To avoid contaminating the pcb with oil from the fingers, handle it by the edges or wear gloves. If the pcb does become contaminated, refer to the cleaning procedures given later in this section.

4-9. CALIBRATION ACCESS

4-10. Use the following procedure to gain access to the calibration adjustments of your instrument.

1. Set the POWER switch to OFF.

2. Disconnect the power cord plug from the receptacle in the rear of the instrument.

3. Remove the phillips screw from the back of the instrument.

Table 4-1. List of Recommended Test Equipment

INSTRUMENT TYPE	REQUIRED CHARACTERISTICS	RECOMMENDED MODEL
Multimeter Calibrator	DC Voltage: 0 to 1000V ± .05% AC Voltage: 100 Hz - 0 to 200V ± .05% 400 Hz 0 to 750V ± .8% 1 kHz - 0 to 250V ± .05% 10 kHz - 0 to 110V ± .3% 50 kHz - 0 to 20V ± .5% DC Current: 0 to 2000 mA ± .04% AC Current: 0 to 200 μA ± .01% Resistance: 0 to 10 MΩ in steps of power-of-ten ± .05%	John Fluke Model 5100A or 5101A or 5102A
DMM	Read true rms 0 to 12V ± 1%	John Fluke Model D 810, D 811, 8010A, 8012A, 8050A
Calibration Leads	One red, one black - 24" spade lug to banana connector	Pomona 1987-24

4. Slide the cover to the rear until the cover is free of the interior of the instrument.

5. Turn the instrument upside down.

6. All adjustments necessary to complete the calibration procedure are now accessible.

7. For reassembly, logically reverse the procedure.

4-11. MAIN PCB ACCESS

4-12. Use this procedure to remove the Main PCB.

1. Perform the calibration access procedure.

2. Remove the two screws from the rear of the bottom shield.

3. Remove the bottom shield.

4. Disconnect the front panel wires as follows:

a. The V-Ω-S input line (white), the COMMON input line (black), and the 10A input line (purple), are all attached to the front panel by a snap connector. Unplug these lines.

b. The mA input line (white) is more difficult to remove. It may either be unsoldered from the Main PCB or the following procedure may be used:

1. On the front panel, insert a coin or your fingernail into the slot on the mA terminal, turn the mA terminal 1/4 turn counterclockwise. Remove the fuse and holder.

2. Bend a small hook in the end of a paper clip (or equivalent).

NOTE

Perform the rest of this procedure carefully so the plastic walls of the fuse holder are not damaged.

3. Pull the wire up through the fuse holder slot.

4. Keep tension on the wire so that the rear end of the spring is as shown in Figure 4-1, Part A.

5. Insert the hook on the paper clip as shown in Figure 4-1, Part A. Pry gently upward until a few turns of the spring are free of the fuse holder.

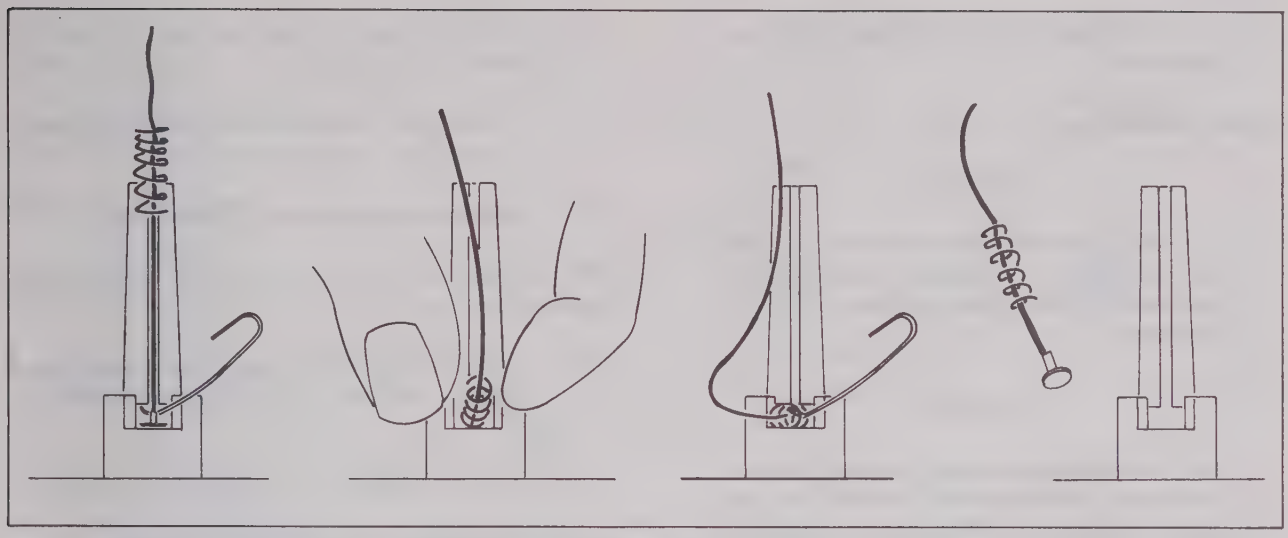

Figure 4-1. Removing the mA Input Line

6. Grasp the spring as shown in Figure 4-1, Part B and turn counterclockwise until the spring comes completely free of the fuse holder.

7. Slide the spring down the wire to the Main PCB.

8. Push the wire back inside the slot in the fuse holder.

9. With the paper clip, pry the spring retainer free of the fuse holder as shown in Figure 4-1, Part C.

10. Pull the wire free of the slot in the fuse holder. Figure 4-1, Part D shows the mA input line free of the fuse holder.

11. Reinstall the fuse and fuse holder.

5. Turn the instrument right side up.

6. Remove the two screws at the rear of the top shield and lift the top shield away from the Main PCB.

7. Remove the two screws that connect the Main PCB and the Front Panel Assembly. The screws are located at the front of the instrument, right side.

8. Carefully pull the front panel free of the switches.

9. To replace the Main PCB, logically reverse this procedure being careful to install the pcb and the shields in their appropriate guides.

4-13. DISPLAY ACCESS

4-14. Use the following procedure to remove or replace the LCD.

1. Perform the calibration access procedure.

2. Turn the instrument right side up.

3. Remove the two screws that connect the Main PCB and the Front Panel Assembly. The screws are located at the right front of the instrument.

4. Carefully slide the front panel forward until it is clear of the switches and Display Assembly. Let the Front Panel Assembly drop clear of the Display Assembly.

5. Remove the two screws connecting the Main PCB and the Display Assembly.

6. Place your fingernail under the grey tabs on the display frame and lift them free of the white screw-posts on the display mounting bracket.

7. Rotate the display frame forward and down until the two hooks on the bottom of the display frame release the display mounting bracket.

8. The LCD may now be lifted free from the display mounting bracket.

9. A small length of flat, flexible material may fall out. This is the zebra strip. The zebra strip is an elastomeric strip of alternate areas of conductive and non-conductive material. When the screws are tightened to hold down the display assembly, this zebra strip provides electrical contact between the pins on the LCD and the land pattern on the Main PCB. The zebra strip is located in a channel on the display mounting bracket.

10. To replace the LCD, logically reverse this procedure.

4-15. Cleaning

CAUTION

Do not use aromatic hydrocarbons or chlorinated solvents for cleaning. These solutions will react with the plastic materials used in the instrument.

CAUTION

Do not get the liquid crystal display wet. Remove the display assembly before washing the pcb and do not install it until the pcb has been fully dried.

4-16. Clean the front panel and case with a mild solution of detergent and water. Clean dust from the circuit board with clean, dry, low pressure air (20 psi). Contaminates can be removed from the pcb with demineralized water and a soft brush (remove the display assembly before washing the Main PCB and avoid getting excessive amounts of water on the switches). Dry with clean, dry, low pressure air, and then bake at 50°C to 60°C (124°F to 140°F) for 24 hours.

4-17. mA Backup Fuse Replacement

4-18. The 3A/600V fuse is located in a clip holder on the Main PCB inside the instrument. Use the following procedure to change it:

a. Perform the CALIBRATION ACCESS procedure.

b. Looking down at the Main PCB from the front of the instrument, the fuse is located on the left side of the Main PCB halfway back.

NOTE

If you are unfamiliar with this type of fuse, there are component location diagrams of the Main PCB in both Sections 5 and 8.

c. Remove the fuse from the clip and replace it with a type BBS-3 fuse.

d. Turn the inside of the instrument right-side-up.

e. Slide the instrument cover back onto the instrument. Be careful to line up all guides.

f. On the rear of the instrument, screw the phillips screw back in.

g. Plug the power cord back into the receptacle on the rear of your instrument.

4-19. Battery Replacement (D 811 only)

4-20. Use the following procedure for removing and replacing batteries:

1. Disconnect line cord. Remove retaining screw at rear of instrument case, and remove instrument from case.

2. Turn the instrument upside down.

3. Unplug the red and black battery wires.

4. Apply pressure to the sides of the battery case to disconnect the battery case from the Main PCB.

5. Remove the blotting paper.

6. Replace the batteries with a new Fluke battery assembly.

7. Replace the blotting paper and connect the battery case back to the Main PCB.

8. Connect the battery wires to their appropriate connector on the Main PCB, red to +, black to -.

9. Replace the instrument in its case.

4-21. Line Fuse Replacement (D 811 only)

4-22. Use the following procedure to replace the main power fuse, F3.

1. Perform the Calibration Access Procedure in Section 4.

2. F3 is located immediately in front of the power receptacle.

3. Replace F3 with 1/32A, Slo-Blo, 250V.

4-23. PERFORMANCE TESTS

4-24. The performance test is used to compare the performance of your instrument with the list of specifications given in Section 1. The performance test is recommended for incoming inspection, a preventative maintenance check, and to verify specifications. If the instrument fails any part of the performance test, calibration and/or repair is indicated.

4-25. Allow the instrument to stabilize and test it at an ambient temperature of 23 ±5°C (73 ±9°F). For the remainder of the performance test and the calibration procedure, your instrument will be referred to as the UUT (Unit Under Test).

4-26. Display Test

4-27. Use the following procedure to test the operation of all display digits, segments and decimal point locations.

1. On the UUT, set the POWER switch to the ON position.

2. On the UUT, select the Ω function, 2000 kΩ range.

3. Verify that the overrange indication (1) illuminates.

4. Select the V function.

5. Verify that the LCD displays 000.

6. Connect test lead between the V-Ω-S and COMMON input terminals.

7. Select each range in sequence starting with the 200 mV range. Verify that the decimal point location agrees with Table 4-2.

8. Remove the test lead.

9. Connect the HI output of the Multimeter Calibrator to the V-Ω-S input of the UUT. Connect the LO output of the Multimeter Calibrator to the COMMON input terminal of the UUT.

10. On the UUT, select the DC V function, 20V range.

11. Program the Multimeter Calibrator for an output of -18.88V. This checks each segment of every digit in the display.

4-28. Resistance/Conductance Test

4-29. Use the following procedure to verify the operation and performance of the resistance and conductance ranges.

1. Short together the COMMON and V-Ω-S input terminals.

2. On the UUT, select the Ω function, 200Ω range.

3. Verify that the display reading is 00.0 to 00.2.

Table 4-2. Decimal Point Locations

RANGE	LCD DISPLAY
200 mV	00.0
2V	.000
20V	0.00
200V	00.0
1000V	000
no reading (10A/20MΩ)	0.00

4. Remove the short.

5. On the UUT, select the conductance function, 200 nS range.

6. Verify that the display reading is between 00.0 and 01.0

7. Connect the HI output of the Multimeter Calibrator to the V-Ω-S input terminal of the UUT. Connect the LO output of the Multimeter Calibrator to the COMMON input terminal of the UUT.

8. Verify the remainder of the ranges by using Table 4-3 and the following procedure. For each step of Table 4-3:

a. On the UUT, select the range indicated under the Range column.

b. Program the Multimeter Calibrator for the value listed under the MC output column.

c. Verify that the display reading on the UUT falls within the values under the Display Reading column.

Table 4-3. Resistance/Conductance Test

STEP	RANGE	MC OUTPUT	DISPLAY READING
1	200Ω	100Ω	99.7 to 100.3
2	2 kΩ	1 kΩ	997 to 1003
3	20 kΩ	10 kΩ	9.97 to 10.03
4	200 kΩ	100 kΩ	99.7 to 100.3
5	2000 kΩ	1 MΩ	994 to 1006
6	20 MΩ	10 MΩ	9.94 to 10.06
7	2 mS	1 kΩ	0.997 to 1.003
8	20 μS	100 kΩ	9.97 to 10.03
9	200 nS	10 MΩ	98.0 to 102.0

4-30. DC Voltage Test

4-31. Use the following procedure to verify operation and accuracy of the DC Voltage function of the UUT.

1. Connect the HI output of the Multimeter Calibrator to the V-Ω-S input terminal of the UUT. Connect the LO output of the Multimeter Calibrator to the COMMON input of the UUT.

2. On the UUT, select the DC V function.

3. Use Table 4-4 and the following procedure:

   a. On the UUT select the range listed under the Range column.

   b. Program the Multimeter Calibrator for the value listed under the MC output column.

   c. Verify that the LCD display is within the values listed under the Display column.

Table 4-4. DC Voltage Test

STEP	RANGE	MC OUTPUT	DISPLAY
1	20 MV	+190.0 mV	+189.7 to +190.3
2	2V	+1.900V	+1.897 to +1.903
3	20V	+19.00V	+18.97 to +19.03
4	20V	-19.00V	-18.97 to -19.03
5	200V	+190.0V	+189.7 to +190.3
6	1000V	+1000V	+998 to +1002

4-32. RMS Converter Offset Test

4-33. Use the following procedure to verify the proper offset of the RMS converter.

1. On the UUT, select the AC V function, any range.

2. Connect a test lead between the V-Ω-S and COMMON terminals.

3. On the UUT, measure and record the voltage level on TP1 with the DMM.

4. Verify that this level is between ±20 mV.

5. Measure the voltage level on TP2.

6. Verify that the voltage level on TP2 is within 1 mV of the level recorded from TP1.

4-34. AC Voltage Test

4-35. Use the following procedure to verify the accuracy and operation of the AC Voltage function.

1. Connect the HI output of the Multimeter Calibrator to the V-Ω-S input terminal of the UUT. Connect the LO output of the Multimeter Calibrator to the COMMON input terminal of the UUT.

2. On the UUT, select the AC V function.

3. Use Table 4-5 and the following procedure:

   a. On the UUT select the range indicated in the Range column.

   b. Program the Multimeter Calibrator for the level and frequency output listed under the MC Output column.

   c. Verify that the LCD display is within the values listed under the Display Reading.

Table 4-5. AC Voltage Test

STEP	RANGE	MC OUTPUT		DISPLAY READING
		LEVEL	FREQ	
1	200 mV	190.0 mV	100 Hz	188.8 to 191.2
2	200 mV	10.0 mV	100 Hz	9.8 to 10.2
3	2V	1.900V	100 Hz	1.888 to 1.912
4	20V	19.00V	100 Hz	18.88 to 19.12
5	200V	190.0V	100 Hz	188.8 to 191.2
6	750V	750V	100 Hz	744 to 756
7	750V	250V	1 kHz	247 to 253
8	20V	1.00V	10 kHz	0.97 to 1.03
9	20V	19.00V	10 kHz	18.79 to 19.21
10	200V	110.0V	10 kHz	108.7 to 111.3
11	20V	19.00V	50 kHz	18.03 to 19.97

4-36. DC Current Test

4-37. Use the following procedure to verify operation and accuracy of the DC Current function.

1. Connect the HI output of the Multimeter Calibrator to the mA input terminal of the UUT. Connect the LO output of the Multimeter Calibrator to the COMMON input terminal of the UUT.

2. On the UUT, select the DC mA/A function.

3. Use Table 4-6 and the following procedure. For each step in Table 4-6:

a. On the UUT, select the range listed under the Range column.

b. Program the Multimeter Calibrator for the output listed under the MC Output column.

c. Verify that the LCD display is within the values listed under the Display Reading column.

Table 4-6. DC mA Test

STEP	RANGE	MC OUTPUT	DISPLAY READINGS
1	200 μA	190.0 μA	189.3 to 190.7
2	2 mA	1.900 mA	1.893 to 1.907
3	20 mA	19.00 mA	18.93 to 19.07
4	200 mA	190.0 mA	189.3 to 190.7
5	2000 mA	1900 mA	1893 to 1907

4-38. AC Current Test

4-39. Use the following procedure to verify operation and accuracy of the AC Current function.

1. Connect the HI output of the Multimeter Calibrator to the mA input terminal of the UUT. Connect the LO output of the Multimeter Calibrator to the COMMON input terminal of the UUT.

2. On the UUT, select the AC mA/A function, 200 μA range.

3. Program the Multimeter Calibrator for an output level of 190.0 μA at a frequency 1 kHz.

4. Verify that the LCD display is within the values: 187.9 to 192.1 μA.

4-40. 10A Current Test

4-41. Use the following procedure to verify the operation and accuracy of the 10A function.

1. Connect the HI output of the Multimeter Calibrator to the 10A input terminal on the UUT. Connect the LO output of the Multimeter Calibrator to the COMMON input terminal on the UUT.

2. On the UUT, select the DC mA/A function, 10A range.

3. Program the Multimeter Calibrator for an output of 1900 mA DC.

4. Verify that the LCD display is between these values: 1.88 to 1.92 A.

4-42. CALIBRATION PROCEDURE

4-43. The calibration procedure should be used any time your instrument has been repaired or fails to pass the Performance Test. The Calibration Procedure has three sections: The Turn-On Check - verifies proper power supply voltages, DC Calibration Adjustment - sets up the DC voltage/DC Current/Resistance/Conductance functions, and AC Calibration Adjustments - sets up all AC functions. Perform the Calibration Access Procedure before starting any section of the Calibration Procedure.

NOTE

Since the components are on the bottom side of the pcb's, it will be necessary to turn the instrument upside down to gain access to the calibration adjustments. This inverts the display. If you have trouble reading the inverted display, there are two alternatives. First, you can stand at the side of your instrument facing the front of the instrument. Lean forward and the display will appear to be right-side-up. If this is unsatisfactory, turn the outer cover on its side with the handle perpendicular to the cover. Place a weight on the bottom leg of the handle. Connect the power cord to the power receptacle on the Main PCB and carefully slide the Main PCB about halfway back into the outer case.

4-44. Power Supply Check (D 810)

4-45. Use the following procedure to verify the power supply voltages of your instrument.

1. Apply line power to the UUT. Insure that this power is at the correct voltage and frequency for your version of the instrument.

2. Place the POWER switch in the ON position.

3. On the UUT, select the DC V function, 200V range.

4. Verify that the LCD reads 00.0 ±0.1V.

5. With the DMM, check the power supply voltages listed in Table 4-7. DO NOT ATTEMPT THIS PROCEDURE WITH THE D 811.

Table 4-7. Power Supply Voltages (D 810)

TEST POINT	REFER TO PAGE	VOLTAGE FUNCTION	VOLTAGE LEVEL SHOULD READ BETWEEN:
TP5	8-5		-2.1 ± 0.4V
TP7	8-4	-VSS	-6.5 ± 1V
TP8	8-4	-VA	-15 ± 1V
TP9		+VDD	+2.9 ± 0.3V
TP10	8-4	+VA	+15 ± 1V

4-46. Power Supply Check (D 811)

4-47. Use the following procedure to verify the power supply voltages of your instrument.

1. Place the POWER switch on the UUT in the ON position.

2. On the UUT, select the DC V function, 200V range.

3. Verify that the LCD displays 00.0 ±0.1V.

4. With the DMM, verify that the power supply voltages listed in Table 4-8 are within the tolerances listed in Table 4-8.

4-48. DC Calibration Adjustment

4-49. Use the following procedure to set up the DC voltage/DC current/Resistance/Conductance functions:

1. On the UUT, select the DC V function, 2V range.

2. Connect the HI output terminal of the Multimeter Calibrator to the V-Ω-S input terminal of the UUT using the red calibration lead. Connect the LO output terminal of the MC to the COMMON input terminal of the UUT using the black calibration lead.

3. Program the Multimeter Calibrator for a DC output of 1.888V. (This voltage is chosen so that all segments of all digits are checked.)

4. On the UUT, adjust R4 (DC CAL) for a display of exactly 1.888 on the LCD.

5. Reverse the input leads to the UUT.

6. Verify that the LCD reading is between -1.887 to -1.889.

7. If necessary, adjust R4 until both readings are within 1 digit of 1.888V.

Table 4-8. Power Supply Voltages (D 811)

TEST POINT	REFER TO PAGE	VOLTAGE FUNCTION	VOLTAGE LEVELS DURING BATTERY OPERATION	REMARKS
TP5	8-5		-2.1 ± 0.4V	
TP7	8-4	-VSS	-6.5 ± 1V	
TP9	8-4	+VDD	+2.9 ± 0.3V	
TP8	8-4	-VA	-11.5 ± 1V	An ac function must be selected to measure -VA and +VA.
TP10	8-4	+VA	+11.5 ± 1V	
TP13 (+) to TP9	8-4		+2.4V nominal	Variable, 2.0 to 3.0V, depending upon battery charge level.
TP14 (+) to TP13	8-4		+1.25 ± 0.05V	Determines battery charging current through R24.

4-50. RMS Converter Offset Adjustment

4-51. Use the following procedure to adjust the offset of the RMS converter.

1. On the UUT, select the AC V function, any range.

2. Connect a test lead between the V-Ω-S and COMMON terminals.

3. With the DMM, measure and record the voltage level on TP1.

4. Verify that the level is between ±20 mV.

5. Connect the DMM to TP2.

6. Adjust R7 on the RMS hybrid network so that the voltage level on TP2 is within 0.5 mV of the level recorded on TP1.

4-52. AC Calibration Adjustment

4-53. The following procedure sets up the circuitry for the AC functions. There are four interacting adjustments: two potentiometers for setting low and high levels at low frequencies and two variable capacitors for setting high levels at high frequency.

1. On the UUT, select AC V, 2V range.

2. Program the Multimeter Calibrator for an output of 1.900V rms at a frequency of 100 Hz.

3. Connect the HI output of the Multimeter Calibrator to the V-Ω-S input of the UUT using the red calibration lead. Connect the LO output of the Multimeter Calibrator to the COMMON input of the UUT using the black calibration lead.

4. Set R21 to the middle of its adjustment range.

5. Adjust R19 (AC HI) for a display of exactly 1.900V.

6. Program the Multimeter Calibrator for an output of 190.0 mV at 100 Hz.

7. On the UUT, select the 2V range.

8. Adjust R21 (AC LO) for a display of exactly .190.

9. The adjustments of R19 and R21 are interacting. Repeat steps 1 through 7 of this procedure until both readings are within 1 count of the designated values.

10. On the UUT, select a range of 20V.

11. Program the Multimeter Calibrator for an output of 19.00V at a frequency of 10 kHz.

12. Adjust C1 for a display of exactly 19.00V.

13. On the UUT, select a range of 200V.

14. Program the Multimeter Calibrator for an output of 110.0V at a frequency of 10 kHz.

15. Adjust C4 for a display of exactly 110.0V.

16. Check all four of the AC calibration adjustment levels, make adjustments as necessary.

4-54. TROUBLESHOOTING

CAUTION

Static discharge can damage MOS components contained in your instrument.

4-55. When troubleshooting or repairing your meter, use the following precautions to prevent damage from static discharge:

1. Never remove, install or otherwise connect or disconnect components without first setting the POWER switch to OFF.

2. Perform all repairs at a static-free workstation.

3. Do not handle IC's or pcb's by their connectors.

4. Use static ground straps to discharge repair personnel.

5. Use conductive foam to store replacement or removed IC's.

6. Remove all plastic, vinyl and styrofoam products from the work area.

7. Use a grounded soldering iron.

4-56. A troubleshooting guide for your instrument is given in Table 4-9. To properly use the guide complete the performance test given earlier in this section and note any discrepancies. Then locate the heading of the procedure in question in the Test and Symptom column (Table 4-9). Under that heading isolate the symptom that approximates the observed malfunction. Possible causes are listed to the right of the selected symptom. Details necessary to isolate a particular cause can be derived from the theory of operation in Section 3 and the schematic diagram in Section 8. Table 4-10 lists the test points in the instrument.

Table 4-9. Troubleshooting Guide

TEST AND SYMPTOM	POSSIBLE CAUSE
INITIAL PROCEDURE	
Display blank	Power supply, power switch, U3.
DISPLAY TEST	
One or more segments will not light through entire test.	Display interconnection, display, or A/D Converter U3.
Decade inoperative or one or more segments always lit.	U3.
Improper decimal point indication.	Range switches, U5, U6, or display. (Check signals at U6 to isolate.
Minus sign improperly displayed.	U3.
Display lit but does not respond to changes in input.	Reference U7, crystal U1, A/D Converter U3, Touch and Hold signal line grounded, Q3, Q4.
RESISTANCE/CONDUCTANCE TEST	
Displayed reading is out of tolerance on at least one but not all ranges.	Range resistor U1 or R3.
Readings are noisy on all ranges.	Thermistor RT1.
Readings are out of tolerance on high ohms.	RV1, RV2, RV3 overheated from severe overload.
Residual reading with test leads open.	PCB is contaminated. (See cleaning procedure Section 4.)
DC VOLTAGE TEST	
Display reading is out of tolerance on 200 mV or 2V range.	Out of calibration (DC), Vref (U7, in error, R4, U3.)
Readings are out of tolerance on all ranges except 200 mV and 2V.	Range resistor U1.
AC VOLTAGE TEST	
Displayed reading is out of tolerance on 200 mV range.	Out of calibration (AC), AC converter defective.
Readings out of tolerance on all ranges except 200 mV.	Range resistor U1, C1, C4 out of calibration.
DC CURRENT TEST	
Input does not affect display.	Fuse F1, F2, CR1, U4.
Displayed reading is out of tolerance on one or more ranges.	R7, R8, R9, U2, R10.

Table 4-10. Test Points

TEST POINT	SIGNAL/CONNECTION	TEST POINT	SIGNAL/CONNECTION
TP1	RMS Converter	TP8	-VA
TP2	RMS Converter Input	TP9	+VDD
TP3	Compensation Network Input	TP10	+VA
TP4	A/D Converter HI Input	TP11	Range control input to A/D Converter
TP5	Digital Reference for A/D Converter Range	TP12	DC Reference Voltage
		TP13	Used with the D 811 (Battery Charging Circuit)
TP6	COMMON		
TP7	-VSS	TP14	Used with the D 811 (Battery Charging Circuit)

Section 5
List of Replaceable Parts

TABLE OF CONTENTS

ASSEMBLY NAME	TABLE NO.	TABLE PAGE	FIGURE NO.	FIGURE PAGE
D 810/D 811 Final Assembly	5-1	5-3	5-1	5-3
A1 D 810 Main PCB Assembly	5-2	5-4	5-2	5-7
A1 D 811 Main PCB Assembly	5-3	5-9	5-3	5-12

5-1. INTRODUCTION

5-2. This section contains an illustrated parts breakdown of the instrument. Components are listed alpha-numerically by assembly. Electrical components are listed by reference designation and mechanical components are listed by item number. Each listed part is shown in an accompanying illustration.

5-3. Parts lists include the following information:

1. Reference Designation or Item Number.

2. Description of each part.

3. FLUKE Stock Number.

4. Federal Supply Code for Manufacturers. (See Appendix A for Code-to-Name list.)

5. Manufacturer's Part Number or Type.

6. Total Quantity per assembly or component.

7. Recommended Quantity: This entry indicates the recommended number of spare parts necessary to support one to five instruments for a period of two years. This list presumes an availability of common electronic parts at the maintenance site. For maintenance for one year or more at an isolated site, it is recommended that at least one of each assembly in the instrument be stocked. In the case of optional subassemblies, plug-ins, etc. that are not always part of the instrument, or are deviations from the basic instrument model, the REC QTY column lists the recommended quantity of the item in that particular assembly.

8. The Use Code: This entry indicates a note number. The corresponding note will be at the end of that table.

5-4. HOW TO OBTAIN PARTS

5-5. Components may be ordered from the nearest Fluke authorized service center listed at the rear of this manual. To ensure prompt and efficient handling of your order, include the following information:

1. Quantity.

2. FLUKE Stock Number.

3. Description.

4. Reference Designation or Item Number.

5. Printed Circuit Board Part Number.

6. Instrument Model Number and the Rev. letter inked on the pcb assembly.

CAUTION

Indicated devices are subject to damage by static discharge.

Table 5-1. D 810/D 811 Final Assembly

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO. OR TYPE	TOT QTY	REC QTY	NOTE
A	D810/D811 FINAL ASSEMBLY FIGURE 5-1						
A1	D810 MAIN PCB ASSEMBLY SEE FIGURE 5-2	WITH	LINE	POWER ONLY			
A1	D811, MAIN PCB ASSEMBLY (BATTERY TYPE) SEE FIGURE 5-3	WITH	LINE	AND BATTERY POWER			
H1	SCREW, PHP, 6-32 X 1/2	320051	89536	320051	1		
H2	SCREW, PHP, 6-20 X 3/8	228266	89536	228266	2		
H3	WASHER, FLAT	340505	89536	340505	1		
MP1	DECAL, HANDLE, DISC	478248	89536	478248	1		
MP2	CASE, MOLDED	607465	89536	607465	1		
MP3	HANDLE, MOLDED	330092	89536	330092	1		
MP4	PAD, FOOT (NOT SHOWN)	338632	89536	338632	1		
MP5	DECAL, FRONT PANEL				1		
	FOR MODEL D810	585752	89536	585752			
	FOR MODEL D811	585760	89536	585760			
MP6	DECAL, SPECIFICATION (NOT SHOWN)	607457	89536	607457	1		
MP7	TEST LEADS (NOT SHOWN)	484055	89536	484055	1		
MP8	GROMMET, RUBBER (NOT SHOWN)	501593	83880	91119	1		
TM1	D810/D811 INSTRUCTION MANUAL	583617	89536	583617	AR		
W1	LINE CORD (NOT SHOWN)	343723	89536	343723	1		
	RECOMMENDED SPARE PARTS KIT (D810/D811)	608950	89536	608950	AR		

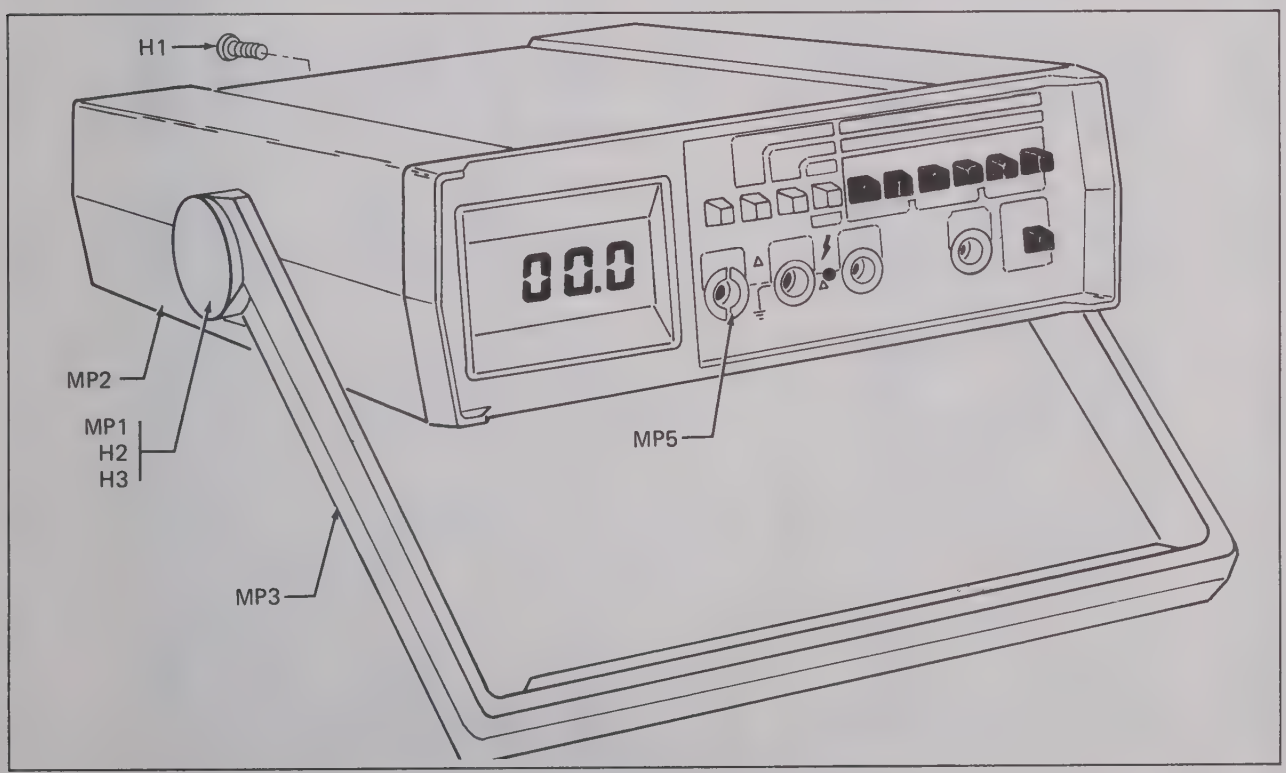

Figure 5-1. D 810/D 811 Final Assembly

Table 5-2. A1 D 810 Main PCB Assembly

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO. OR TYPE	TOT QTY	REC QTY	NOTE
A1	D810 MAIN PCB ASSEMBLY SEE FIGURE 5-2	WITH	LINE	POWER ONLY			1
AR1	IC, LIN OP-AMP	418780	12040	LF351N	1	1	
C1	CAP, VAR, 1.5 PF-0.25 PF, 200V	218206	72982	530-000	2	1	
C2	CAP, MICA, 150 PF +/-5%, 500V	148478	72136	DM15F151J	2		
C3	CAP, MICA, 120 PF +/-5%, 500V	148486	72136	DM15F121J	1		
C4	CAP, VAR, 1.5 PF-0.25 PF, 200V	218206	72982	530-000	REF		
C5	CAP, MICA, 2200 PF +/-5%, 500V	148346	72136	DM19F222J	1		
C6	CAP, MYLAR, 0.047 UF +/-10%, 250V	162008	73445	C280AMAE47K	1		
C7	CAP, MICA, 150 PF +/-5%, 500V	148478	72136	DM15F151J	REF		
C8	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015KA1	3		
C9	CAP, POLY, 0.622 UF +/-10%, 100V	448183	03797	0.22/10/1000-7	1		
C10	CAP, ELECT, 22 UF -10/+75%, 16V	436840	89536	436840	1		
C11	CAP, MYLAR, 0.047 UF +/-10%, 250V	446773	89536	446773	2		
C12	CAP, MICA, 470 PF +/-5%, 500V	148429	72136	DM19E471J	1		
C13	CAP, MYLAR, 0.047 UF +/-10%, 250V	446773	89536	446773	REF		
C14	CAP, POLY, 0.1 UF +/-10%, 2500V	446781	89536	446781	1		
C15	CAP, POLY, 0.22 UF +/-10%, 100V	436113	73445	C280MAH1A220K	1		
C16	CAP, CER, 0.01 UF +/-20%, 100V	149153	56289	C023B101F103M	2		
C17	CAP, CER, 500 PF +/-10%, 500V	105692	56289	C067B102E501K	1		
C18	CAP, TA, 2.2 UF +/-20%, 20V	161927	56289	196D225X0020HA1	1		
C19	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015KA1	REF		
C30	CAP, ELECT, 220 UF -10/+75%, 25V	484071	89536	484071	2		
C31	CAP, ELECT, 220 UF -10/+75%, 25V	484071	89536	484071	REF		
C32	CAP, ELECT, 220 UF -10/+75%, 16V	435990	89536	435990	1		
C33	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015KA1	REF		
C34	CAP, CER, 0.01 UF +/-20%, 100V	149153	56289	C023B101F103M	REF		
CR1	DIODE, SI, RECT. 2A, 50V	347559	05277	1N5400	1		
CR2	DIODE, SI, LO-CAP, LO-LEAK	348177	07263	FD7223	2	1	
CR3	DIODE, SI, LO-CAP, LO-LEAK	348177	07263	FD7223	REF		
CR9	DIODE, SI, RECT. 1A, 100V	343491	01295	1N4002	3	1	
CR10	DIODE, SI, RECT. 1A, 100V	343491	01295	1N4002	REF		
CR11	DIODE, SI, RECT. 1A, 100V	343491	01295	1N4002	REF		
DS1	LIQUID CRYSTAL DISPLAY (LCD)	583575	89536	583575	1		
F1	FUSE, FAST-BLO, 2A, 250V	376582	71400	AGX2	1	5	
F2	FUSE, FIBRE, 3A, 600V	475004	71400	BBS-3	1	5	
H1	PUSH ROD	479634	89536	479634	1		
H2	SCREW, FHP, 4-40 X 3/8	256024	89536	256024	2		
H3	SCREW, RHP, 4-40 X 1/4	256156	89536	256156	2		
H4	SCREW, RHP, #5 X 5/16	494641	89536	494641	4		
H5	SCREW, PH, S-STEEL, 6-32 X 1/4	385401	89536	385401	2		
JA1	RECEPTACLE, AC	607374	89536	607374	1		
MP1	PANEL, FRONT	USE	AS	A REFERENCE ONLY	1		
MP2	SHIELD, TOP	471037	89536	471037	1		
MP3	SHIELD, BOTTOM	471045	89536	471045	1		
MP4	BRACKET, LCD	471730	89536	471730	1		
MP5	BEZEL, LCD	607390	89536	607390	1		
MP6	BUTTON, POWER SWITCH, GREEN	445197	89536	445197	1		
MP7	BUTTON (FUNCTION) (S4 THRU S7)	607424	89536	607424	4		

Table 5-2. A1 D 810 Main PCB Assembly (cont)

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO. OR TYPE	TOT QTY	REC QTY	NOTE
MP8	BUTTON (RANGE) (S8 THRU S13)	607432	89536	607432	6		
MP9	SPRING, COMPRESSION	422824	84830	LC-0226-3	1		
MP11	CONNECTOR, POST	376574	89536	376574	2		
MP12	INSULATOR	495044	89536	495044	1		
MP13	GROMMET	493015	89536	493015	2		
Q1	XSTR, SI, NPN	218396	89536	218296	4	1	
Q2	XSTR, SI, NPN	218396	89536	218396	REF		
Q3	XSTR, SI, NPN	218396	89536	218396	REF		
Q4	XSTR, SI, PNP	195974	89536	195974	2	1	
Q5	XSTR, SI, PNP	195974	89536	195974	REF		
Q9	XSTR, SI, NPN	218396	89536	218396	REF		
R1	RES, COMP, 100K +/-10%, 1W	109397	01121	GB1031	1		
R2	RES, COMP, 1K +/-10%, 2W	474080	01121	HB1021	1		
R3	RES, MTL. FILM, 1K +/-0.1%, 1/8W	474445	91637	CMF551001B	1		
R4	RES, VAR, CERMET, 200 +/-10%, 1/2W	474973	89536	474973	1	1	
R5	RES, DEP. CAR, 1M +/-5%, 1/4W	348987	80031	CR251-4-5P1M	2		
R6	RES, DEP. CAR, 100 +/-5%, 1/4W	348771	80031	CR251-4-5P100E	1		
R7	RES, MTL. FILM, 900 +/-0.1%, 1/8W	461988	89536	4761988	1		
R8	RES, MTL. FILM, 90.0 +/-0.1%, 1/8W	461970	89536	461970	1		
R9	RES, WW, 9.000 +/-0.15%, 3W	461962	89536	461962	1		
R10	RES, FXD, 0.01 +/-0.25%, 1W	461780	80031	461780	1		
R11	RES, COMP, 22M +/-10%, 1/2W	108233	01121	EB2261	2		
R12	RES, COMP, 22M +/-5%, 1/4W	221986	01121	CB2255	1		
R13	RES, DEP. CAR, 1 +/-5%, 1/4W	357665	80031	CR251-4-5P1E	1		
R14	RES, COMP, 100K +/-5%, 2W	285056	01121	HB1045	1		
R15	RES, DEP. CAR, 15 +/-5%, 1/4W	348755	80031	CR251-4-5P15E	1		
R16	RES, COMP, 1M +/-10%, 1W	109793	01121	GB1051	1		
R17	RES, DEP. CAR, 220K +/-5%, 1/4W	348953	80031	CR251-4-5P220K	1		
R18	RES, DEP. CAR, 1K +/-5%, 1/4W	343426	80034	CR251-4-5P1K	1		
R19	RES, VAR, CERMET, 5K +/-10%, 1/2W	478883	89536	478883	1	1	
R20	RES, DEP. CAR, 2.2M +/-5%, 1/4W	342659	80031	CR251-4-5P2M2	1		
R21	RES, VAR, 1M +/-10%, 1/2W	485052	89536	485052	1	1	
R22	RES, DEP. CAR, 470K +/-5%, 1/4W	342634	80031	CR251-4-5P470K	1		
R23	RES, DEP. CAR, 1M +/-5%, 1/4W	348987	80031	CR251-4-5P1M	REF		
R30	RES, DEP. CAR, 4.7K +/-5%, 1/4W	348821	80031	CR251-4-5P4K7	1		
R31	RES, DEP. CAR, 100K +/-5%, 1/4W	348920	80031	CR251-4-5P100K	1		
R32	RES, COMP, 22M +/-10%, 1/2W	108233	01121	EB2261	REF		
R33	RES, COMP, 3.3M +/-5%, 1/4 W	208389	01121	CB3355			
R34	RES, DEP. CAR, 47M +/-10%, 1/2W	146415	89536	146415	1		
RT1	RES, CL, 1K +/-40%, 2W 25 DEG C	446849	50157	180010200	1		
RV1	VARISTOR, 430V +/-10%, 365VDC	447849	09214	V430MA7B	3	1	
RV2	VARISTOR, 430V +/-10%, 365VDC	447849	09214	V430MA7B	REF		
RV3	VARISTOR, 430V +/-10%, 365VDC	447849	09214	V430MA7B	REF		
S1	SWITCH, POWER	473736	89536	473736	1		
S4-S13	SWITCH ASSEMBLY	473322	89536	473322	1		
T1	TRANSFORMER, POWER, 115V	461509	89536	461509	1		
U1	RES, NETWORK, 10.0M, 101K, 11.1K	461483	89536	461483	1	1	
U2	RES, NETWORK, .100, .900	461491	89536	461491	1	1	
U3	IC, C-MOS, A/D CONVERTER	429100	89536	429100	1	1	
U4	IC, FW, RECT. BRIDGE, 50V-1000V, 1 AMP	418582	83003	VM08	1	1	

Table 5-2. A1 D 810 Main PCB Assembly (cont)

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO. OR TYPE	TOT QTY	REC QTY	NOTE
U5	RES, NETWORK, 25 DEG. C, +/-5%, 1/8W	474999	89536	474999	1	1	
U6	IC, C-MOS, QUAD EXCLUSIVE-OR GATE	355222	89536	355222	1	1	
U7	IC, LIN, 2.5V BAND-GAP REF	472845	04713	MC1403V	1	1	
U8	HYBRID RMS CONVERTER BOARD	480897	89536	480897	1	1	
VR2	DIODE, ZENER, 4.3V	180455	07910	1N749A	1	1	
W1	WIRE ASSEMBLY, WHITE (FUSE)	489096	89536	489096	1		
W2	WIRE ASSEMBLY, BLACK	487519	89536	487519	1		
W3	WIRE ASSEMBLY, WHITE	487629	89536	487629	1		
W4	WIRE ASSEMBLY, VIOLET	487637	89536	487637	1		
W5	WIRE ASSEMBLY, WHITE (AC)	489120	89536	489120	1		
W6	WIRE ASSEMBLY, GREEN/YELLOW	489112	89536	489112	1		
W8	WIRE ASSEMBLY, BLACK/WHITE	489773	89536	489773	1		
XF1	FUSE HOLDER ASSEMBLY, 115V SOURCE	607416	89536	607416	1		
XU3	SOCKET, IC, 40-PIN (W/U3)	429282	09922	DILB40P-108	1		
Y1	CRYSTAL 60HZ (3.840 MHZ)LINE FREQUENCY	447615	89536	447615	1		

1 ORDER REPLACEMENT PARTS ONLY.

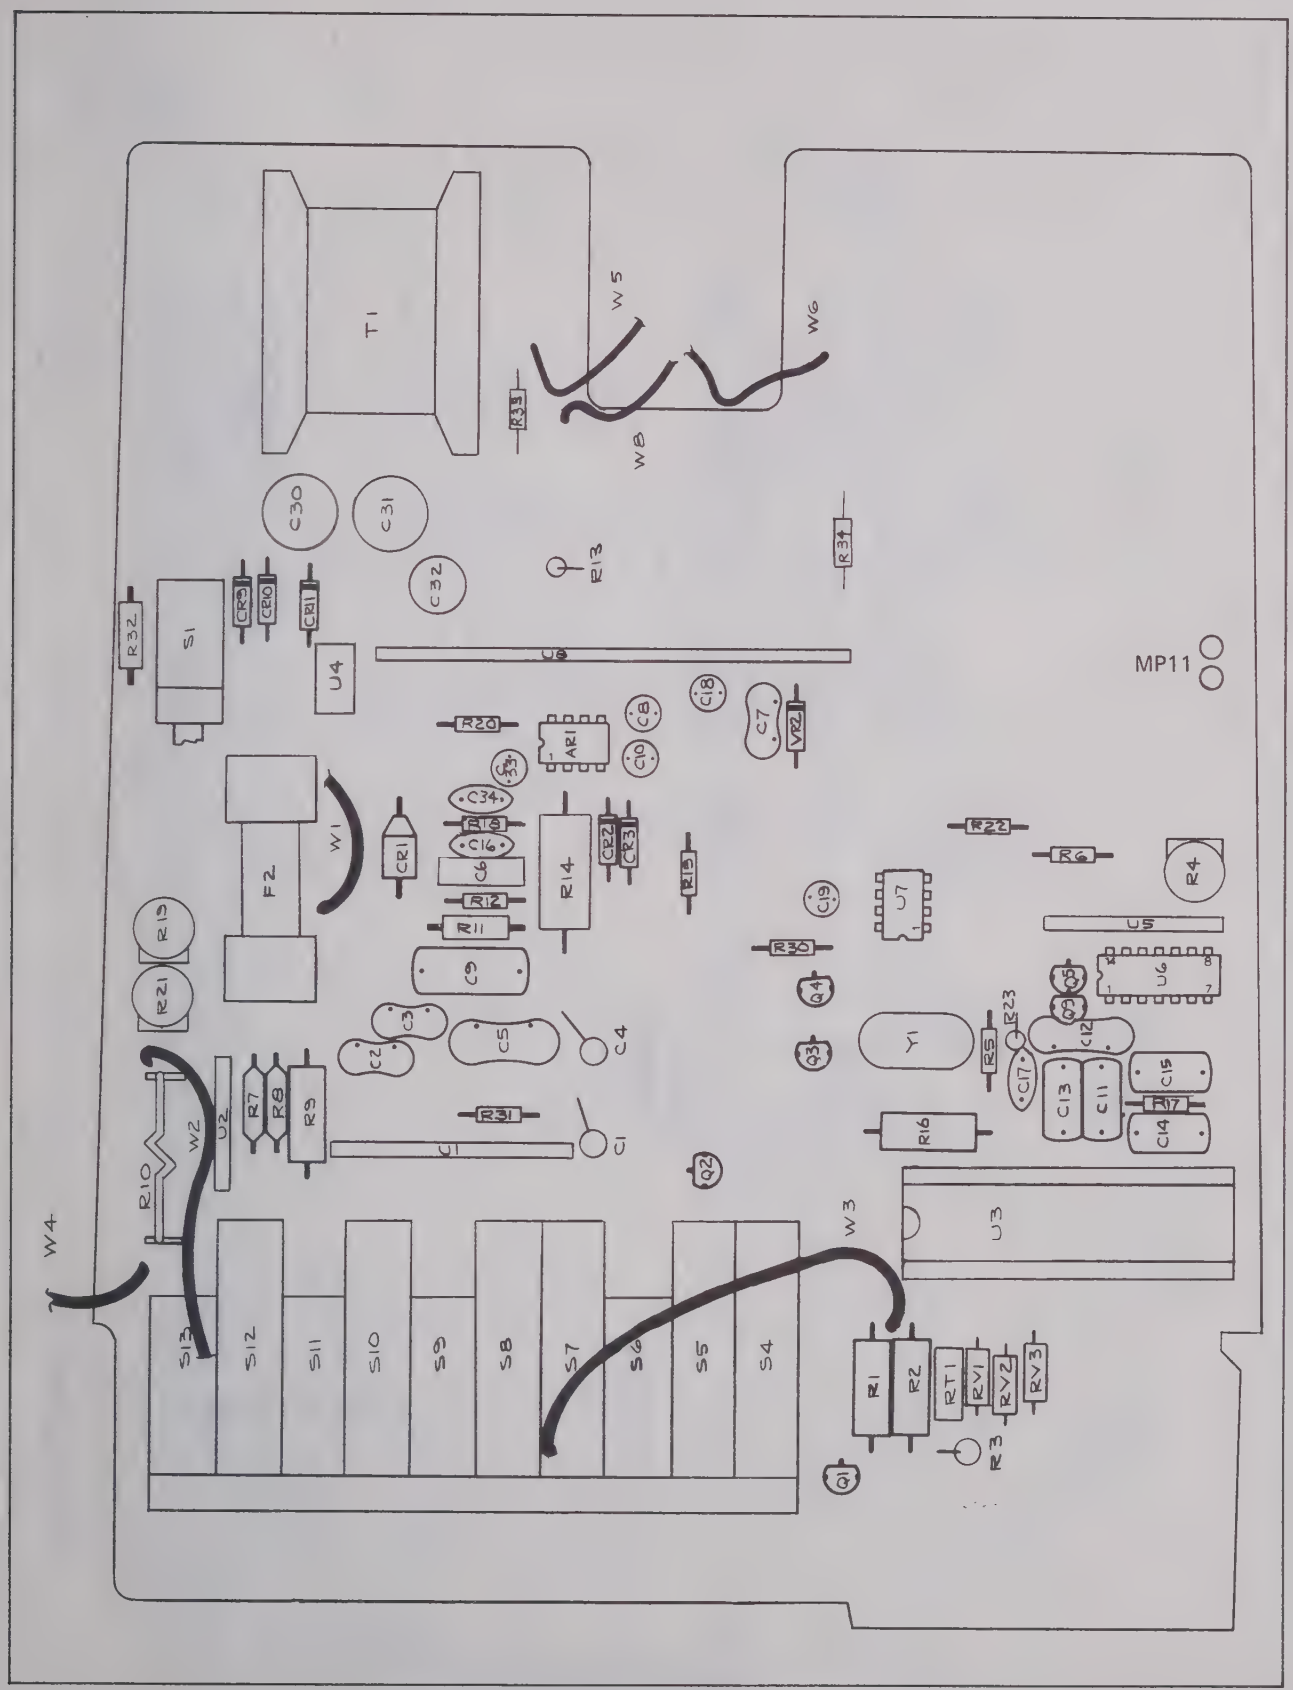

Figure 5-2. A1 D 810 Main PCB Assembly

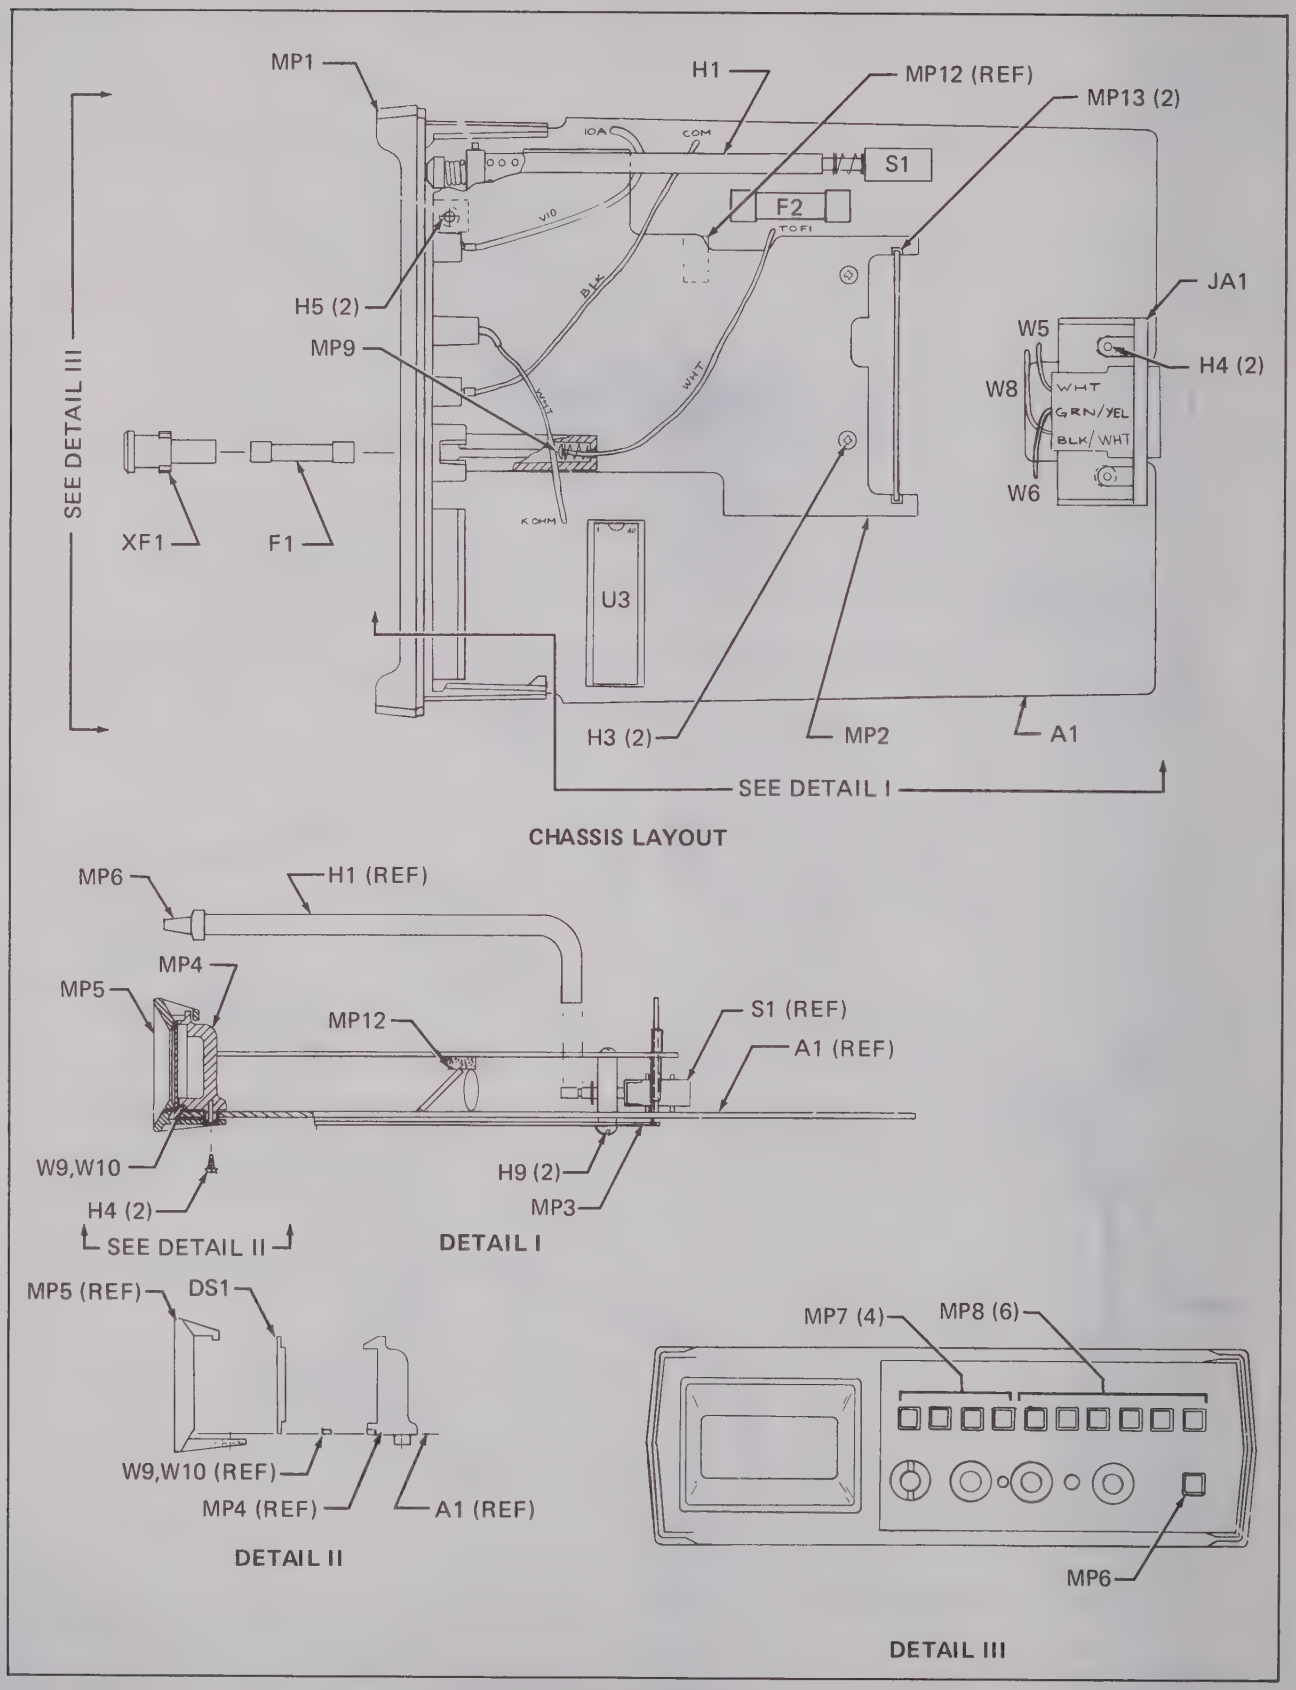

Figure 5-2. A1 D 810 Main PCB Assembly (cont)

Table 5-3. A1 D 811 Main PCB Assembly

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO. OR TYPE	TOT QTY	REC QTY	NOTE
A1	D811 MAIN PCB ASSEMBLY SEE FIGURE 5-3	WITH	LINE	AND BATTERY POWER			1
AR1	IC, LIN, OP-AMP	418780	12040	LF351N	1	1	
BT1	BATTERY ASSEMBLY	487975	89536	487975	1		
C1	CAP, VAR, 1.5 PF -0.25 PF, 200V	218206	72982	530-000	2	1	
C2	CAP, MICA, 150 PF +/-5%, 500V	148478	72136	DM15F151J	2		
C3	CAP, MICA, 120 PF +/-5%, 500V	148486	72136	DM15F121J	1		
C4	CAP, VAR, 1.5 PF -0.25 PF, 200V	218206	72982	530-000	REF		
C5	CAP, MICA, 2200 PF +/-5%, 500V	148346	72136	DM19F222J	1		
C6	CAP, MYLAR, 0.047 UF +/-10%, 250V	162008	73445	C280AMAE47K	1		
C7	CAP, MICA, 150 PF +/-5%, 500V	148478	72136	DM15F151J	REF		
C8	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015KA1	4		
C9	CAP, POLY, 0.622 UF +/-10%, 100V	448183	03797	0.22/10/1000-7	1		
C10	CAP, ELECT, 22 UF -10/+75%, 16V	436840	89536	436840	3		
C11	CAP, MYLAR, 0.047 UF +/-10%, 100V	446773	89536	446773	2		
C12	CAP, MICA, 470 PF +/-5%, 500V	148429	72136	DM19E471J	1		
C13	CAP, MYLAR, 0.047 UF +/-10%, 100V	446773	89536	446773	REF		
C14	CAP, POLY, 0.1 UF +/-10%, 2500V	446781	89536	446781	1		
C15	CAP, POLY, 0.22 UF +/-10%, 100V	436113	73445	C280MAH1A220K	1		
C16	CAP, CER, 0.01 UF +/-20%, 100V	149153	56289	C023B101F103M	2		
C17	CAP, CER, 500 PF +/-10%, 500V	105692	56289	C067B102E501K	1		
C18	CAP, TA, 2.2 UF +/-20%, 20V	161927	56289	196D225X0020HA1	3		
C19	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015KA1	REF		
C20	CAP, ELECT, 2200 UF +75/-10%, 16V	474981	89536	474981	1		
C21	CAP, ELECT, 22 UF -10/+75%, 16V	436840	89536	436840	REF		
C22	CAP, ELECT, 2200 UF +75/-10%, 16V	435990	89536	435990	1		
C23	CAP, TA, 2.2 UF +/-20%, 20V	161927	56289	196D225X0020HA1	REF		
C24	CAP, TA, 2.2 UF +/-20%, 20V	161927	56289	196D225X0020HA1	REF		
C25	CAP, CER, 1000 PF +/-10%, 500V	357806	56289	C016B102G102K	1		
C26	CAP, ELECT, 220 UF +75/-10%, 16V	435990	89536	435990	2		
C27	CAP, ELECT, 220 UF +75/-10%, 16V	435990	89536	435990	REF		
C28	CAP, ELECT, 22 UF -10/+75%, 16V	436840	89536	436840	REF		
C29	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015KA1	REF		
C33	CAP, TA, 10 UF +/-20%, 15V	193623	56289	196D106X0015KA1	REF		
C34	CAP, CER, 0.01 UF +/-20%, 100V	149153	56289	C023B101F103M	REF		
CR1	DIODE, SI, RECTIFIER, 2 AMP, 50V	347559	05277	1N5400	1		
CR2	DIODE, SI, LO-CAP, LO-LEAK	348177	07263	FD7223	2	1	
CR3	DIODE, SI, LO-CAP, LO-LEAK	348177	07263	FD7223	REF		
CR5	DIODE, HI-SPEED SWITCH	203323	07910	1N4448	2	1	
CR6	DIODE, SI, RECTIFIER, 1 AMP	343491	01295	1N4002	2	1	
CR7	DIODE, SI, RECTIFIER, 1 AMP	343491	01295	1N4002	REF		
CR8	DIODE, HI-SPEED SWITCH	203323	07910	1N4448	REF		
DS1	LIQUID CRYSTAL DISPLAY (LCD)	583575	89536	583575	1		
F1	FUSE, FAST-BLO, 2 AMP, 250V	376582	71400	AGX2	1	5	
F2	FUSE, FIBRE, 3 AMP, 600V	475004	71400	BBS-3	1	5	
F3	FUSE, SLO-BLO, 1/32 AMP	163022	71400	MDL1-32	1	5	
H1	PUSH ROD	479634	89536	479634	1		
H3	SCREW, RHP, 4-40 X 1/4	256156	89536	256156	4		
H4	SCREW, PHP, THRD FORM, #5 X 5/16	494641	89536	494641	4		

Table 5-3. A1 D 811 Main PCB Assembly (cont)

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO. OR TYPE	TOT QTY	REC QTY	NOTE
H5	SCREW, PHP, 6-32 X 1/4	385401	89536	385401	2		
H9	SCREW, FHP, 4-40 X 3/8	256024	89536	256024	2		
JA1	RECEPTACLE, AC	607374	89536	607374	1		
MP1	PANEL, FRONT	USE	AS	A REFERENCE ONLY	1		
MP2	SHIELD, TOP	471037	89536	471037	1		
MP3	SHIELD, BOTTOM	471045	89536	471045	1		
MP4	BRACKET, LCD	471730	89536	471730	1		
MP5	BEZEL, LCD	607390	89536	607390	1		
MP6	BUTTON, POWER SWITCH, GREEN	445197	89536	445197	1		
MP7	BUTTON (FUNCTION) (S4 THRU S7)	607424	89536	607424	4		
MP8	BUTTON (RANGE) (S8 THRU S13)	607432	89536	607432	6		
MP9	SPRING, COMP, SS (NOT SHOWN)	422824	84830	LC-0226-3	1		
MP10	RETAINER, BATTERY (NOT SHOWN)	471052	89536	471052	1		
MP11	PAD, ABSORBENT (NOT SHOWN)	483610	89536	483610	1		
MP12	HEAT SINK (NOT SHOWN)	473785	13103	6046PB	1		
MP13	DECAL, HANDLE, DISC	478248	89536	478248	1		
MP14	GROMMET	493015	06915	493015	1	1	
MP15	INSULATOR	495044	89536	495044	1		
MP16	LABEL, FIRE PROTECTION (ON T2 NOT SHOWN)	483602	89536	483602	1		
Q1	XSTR, SI, NPN	218396	89536	218396	4	1	
Q2	XSTR, SI, NPN	218396	89536	218396	REF		
Q3	XSTR, SI, NPN	218396	89536	218396	REF		
Q4	XSTR, SI, PNP	195974	89536	195974	2	1	
Q5	XSTR, SI, PNP	195974	89536	195974	REF		
Q6	XSTR, SI, PNP	523647	07910	MPS6651	1	1	
Q7	XSTR, SI, NPN	168716	89536	168716	1	1	
Q8	XSTR, SI, PNP	195974	89536	195974	1	1	
Q9	XSTR, SI, NPN	218396	89536	218396	REF		
R1	RES, COMP, 100K +/-10%, 1W	109397	01121	GB1031	1		
R2	RES, COMP, 1K +/-10%, 2W	474080	01121	HB1021	1		
R3	RES, MTL. FILM, 1K +/-0.1%, 1/8W	474445	91637	CMF551001B	1		
R4	RES, VAR, CERMET, 200 +/-10%, 1/2W	474973	89536	474973	1	1	
R5	RES, DEP. CAR, 1M +/-5%, 1/4W	348987	80031	CR251-4-5P1M	2		
R6	RES, DEP. CAR, 100 +/-5%, 1/4W	348771	80031	CR251-4-5P100E	2		
R7	RES, MTL. FILM 900 +/-0.1%, 1/8W	461988	89236	461988	1		
R8	RES, MTL. FILM, 90.0 +/-0.1%, 1/8W	461970	89536	461970	1		
R9	RES, WW, 9.000 +/-0.15%, 3W	461962	89536	461962	1		
R10	RES, FXD, 0.01 +/-0.25%, 1W	461780	89536	461780	1		
R11	RES, COMP, 22M +/-10%, 1/2W	108233	01121	EB2261	2		
R12	RES, COMP, 22M +/-5%, 1/4W	221986	01121	CB2255	1		
R13	RES, DEP. CAR, 1 +/-5%, 1/4W	357665	80031	CR251-4-5P1E	1		
R14	RES, COMP, 100K +/-5%, 2W	285056	01121	HB1045	1		
R15	RES, DEP. CAR, 15 +/-5%, 1/4W	348755	80031	CR251-4-5P15E	1		
R16	RES, COMP, 1M +/-10%, 1W	109793	01121	GB1051	1		
R17	RES, DEP. CAR, 220K +/-5%, 1/4W	348953	80031	CR251-4-5P220K	1		
R18	RES, DEP. CAR, 1K +/-5%, 1/4W	343426	80034	CR251-4-5P1K	1		
R19	RES, VAR, CERMET, 5K +/-10%, 1/2W	478883	89536	478883	1	1	
R20	RES, DEP. CAR, 2.2M +/-5%, 1/4W	342659	80031	CR251-4-5P2M2	1		
R21	RES, VAR, 1M +/-10%, 1/2W	485052	89536	485052	1	1	
R22	RES, DEP. CAR, 470K +/-5%, 1/4W	342634	80031	CR251-4-5P470K	1		

Table 5-3. A1 D 811 Main PCB Assembly (cont)

REF DES	DESCRIPTION	FLUKE STOCK NO.	MFG SPLY CODE	MFG PART NO. OR TYPE	TOT QTY	REC QTY	NOTE
R23	RES, DEP. CAR, 1M +/-5%, 1/4W	348987	80031	CR251-4-5P1M	REF		
R24	RES, COMP, 8.2 +/-5%, 1/2W	159590	01121	EB8G25	1		
R25	RES, DEP. CAR, 3.3K +/-5%, 1/4W	348813	80031	CR251-4-5P3K3	1		
R26	RES, DEP. CAR, 47 +/-5%, 1/4W	441592	80031	CR251-4-5P47E	1		
R27	RES, DEP. CAR, 1 +/-5%, 1/4W	357665	80031	CR251-4-5P1E	1		
R28	RES, DEP. CAR, 100 +/-5%, 1/4W	348771	80031	CR251-4-5P100E	REF		
R29	RES, DEP. CAR, 4.7K +/-5%, 1/4W	348821	80031	CR251-4-5P4K7	2		
R31	RES, DEP. CAR, 100K +/-5%, 1/4W	348920	80031	CR251-4-5P100K	1		
R32	RES, COMP, 22M +/-10%, 1/2W	108233	01121	EB2261	REF		
R33	RES, COMP, 3.3M +/-5%, 1/4W	208389	01121	CB3355	1		
R34	RES, DEP. CAR, 47M +/-10%, 1/2W	146415	89536	146415	1		
RT1	RES, CL, 1K +/-40%, 2W, 25 DEG C	446849	50157	180010200	1		
RV1	VARISTOR, 430V +/-10%, 365VDC	447672	09214	V430MA7B	3	1	
RV2	VARISTOR, 430V +/-10%, 365VDC	447672	09214	V430MA7B	REF		
RV3	VARISTOR, 430V +/-10%, 365VDC	447672	09214	V430MA7B	REF		
S1	SWITCH, POWER	473736	89536	473736	1		
S4-S13	SWITCH, ASSEMBLY (S4 THRU S13)	473322	89536	473322	1		
T2	XFMR, POWER	490110	89536	490110	1		
T3	XFMR, DC-DC CONVERTER	478453	89536	478453	1		
U1	RES, NETWORK, 10.0M, 101K, 11.1K	461483	89536	461483	1	1	
U2	RES, NETWORK, .100, .900	461491	89536	461491	1	1	
U3	IC, C-MOS, A/D CONVERTER	429100	89536	429100	1	1	
U4	IC, FW. RECT. BRIDGE, 50V-100V, 1 AMP	418582	83003	VM08	2	1	
U5	RES, NETWORK, 25 DEG. C, +/-5%, 1/8W	474999	89536	474999	1	1	
U6	IC, C-MOS, QUAD EXCLUSIVE-OR GATE	355222	89536	355222	1	1	
U7	IC, LIN, 2.5V BAND-GAP REF	472845	04713	MC1403V	1	1	
U8	HYBRID RMS CONVERTER BOARD	480897	89536	480897	1	1	
U9	IC, FW. RECT. BRIDGE, 50V-100V, 1 AMP	418582	83003	VM08	REF		
U10	IC, LIN, VOLTAGE REGULATOR	473793	12040	LM317MP	1	1	
VR1	DIODE, ZENER	473744	07910	1N5240	1	1	
VR2	DIODE, ZENER, 4.3V	180455	07910	1N749A	1	1	
W1	WIRE ASSY, FUSE, WHT	489096	89536	489096	1		
W2	WIRE ASSY, BLK	487579	89536	487579	1		
W3	WIRE ASSY, WHT	487629	89536	487629	1		
W4	WIRE ASSY, VIO	487637	89536	487637	1		
W5	WIRE ASSY, AC, WHT	489120	89536	489120	1		
W6	WIRE ASSY, GRN/YEL	489112	89536	489112	1		
W7	WIRE ASSY, BLK	489104	89536	489104	1		
W9	CONNECTOR, POST (USED W/BT1)	453092	18565	22989	2		
W10	CONNECTOR, POST (USED W/BT1)	453092	18565	22989	REF		
XF1	FUSE HOLDER ASSEMBLY, 115V SOURCE	607416	89536	607416	1		
XF3	CLIP, FUSE	485219	91833	3529	2		
XU3	SOCKET, IC, 40-PIN (W/U3)	429282	09922	DILB40P-108	1		
Y2	CRYSTAL 60HZ (3.84 MHZ) LINE FREQUENCY	447615	89536	447615	1		

1 ORDER REPLACEMENT PARTS ONLY.

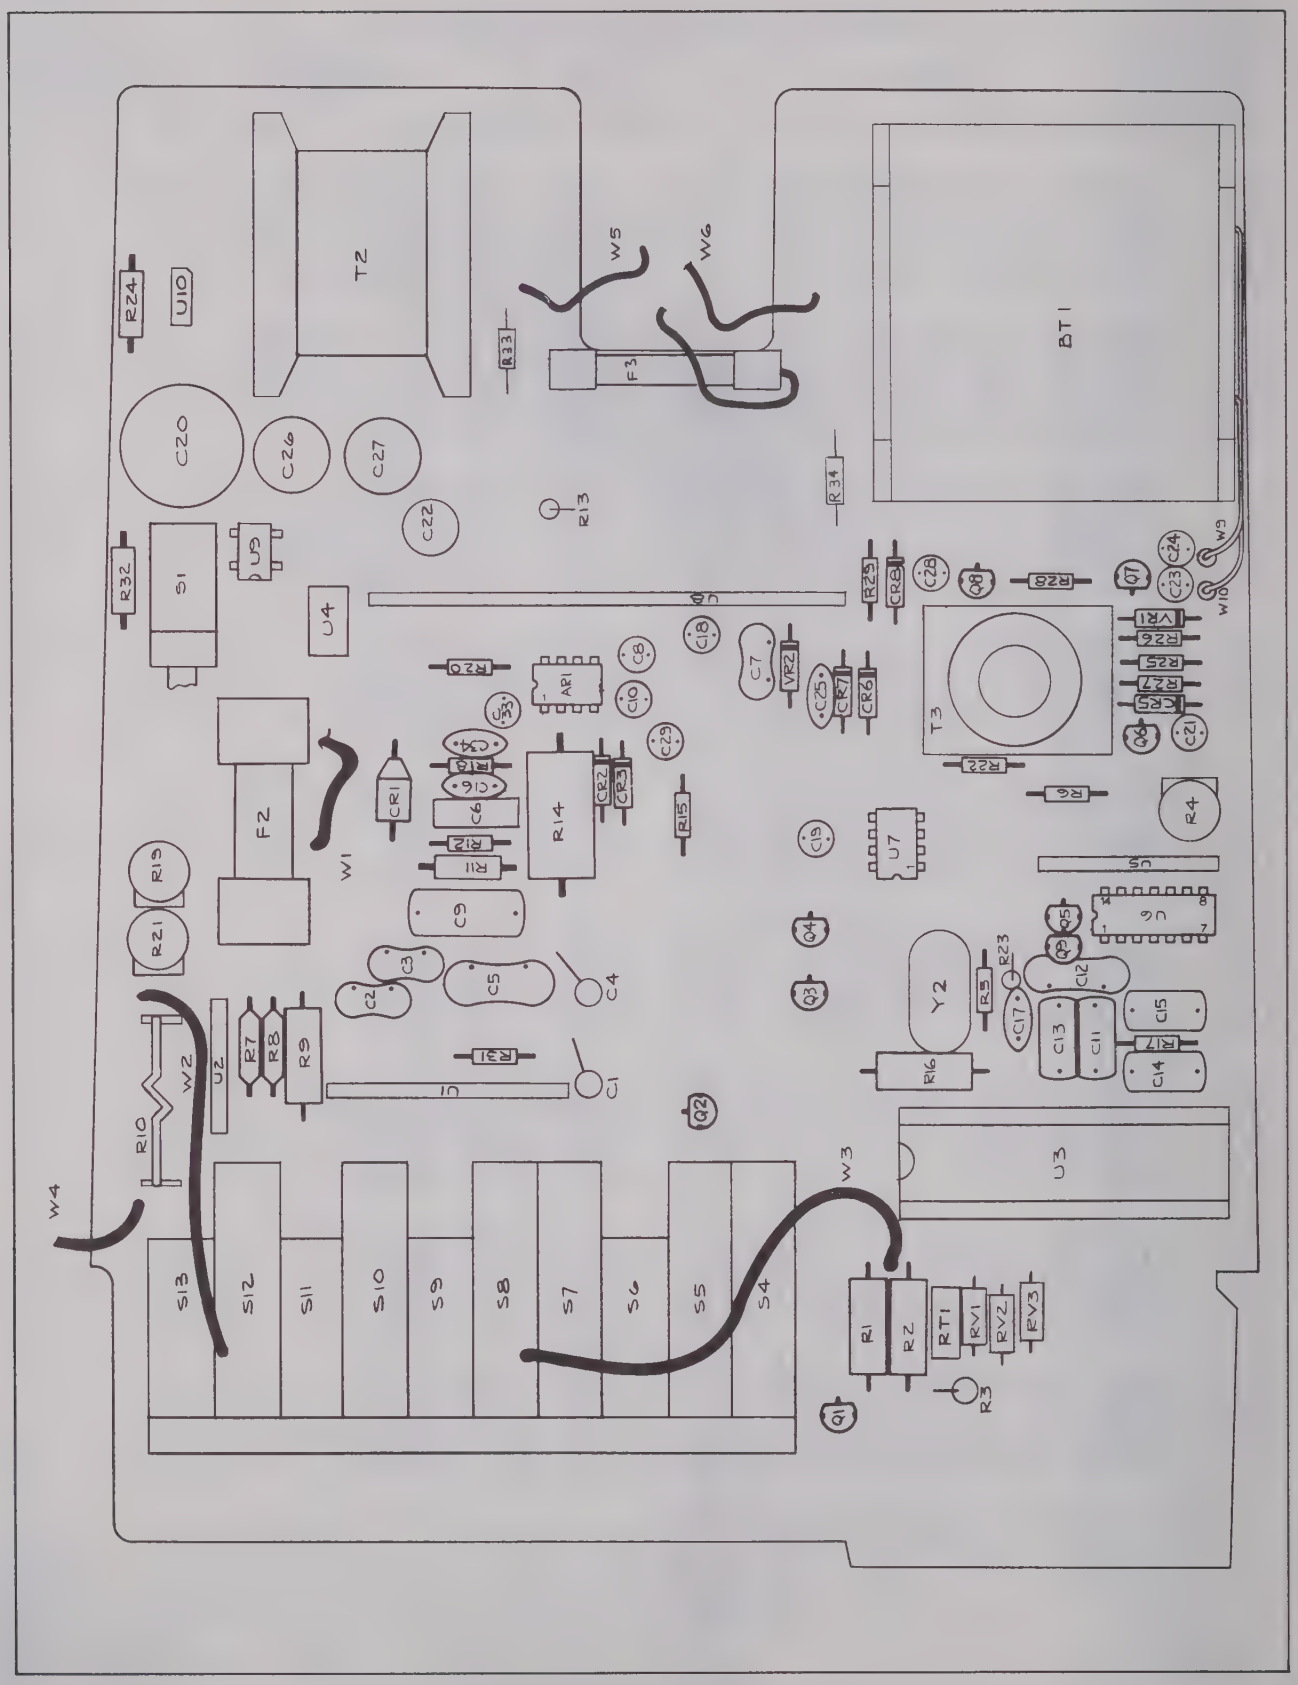

Figure 5-3. A1 D 811 Main PCB Assembly

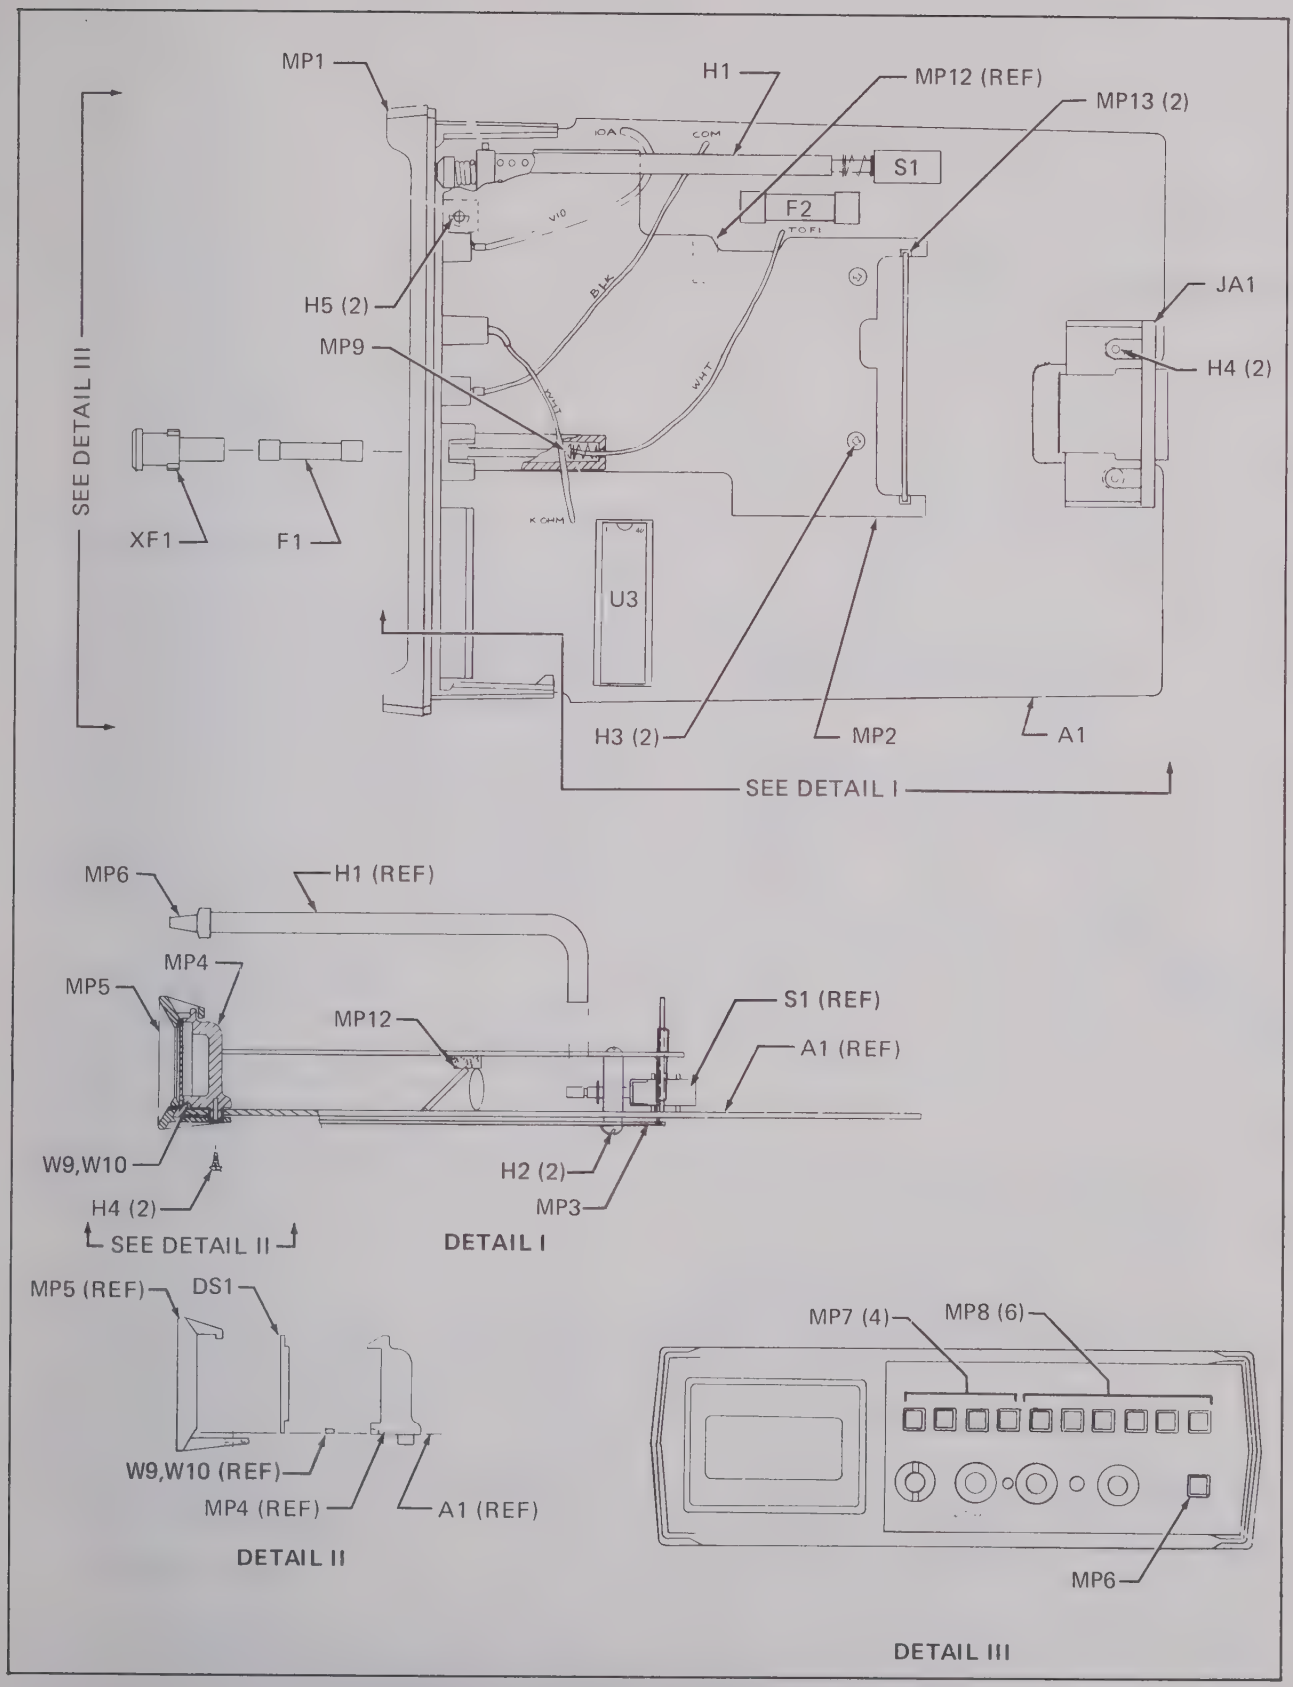

Figure 5-3. A1 D 811 Main PCB Assembly (cont)

Section 6
Accessory Information

6-1. INTRODUCTION

6-2. This section of the manual contains information concerning the accessories available for use with Models D 810 and D 811 Digital Multimeters. The accessories, which are shown in Figures 6-1 and 6-2, are described in general terms under a separate major heading containing the accessory model number. The depth of detail is intended to give the prospective user an adequate first acquaintance with the features and capabilities of each accessory. Additional information, when necessary, is supplied with the accessory. When ordering an accessory, include the model number and name.

6-3. Carrying Case (Y8205)

6-4. The Model Y8205 Carrying Case, Figure 6-1, is a soft, vinyl plastic container, designed for the storage and transport of your instrument. The case provides your instrument with adequate protection against normal handling and storage conditions. A separate storage compartment is provided for test leads, power cord, and other compact accessories.

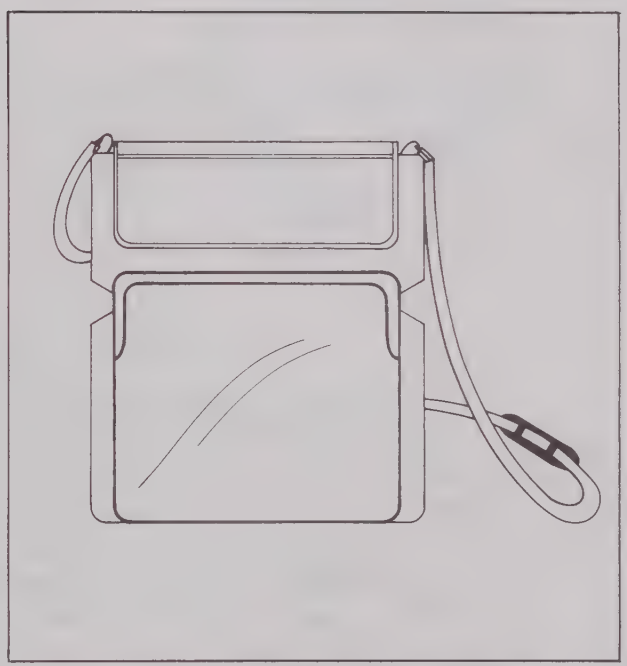

Figure 6-1. Model Y8205 Carrying Case

6-5. Temperature Probe (80T-150C/F)

6-6. The 80T-150C or 80T-150F Temperature Probe converts your instrument into a direct-reading (1 mV dc/°) °C or °F thermometer. It is ideally suited for surface, ambient and liquid measurement, and lends itself easily to a wide range of design, troubleshooting and evaluation applications. A rugged, fast-responding probe-tip with a 350V dc standoff makes the 80T-150 one of the most versatile and easy-to-use temperature probes available.

6-7. Specifications

Range in °C/°F (field selectable by internal jumpers: -50°C to +150°C or -58°F to 302°F
Accuracy: ±1°C (1.8°F) from 0°C to 100°C, decreasing linearly to ±3°C (5.4°F) at -50°C and +150°C
Resolution: 0.1°C on 200 mV range
Voltage Standoff: 350V dc or peak ac
Power: Internal disposable battery; 1,000 hours of continuous use.

6-8. Touch & Hold Probe (Y8008)

6-9. The Touch and Hold Probe allows voltage, resistance and conductance readings to be held in the display of your instrument. Normal readings may be made by using the probe with the control switch in the out position. When the control switch is pressed, the COMMON terminal is connected to the Touch and Hold signal at the mA terminal. This stops the instrument clock, freezing the display. This feature is meant to be used for short time intervals. If you leave the display stopped for 1/2 to 1 hour, the outline

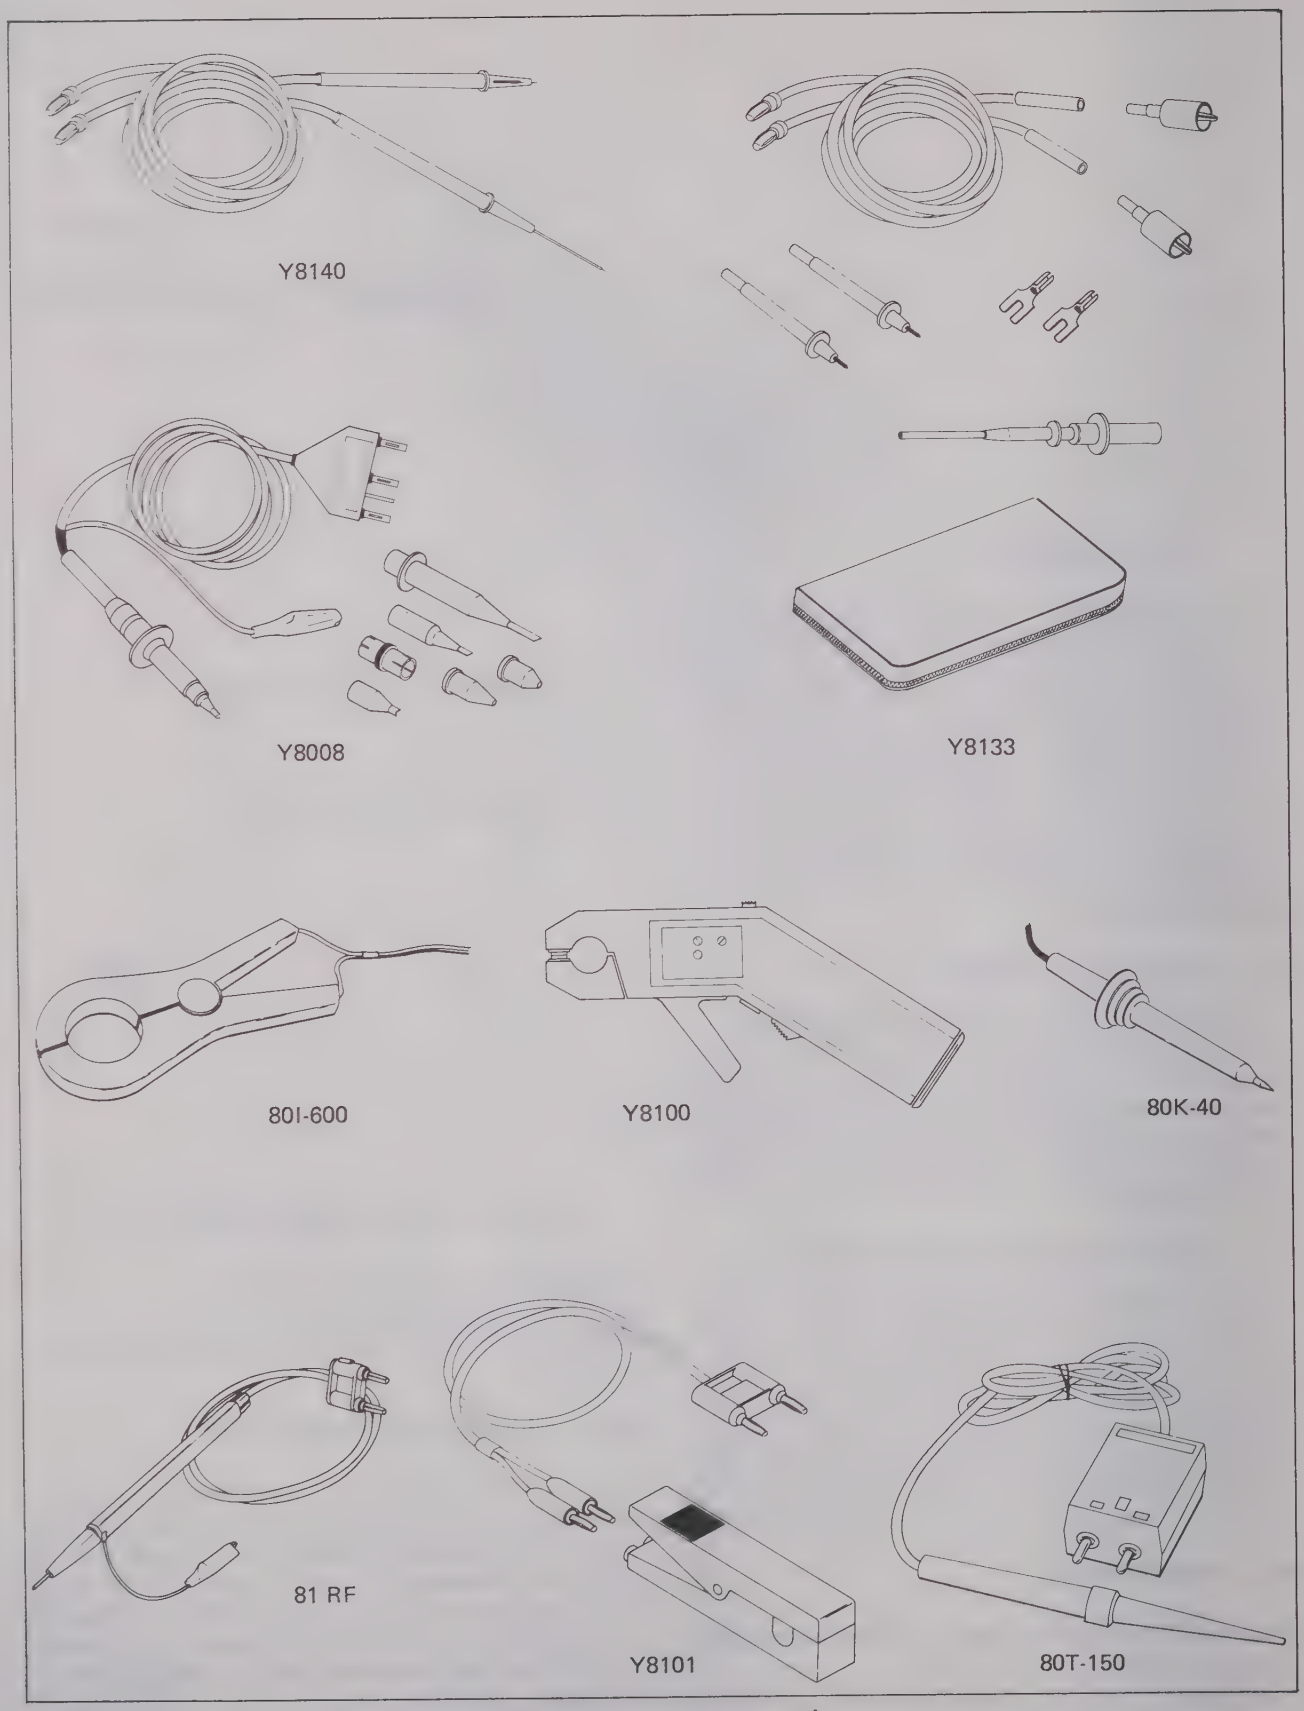

Figure 6-2. Probe Accessories

of the displayed value will remain for a few hours. Stopping the display for extremely long periods of time may result in permanent damage to the LCD.

6-10. Specifications

Input Voltage: 1000V dc or peak ac, maximum
Conductor-to-Shield Capacitance: 100 pF maximum
Lead Resistance: 2 Ω maximum (Common wire clipped to probe tip)
Probe Tip to Probe Common: 1000V dc or peak ac, max
Probe Common to Earth Ground: 60V dc or 42V peak ac, max

6-11. High Voltage Probe (80K-40)

6-12. The Model 80K-40 extends the voltage measurement capability of your meter up to 40 kV. Internally, the probe contains a special 1000:1 resistive divider. Metal film resistor with matched temperature coefficients comprise the divider, and provide the probe with its excellent accuracy and stability characteristics. Also, an unusually high input impedance (1000 MΩ) minimizes circuit loading, and thereby contributes to measurement accuracy.

6-13. Specifications

Voltage Range: 1 kV to 40 kV dc or peak ac, 28 kV rms ac.
Input Resistance: 1000 MΩ
Division Ratio: 1000:1
ACCURACY DC
Overall Accuracy: 20 kV to 30 kV ±2% (calibrated at 25 kV)
Upper Limit: Changes linearly from 2% at 30 kV to 4% at 40 kV
Lower Limit: Changes linearly from 2% at 20 kV to 4% at 1 kV
Accuracy AC (Overall): ±5% at 60 Hz

6-14. High Frequency Probe (81RF)

6-15. The 81RF Probe extends the frequency range of the instrument voltage measurement capability to include 100 kHz to 100 MHz input from 0.25 to 30V rms. It operates in conjunction with the instrument's dc voltage ranges, and provides a dc output that is calibrated to be equivalent to the rms value of a sine wave input.

6-16. Specifications

Frequency Response: +1 dB from 100 kHz to 100 MHz (relative to ac/dc transfer ratio).

AC-to-DC Transfer Ratio (23 ±5°C):

RMS Input (100 kHz)	DC Output
0.25 - 0.5V	0.25 - 0.5V ±1.5 dB
0.5 - 2.0V	0.5 - 2.0V ±0.5 dB
2.0 - 30V	2.0 - 30V ±1.0 dB

Extended Frequency Response: Useful for relative readings from 20 kHz to 250 MHZ.
Response: Responds to peak value of input; calibrated to read rms value of a sine wave.
Voltage Range: 0.25 to 30V rms.
Maximum DC Input: 350V dc.
Temperature Coefficient (0 to 18°C, 28 to 50°F): ±0.1 of ac-to-dc transfer ratio specifications per °C.
Input Impedance: 12 M shunted by 15 pF.

6-17. AC Current Transformer (Y8101)

6-18. The Model Y8101 is a small clamp-on current transformer designed to extend the current measuring capability of an ac current meter up to 150 amperes. A clamp-on coil designed into the probe allows measurements to be made without breaking the circuit under test. This coil serves as the secondary of a 1:1000 transformer. The current-carrying conductor being measured serves as the primary.

6-19. Specifications

Current Range: 2A to 150A.
Accuracy, (48 Hz to 10 kHz):
±2%, 10A to 150A
±8%, 2A to 10A
Division Ratio: 1000:1
Working Voltage: 300V ac rms max.
Insulation Dielectric Withstand Voltage: 3kV rms.
Maximum Conductor Size: 7/16 in. (1.11 cm)

6-20. AC/DC Current Probe (Y8100)

6-21. The Fluke Y8100 DC/AC Current Probe is a clamp-on probe that is used with a voltmeter, multimeter, or oscilloscope to read dc, ac, or composite (ac on dc) current measurements. The jaws on the Y8100 are designed to clamp around conductors up to 3/4 inch in diameter. The pistol shape allows safe, easy, one-hand operation when making current measurements. The Model Y8100 probe is battery powered with size AA cells. It measures current to 200A dc or ac rms using any voltmeter. Two ranges, 20A and 200A, produce a 2V output at full-range current.

6-22. Specifications

Ranges: 20A ac or dc
200A ac or dc

Rated Output: 2V at full range
Accuracy:
DC to 200 Hz: ±2% of range
200 Hz to 1 kHz: < 100A add ±3% reading
> 100A add ±6% reading
Calibration Cycle: 1 year
Frequency Response: dc to 1.0 kHz
Recommended Load: ⩾3.0k
Temperature Range: +15°C to +35°C; for specified accuracy -10°C to +50°C; storage and operation at reduced accuracy.
Heating Limitation: Prolonged operation above 200A ac or 1 kHz can cause damage to the Y8100.
Working Voltage Rating: Core to output; 600V dc or 480V ac Max
output to ground; 42V dc or 30V ac Max
Aperture Size: 3/4" (19mm) diameter
Size-Overall: 9" x 4-1/2" x 1-7/16" (230 mm x 115 mm x 37 mm)
Weight: 14 ounces (0.4 kg), with batteries
Power: 4; "AA" cells
Battery Life: Alkaline-20 hours continuous

6-23. Current Transformer (80I-600)

6-24. The Model 80I-600 extends the maximum 2A ac current measuring capability of your meter up to a maximum of 600 amps. A clamp-on transformer designed into the probe allows measurements to be made without breaking the circuit under test. In use, the current carrying conductor being measured serves as the transformer's primary while the 80I-600 serves as the secondary. Because of a high efficiency, quadrature type of winding, wire size and location of the conductor within the transformer jaws do not affect accuracy of the current measurement.

6-25. Specifications

Range: 1 to 600 A ac
Accuracy: ±3%
Frequency Response: 30 Hz to 1 kHz, 10 kHz typical
Division Ratio: 1000:1
Insulation: 5 kV
Maximum Conductor Size: 2-inch diameter

6-26. Test Lead Set (Y8133)

6-27. The Y8133 deluxe test lead set allows interconnection with a wide variety of leads and electronic components. Included in the kit are:

1. Two test leads (one red and one black). The Y8133 leads have a standard banana connector on one end and a shrouded banana connector on the other end.
2. Two test probes (one red, one black)
3. Two insulated alligator clips (one red, one black)
4. Two spade lugs.
5. One squeeze hook.
6. One test lead pouch.
7. One instruction sheet.

6-28. Specifications

RATINGS	MAXIMUM CURRENT (AMPS)	MAXIMUM VOLTAGE (VOLTS)
TEST LEADS	10	2000
TEST PROBES	10	2000
SQUEEZE HOOK	1	1000

6-29. Test Lead Set (Y8140)

6-30. The Y8140 Test Lead Set consists of one red and one black 60-inch (1.52 meter) test lead, each with a standard banana plug on one end and an extendable tip probe on the other end. This flexible metallic tip conductor may be extended up to 2-1/2 inches, and is insulated to within 1/10 of an inch of its tip. This insulation reduces the chance of creating an inadvertent short circuit while using the probes in their extended configuration. Intended primarily for measuring voltages, the Y8140 leads may also be used for measuring modest currents.

6-31. Specifications

Voltage Rating: 1000V RMS, maximum
Current Rating: 2A, maximum

Section 7
General Information

7-1. This section of the manual contains generalized user information as well as supplemental information to the List of Replaceable parts contained in Section 5. The following information is presented in this section:

List of Abbreviations

Federal Supply Code for Manufacturers

Fluke Technical Service Centers — U.S. and Canada

Technical Service Centers—International

List of Abbreviations and Symbols

A or amp	ampere
ac	alternating current
af	audio frequency
a/d	analog-to-digital
assy	assembly
AWG	american wire gauge
B	bel
bcd	binary coded decimal
°C	Celsius
cap	capacitor
ccw	counterclockwise
cer	ceramic
cermet	ceramic to metal(seal)
ckt	circuit
cm	centimeter
cmrr	common mode rejection ratio
comp	composition
cont	continue
crt	cathode-ray tube
cw	clockwise
d/a	digital-to-analog
dac	digital-to-analog converter
dB	decibel
dc	direct current
dmm	digital multimeter
dvm	digital voltmeter
elect	electrolytic
ext	external
F	farad
°F	Fahrenheit
FET	Field-effect transistor
ff	flip-flop
freq	frequency
FSN	federal stock number
g	gram
G	giga (10^9)
gd	guard
Ge	germanium
GHz	gigahertz
gmv	guaranteed minimum value
gnd	ground
H	henry
hd	heavy duty
hf	high frequency
Hz	hertz
IC	integrated circuit
if	intermediate frequency
in	inch(es)
intl	internal
I/O	input/output
k	kilo (10^3)
kHz	kilohertz
kΩ	kilohm(s)
kV	kilovolt(s)
lf	low frequency
LED	light-emitting diode
LSB	least significant bit
LSD	least significant digit
M	mega (10^6)
m	milli (10^{-3})
mA	milliampere(s)
max	maximum
mf	metal film
MHz	megahertz
min	minimum
mm	millimeter
ms	millisecond
MSB	most significant bit
MSD	most significant digit
MTBF	mean time between failures
MTTR	mean time to repair
mV	millivolt(s)
mv	multivibrator
MΩ	megohm(s)
n	nano (10^{-9})
na	not applicable
NC	normally closed
(-) or neg	negative
NO	normally open
ns	nanosecond
opnl ampl	operational amplifier
p	pico (10^{-12})
para	paragraph
pcb	printed circuit board
pF	picofarad
pn	part number
(+) or pos	positive
pot	potentiometer
p-p	peak-to-peak
ppm	parts per million
PROM	programmablle read-only memory
psi	pound-force per square inch
RAM	random-access memory
rf	radio frequency
rms	root mean square
ROM	read-only memory
s or sec	second (time)
scope	oscilloscope
SH	shield
Si	silicon
serno	serial number
sr	shift register
Ta	tantalum
tb	terminal board
tc	temperature coefficient or temperature compensating
tcxo	temperature compensated crystal oscillator
tp	test point
u or μ	micro (10^{-6})
uhf	ultra high frequency
us or μs	microsecond(s) (10^{-6})
uut	unit under test
V	volt
v	voltage
var	variable
vco	voltage controlled oscillator
vhf	very high frequency
vlf	very low frequency
W	watt(s)
ww	wire wound
xfmr	transformer
xstr	transistor
xtal	crystal
xtlo	crystal oscillator
Ω	ohm(s)
μ	micro (10^{-6})

Federal Supply Codes for Manufacturers

00779
AMP Inc.
Harrisburg, Pennsylvania

01121
Allen-Bradley Co.
Milwaukee, Wisconsin

03797
Eldema Div.
Genisco Technology Corp.
Compton, California

04713
Motorola Inc. Semiconductor Products
Phoenix, Arizona

05277
Westinghouse Electric Corp.
Semiconductor Div.
Youngwood, Pennsylvania

06195
McMahan Brothers, Desk Co.
Los Angeles, California

07263
Fairchild Semiconductor
Div. of Fairchild Camera
& Instrument Corp.
Mountain View, California

07910
Teledyne Semiconductor
Formerly Continental Device
Hawthorne, California

09214
G.E. Co. Semi-Conductor
Products Dept.
Power Semi-Conductor
Products OPN Sec.
Auburn, New York

09922
Burndy Corp.
Norwalk, Connecticut

12040
National Semiconductor Corp.
Danburry, Connecticut

13103
Thermalloy Co., Inc.
Dallas, Texas

28480
Hewlett Packard Co.
Corporate HQ
Palo Alto, California

50157
Midwest Components
Muskegon, Michigan

56289
Sprague Electric Co.
North Adams, Massachusetts

71400
Bussmann Mfg.
Div. of McGraw-Edison Co.
Saint Louis, Missouri

72136
Electro Motive Mfg. Co.
Williamantic, Connecticut

72982
Erie Tech. Products Inc.
Erie, Pennsylvania

73445
Amperex Electronic Corp.
Hicksville, New York

80031
Electro-Midland Corp.
Mepco Div.
A North American Phillips Co.
Norristown, New Jersey

80034
Templetone Radio Mfg. Corp.
New York, New York

83058
The Carr Co., United Can Div.
of TRW
Cambridge, Massachusetts

84830
Lee Spring Co.
Brooklyn, New York

89236
Modern Manufacturing
Pasadena, California

89536
John Fluke Mfg. Co., Inc.
Seattle, Washington

91637
Dale Electronics Inc.
Columbus, Nebraska

91833
Keystone Electronics Corp.
New York, New York

Fluke Technical Service Centers - U.S. and Canada

UNITED STATES

CA, Burbank
Fluke Technical Center
2020 N. Lincoln Street
Burbank, CA 91504
(213) 849-4641

CA, Santa Clara
Fluke Technical Center
2300 Walsh Avenue
Santa Clara, CA 95050
(408) 985-1200

CO, Denver
Fluke Technical Center
1980 S. Quebec Street, Unit 4
Denver, CO 80231
(303) 750-1228

FL, Orlando
Fluke Technical Center
940 N. Fern Creek Avenue
Orlando, FL 32803
(305) 896-2296

IL, Rolling Meadows
Fluke Technical Center
1400 Hicks Road
Rolling Meadows, IL 60008
(312) 398-5800

MA, Waltham
Fluke Technical Center
244 Second Avenue
Waltham, MA 02154
(617) 890-1604

MD, Rockville
Fluke Technical Center
5640 Fishers Lane
Rockville, MD 20852
(301) 770-1576

MN, Apple Valley
Fluke Technical Center
7373 West 147th Street, Suite 196
Apple Valley, MN 55124
(612) 432-9400

NC, Greensboro
Fluke Technical Center
1310 Beaman Place
Greensboro, NC 27408
(919) 273-1918

NJ, Paramus
Fluke Technical Center
West 75th Century Road
Paramus, NJ 07652
(210) 262-9550

TX, Dallas
Fluke Technical Center
14400 Midway Road
Dallas, TX 75240
(214) 233-9945

WA, Mountlake Terrace
John Fluke Mfg. Co., Inc.
21707 66th Avenue W., Suite 1
Mountlake Terrace, WA 98043
(206) 774-2206

CANADA

ALB, Calgary
Allan Crawford Assoc., Ltd.
1935 30th Avenue N.E. #14
Calgary, ALB T2E 6Z5
(403) 230-1341

ONT, Mississauga
Allan Crawford Assoc., Ltd.
6503 Northam Drive
Mississauga, ONT L4V 1J5
(416) 678-1500

QUE, St. Laurent
Allan Crawford Assoc., Ltd.
7018 Cote de Liesse
St. Laurent, QUE H4T 1E7
(514) 731-8564

Technical Service Centers - International

ARGENTINA
Fluke Latin American
Service Headquarters
Virrey del Pino 4071
Buenos Aries, Argentina
Tel: 523185

AUSTRALIA
Elmeasco Instrument Pty Ltd.
P.O. Box 30
Concord, N.S.W.
Australia 2137
Tel: (02) 736-2888

AUSTRIA
Walter Rekirsch
Elektronische Gerate GmbH & Co.
Vertriebs-KG.
Liechtensteinstrasse 97/6
A-1090 Vienna, Austria
Tel: 09-43-222-347646

BELGIUM
Fluke (Belgium)S.A./N.V.
6, Rue de Geneve
1140 Brussels, Belgium
Tel: 09-32-2-2164090

BRAZIL
Arotec S.A.
Industria e Comercio
Av. Pacaembu 811
01234 Sao Paulo S.P., Brazil
Tel: 826-2266

CHILE
Intronica Chile Ltda.
Casilla 16228
Santiago 9, Chile
Tel: 44940

COLOMBIA
Coasin Ltda.
Carrera 13, # 37-37, Of. 407
Ap. Aero 29583
Bogota DE, Colombia
Tel: 285-0230

DENMARK
Tage Olsen A/S
Ballerup Byvej 222
DK-2750 Ballerup
Denmark
Tel: (01) 2-65 81 11

ECUADOR
Proteco Coasin Cia., Ltda.
Edificia "Jerico"
Ave. 12 de Octubre #2285y
Ave, Orellana (Planta Baja)
Quito, Ecuador
Tel: 526759

EGYPT
Lotus Engineering Organisation
P.O. Box 1252
Cairo, Egypt
Tel: 71617

FINLAND
Oy Findip AB
Teollisuustie 7
02700 Kauniainen
Finland
Tel: 09-358-0-502255

FRANCE
M.B. Electronique S.A.
Rue Fourny
ZAC de BUC
B.P. #31
78530 BUC, France
Tel: 09-33-1-9568131

GREECE
Hellenic Scientific
Representations Ltd.
11, Vrassida Street
Athens 615, Greece
Tel: 09-30-1-711140

HONG KONG
Gilman Industrial Bldg., 9F
107-109 Wai Yip Street
Kwun Tong
Kowloon, Hong Kong
Tel: 3-427144

INDIA
Hinditron Services Pvt. Ltd.
"Hinditron House"
412 Raj Mahal Vilas Extension
Bangalore 560 006, India
Tel: 33139

Hinditron Services Pvt. Ltd.
69 A.L. Jagmohandas Marg
Bombay 400 006, India
Tel: 365344

INDONESIA
P.T. Dwi Tunggal Jaya Sakti
Sangga Buana Bldg., 1st Floor
J1. Senen Raya 44, P.O. Box 4435
Jakarta, Indonesia
Tel: 376608

IRAN
Irantronics Company Ltd.
20 Salm Road
Roosevelt Avenue
Tehran, Iran
Tel: 828294/831564

ISRAEL
R.D.T. Electronics Engineering Ltd.
P.O. Box 75
46, Sokolov Street
Ramat Hasharon 47235
Israel
Tel: 09-972-3-483211

ITALY
Sistrel S.p.A.
Via Timavo 66
20099 Sesto S. Giovanni (Milan)
Italy
Tel: 09-39-2-2476693

Sistrel S.P.A.
Via Guiseppe Armellini #37
00143 Rome, Italy
Tel: 09-39-6-5915551

JAPAN
John Fluke Mfg. Co., Inc.
Japan Branch
1 Higashikata-machi
Midori-ku
Yokohama 226, Japan
Tel: (045) 473-5425

KOREA
Electro-Science Korea Co.
C.P.O. Box 8446
Room 1201 Bowon Bldg.
490 Chongro - 5 Ka
Chongro-ku
Seoul, Korea
Tel: 261-7702

MALASIA
O'Connor's (Malaysia) SDN. BHD.
P.O. Box 91
Petaling Jaya, Selangor
West Malaysia
Tel: 51563

MEXICO
C.J. Christensen S.A. De C.V.
Melchor Ocampo 150-8
Mexico 4 D.F., Mexico
Tel: (905) 535-2258

NETHERLANDS
Fluke (Nederland) B.V.
P.O. Box 5053
5004 EB Tilburg
The Netherlands
Tel: (013) 673973

NEW ZEALAND
W & K McLean Ltd.
P.O. Box 18065
Glen Innes
Auchland, New Zealand
Tel: 587-037

NORWAY
Morgenstierne & Co. A/A
Konghellegate 3
P.O. Box 6688, Rodelokka
Oslo 5, Norway
Tel: 09-47-2-356110

PAKISTAN
Pak International Operations
505 Mohammadi House
1.1. Chundrigar Road
Katrachi-2 Pakistan
Tel: 221127/239052

PERU
Importaciones Y Representaciones
Electronicas S.A.
Avda. Franklin D. Roosevelt 105
Lima 1, Peru
Tel: 288650

PORTUGAL
Equipamentos de Laboratorio, Ltda
P.O. Box 1100
Lisbon 1002, Portugal
Tel: 09-351-1-578936/547512

REPUBLIC OF SINGAPORE
Rank O'Connor's (PTE) Ltd.
98 Pasir Panjang Road
Singapore 0511
Republic of Singapore
Tel: 637944

REPUBLIC OF SOUTH AFRICA
Fluke S.A. (Pty) Ltd.
P.O. Box 39797
Bramley 2018
Republic of South Africa
Tel: (011) 786-3170

SPAIN
Hispano Electronica S.A.
Apartado de Correos 48
Alcorcon (Madrid)
Spain
Tel: 09-3416194108

SWEDEN
Teleinstrument AB
P.O. Box 490
S-162 Vallingby 4
Sweden
Tel: 09-46-8-380370

SWITZERLAND
Traco Electronic AG
Jenatschstrasse 1
8002 Zurich
Switzerland
Tel: 09-41-1-2010711

TAIWAN
CCT Associates, Inc.
P.O. Box 24209
Taipei, Taiwan
Republic of China
Tel: (02) 391-6894/393-5760

THAILAND
Dynamic Supply Engineering R.O.P.
56 Ekamai, Sukhumvit 63
Bangkok-11, Thailand
Tel: 914434/928532

TURKEY
Erkman Electronik Aletler
Ticaret Anonim Sirketi
Necatiby Cad 92/3
Karakoy, Istanbul, Turkey
Tel: 09-44-1-5461

UNITED KINGDOM
Fluke International Corp. - UK
Colonial Way
Watford, Herts. WD24TT
United Kingdom
Tel: 09-4492340511

URUGUAY
Coasin Uruguaya S.R.L.
Edifico Ciudadela
Sarandi 690 D. Esc. 109
Casilla de Correos 1400
Correo Central
Montevideo, Uruguay
Tel: 917978

VENEZUELA
Coasin C.A.
Apdo. Postal 50939
Sabana Grande # 1
Caracas 105, Venezuela
Tel: 782-9109

WEST GERMANY
Fluke (Deutschland) GmbH
Krausstrasse 32
8045 Ismaning
West Germany
Tel: (089) 96251

Customers in the following countries: Bulgaria, Czechoslovakia, Hungary, Poland, Romania, U.S.S.R., and Yugoslavia, contact: Amtest Associates Ltd., P.O. Box 55, Addlestone, Surrey, KT 15 1DU, England, Tel. (0932) 52121

Appendix 7A
Manual Change Information

INTRODUCTION

This appendix contains information necessary to backdate the manual to conform with earlier pcb configurations. To identify the configuration of the pcb's used in your instrument, refer to the revision letter (marked in ink) on the component side of each pcb assembly. Table 7A-1 defines the assembly revision levels documented in this manual.

NEWER INSTRUMENTS

As changes and improvements are made to the instrument, they are identified by incrementing the revision letter marked on the affected pcb assembly. These changes are documented on a supplemental change/errata sheet which, when applicable, is inserted at the front of the manual.

OLDER INSTRUMENTS

To backdate this manual to conform with earlier assembly revision levels, perform the changes indicated in Table 7A-1.

CHANGES

There are no backdating changes at this printing. All pcb assemblies are documented at their original revision level.

Table 7A-1. Manual Status and Backdating Information

Ref Or Option No.	Assembly Name	Fluke Part No.	* To adapt manual to earlier rev configurations perform changes in desending order (by no.), ending with change under desired rev letter																						
			–	A	B	C	D	E	F	G	H	J	K	L	M	N	P									
A1	Main PCB, D810 Line	607358	●	●	●	●	●	X																		
A1	Main PCB, D811 Battery	607366	X																							

* X = The PCB revision levels documented in this manual.
● = These revision letters were never used in the instrument.
–= No revision letter on the PCB.

Section 8
Schematic Diagrams

TABLE OF CONTENTS

FIGURE	TITLE	PAGE
8-1.	A1 D 810/D 811 Main PCB Assembly	8-2
8-2.	Custom IC (U3) Block Diagram	8-6

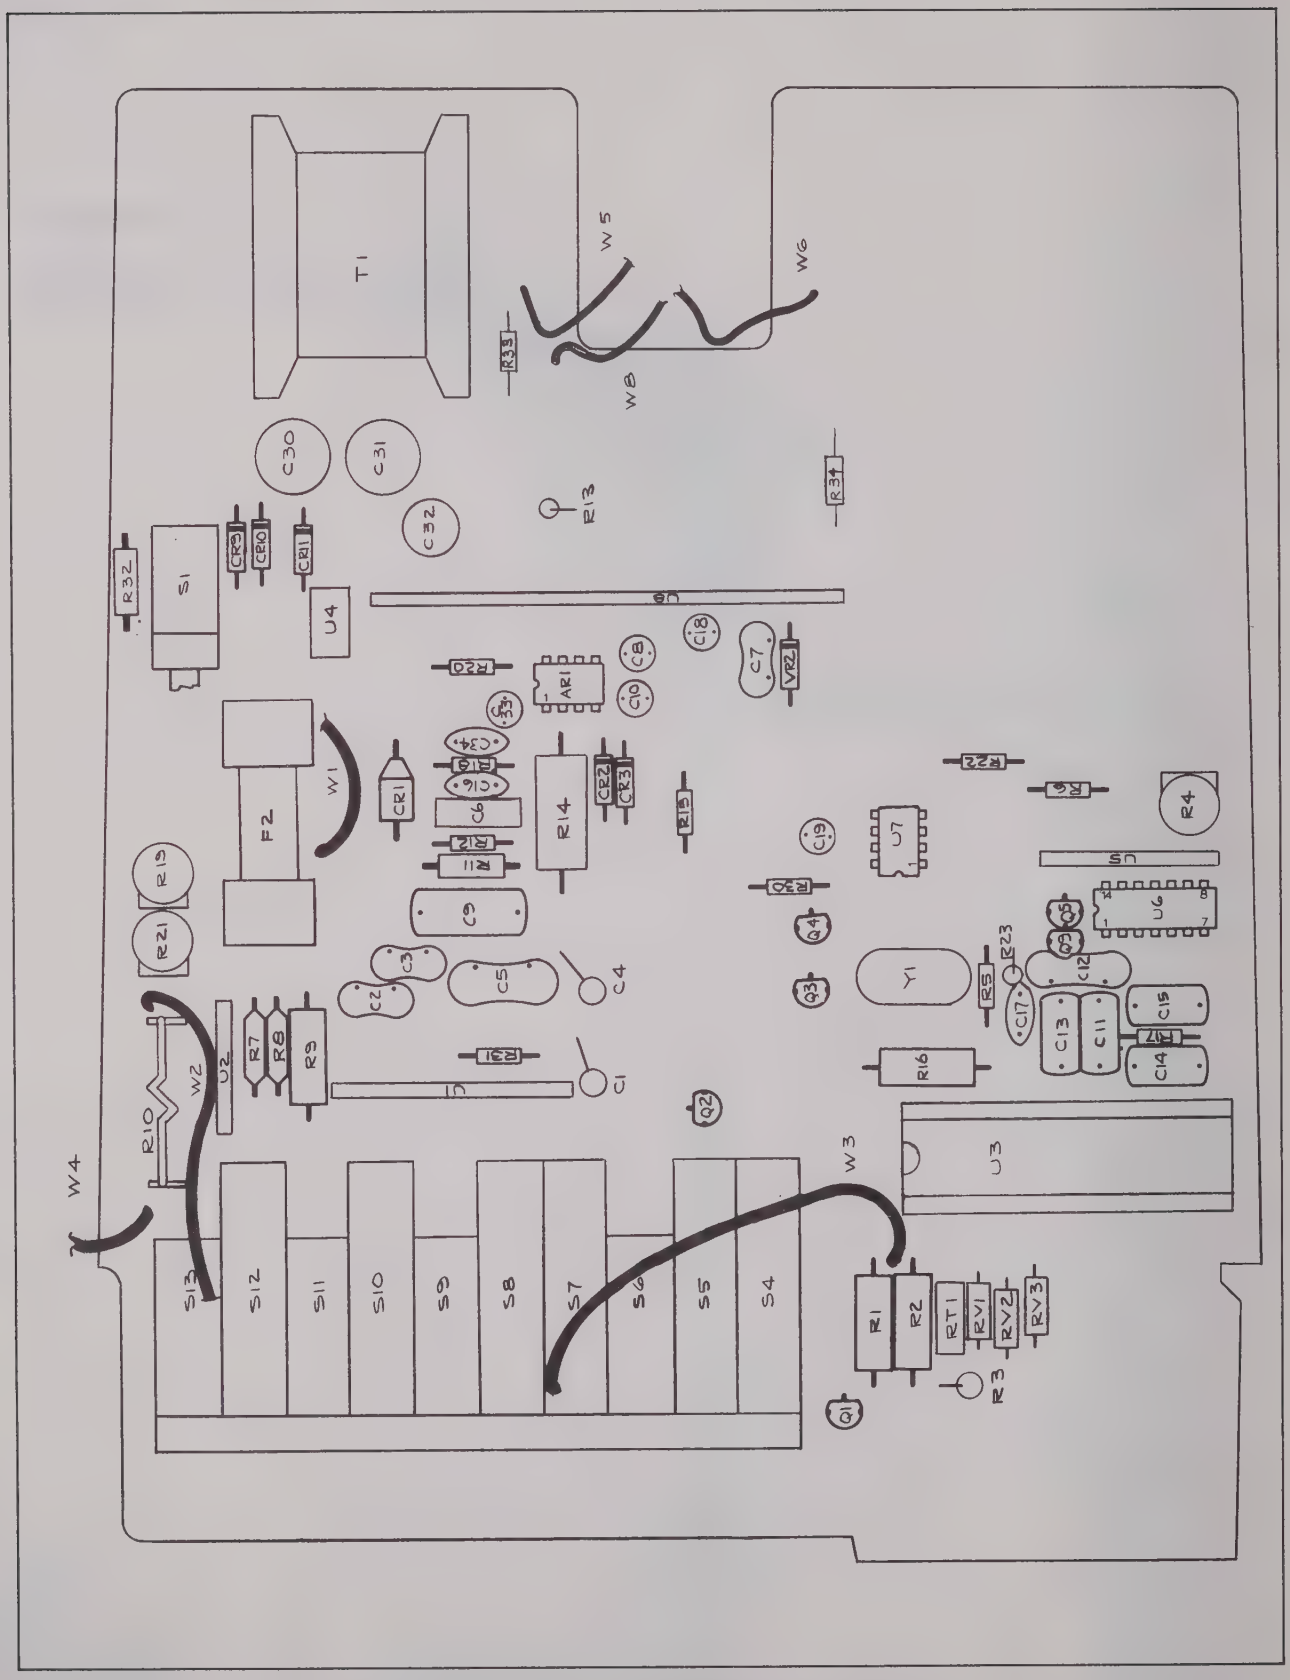

Figure 8-1. A1 D 810/D 811 Main PCB Assembly

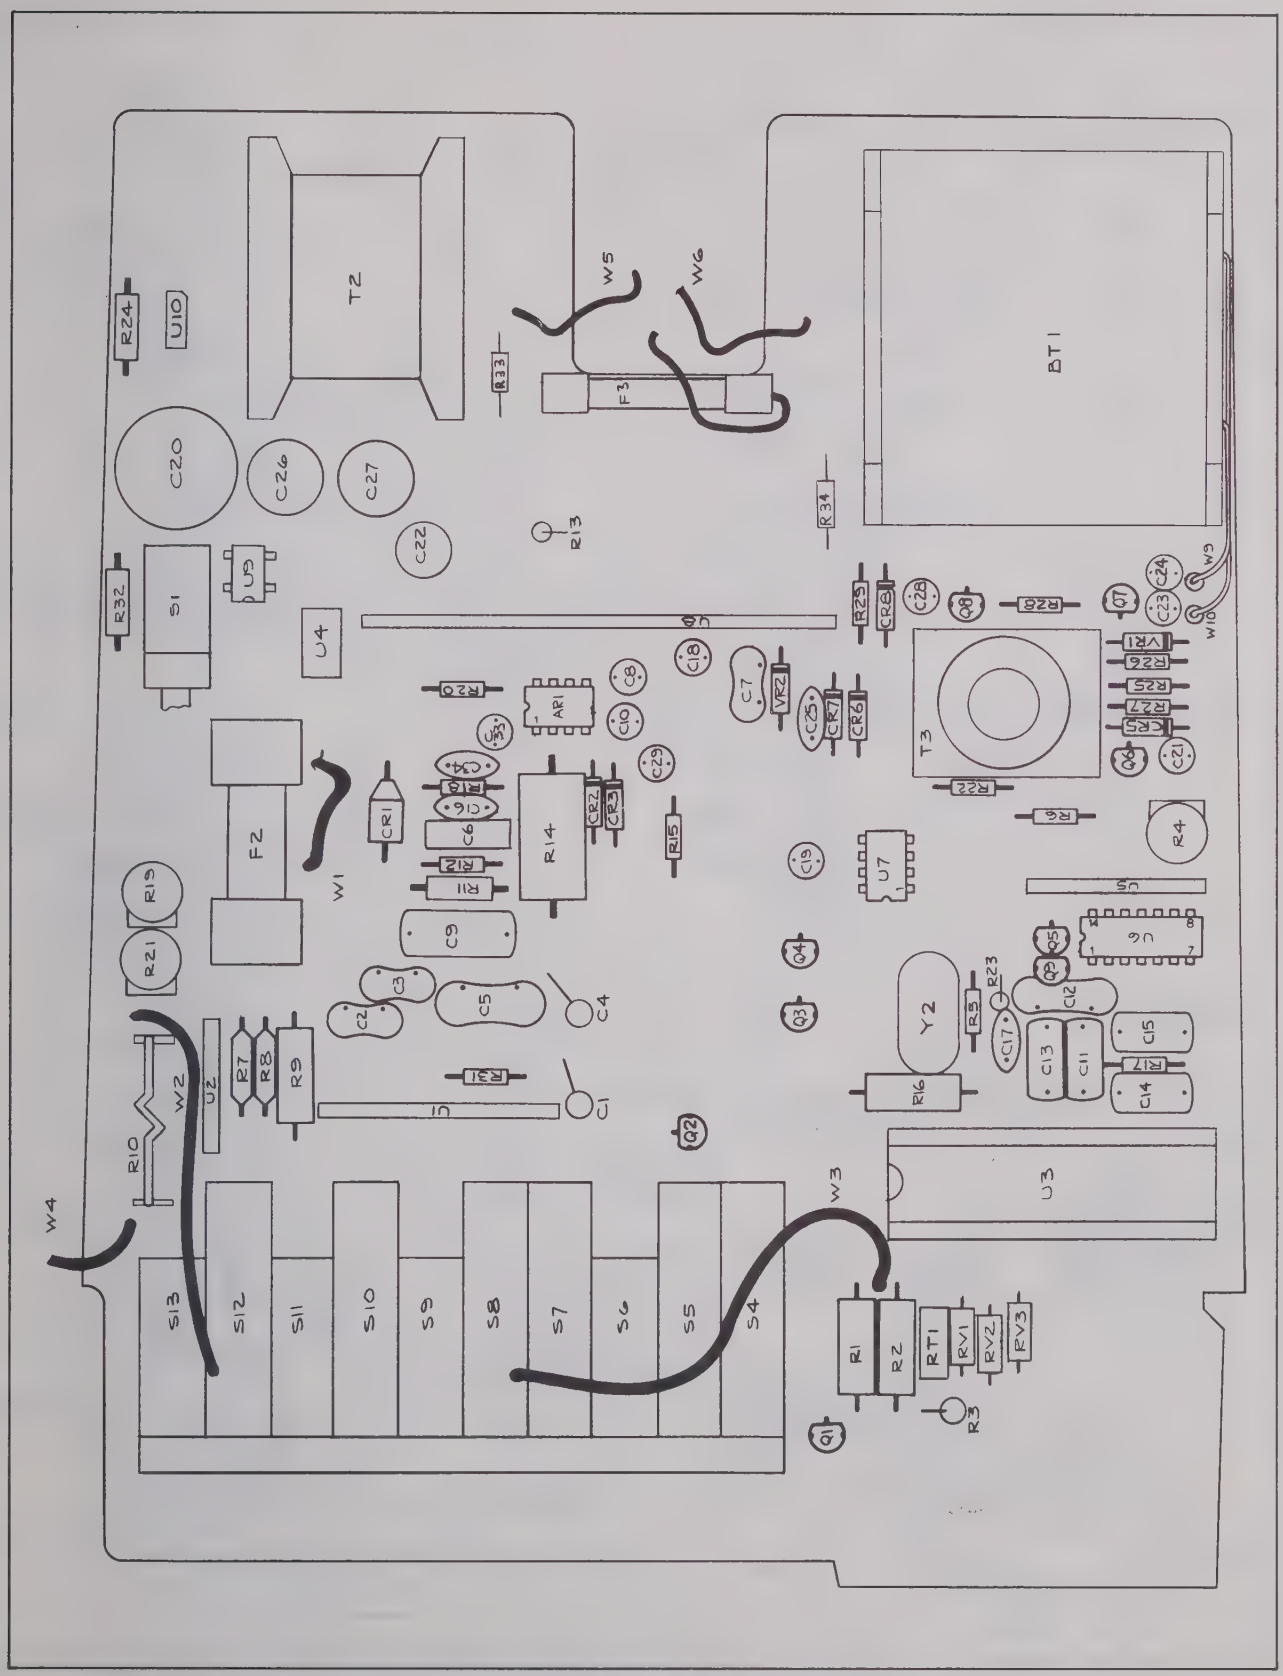

Figure 8-1. A1 D 810/D 811 Main PCB Assembly (cont)

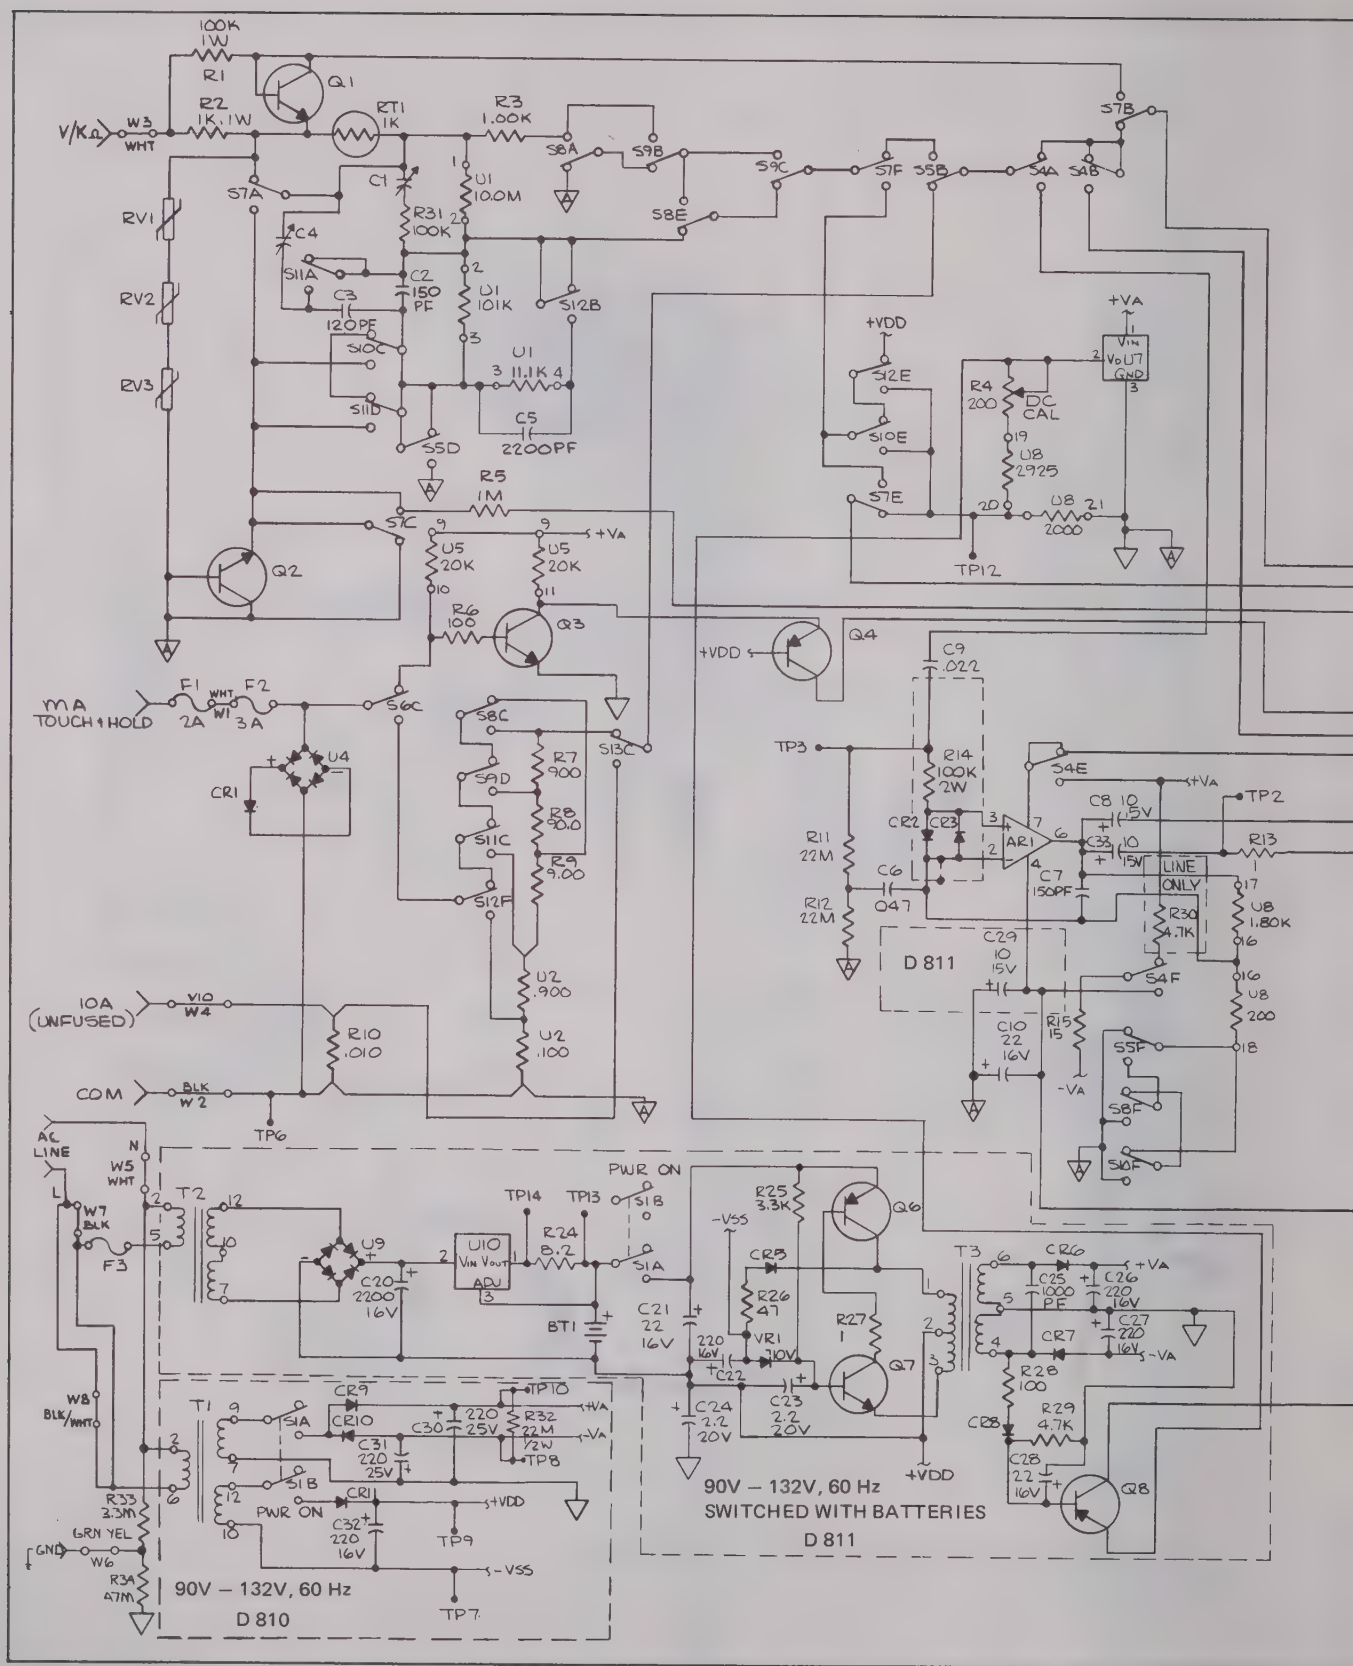

Figure 8-1. A1 D 810/D 811 Main PCB Assembly (cont)

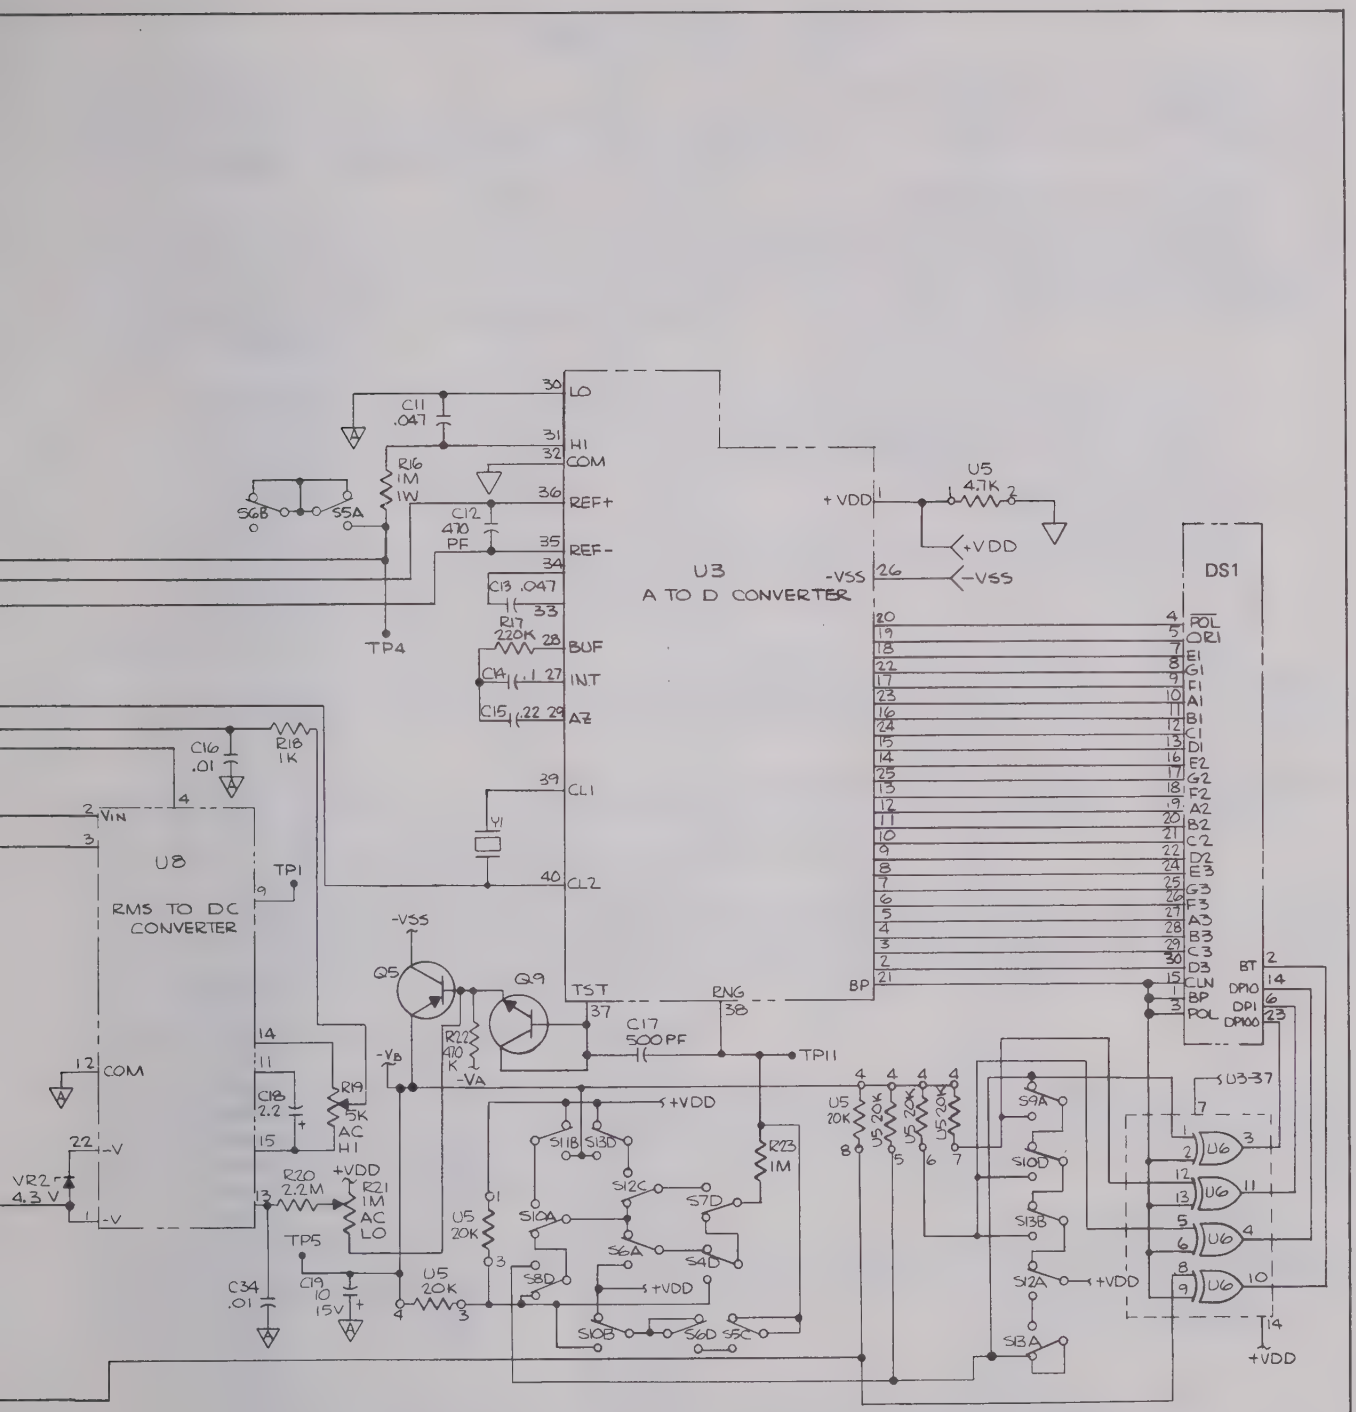

Figure 8-1. A1 D 810/D 811 Main PCB Assembly (cont)

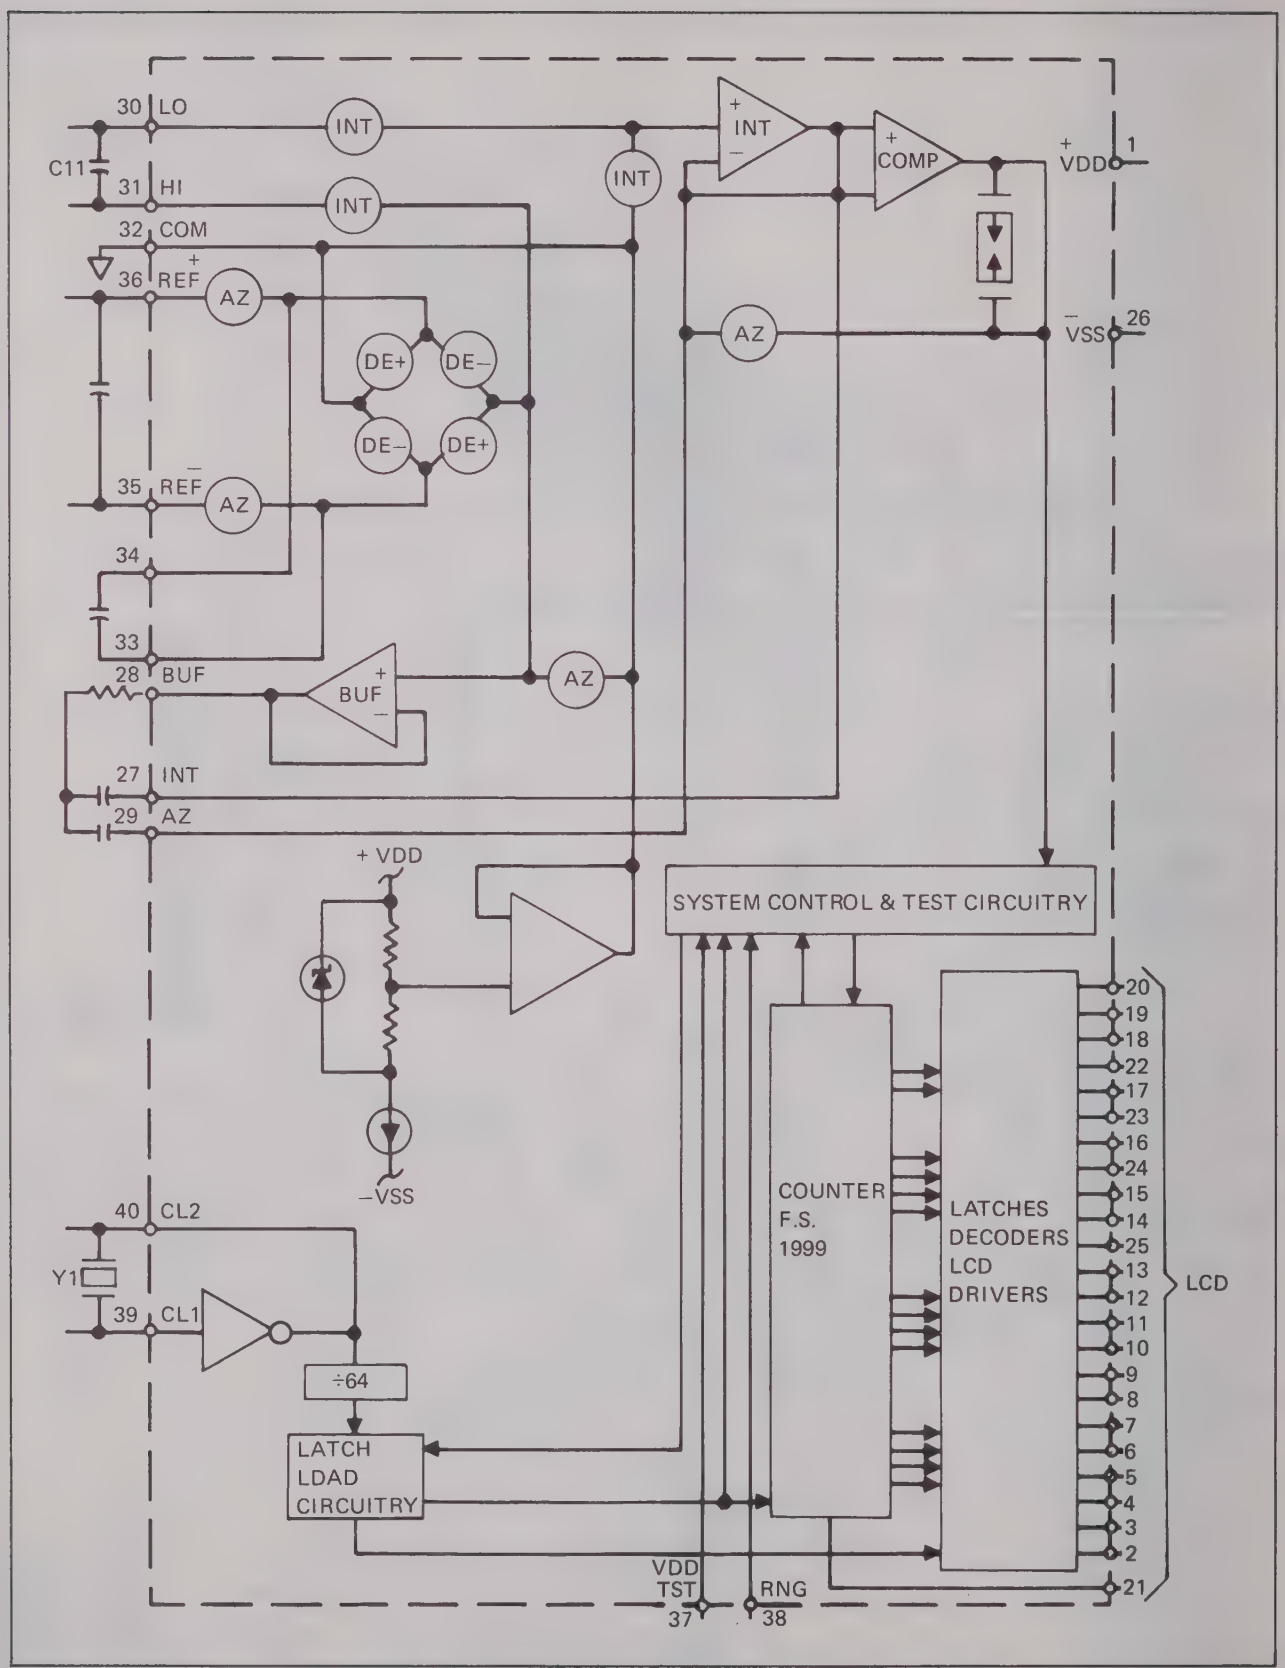

Figure 8-2. Custom IC (U3) Block Diagram

LIMITED WARRANTY

The JOHN FLUKE MFG. CO., INC., warrants each voltmeter it manufactures to be free from defects in material and workmanship under normal use and service for the period of 1 year from date of purchase. This warranty extends only to the original purchaser. This warranty shall not apply to fuses, disposable batteries (rechargeable type batteries are warranted for 90-days), or any product or parts which have been subject to misuse, neglect, accident or abnormal conditions of operations.

In the event of failure of a product covered by this warranty, John Fluke Mfg. Co. Inc., will repair and calibrate an instrument returned to an authorized service Facility within 1 year of the original purchase, provided the warrantor's examination discloses to its satisfaction that the product was defective. The warrantor may, at its option, replace the product in lieu of repair. With regard to any instrument returned within 1 year of the original purchase, said repairs or replacement will be made without charge. If the failure has been caused by misuse, neglect, accident or abnormal conditions of operations, repairs will be billed at a nominal cost. In such case, an estimate will be submitted before work is started, if requested.

ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OR USE SHALL BE LIMITED TO A PERIOD OF TWELVE MONTHS FROM THE DATE OF PURCHASE. THE FOREGOING WARRANTY IS IN LIEU OF ALL OTHER EXPRESS WARRANTIES. JOHN FLUKE MFG. CO. INC., SHALL NOT BE LIABLE FOR ANY SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES, WHETHER IN CONTRACT, TORT, OR OTHERWISE.

NOTE: Some states do not allow limitations on how long an implied warranty lasts, or the exclusion or limitation of incidental or consequential damages, so the above limitations or exclusion may not apply to you. This warranty gives you specific legal rights, and you may also have other rights which vary from state to state.

If any failure occurs, the following steps should be taken:

1. Notify the JOHN FLUKE MFG. CO., INC., or nearest Service facility, giving full details of the difficulty, and include the Model number, type number, and serial number. On receipt of this information, service data or shipping instructions will be forwarded to you.

2. On receipt of the shipping instructions, forward the instrument, transportation prepaid. Repairs will be made at the Service Facility and the instrument returned, transportation prepaid.

SHIPPING TO MANUFACTURER FOR REPAIR OR ADJUSTMENT

All shipments of JOHN FLUKE MFG. CO., INC., instruments should be made via United Parcel Service or "Best Way" prepaid. The instrument should be shipped in the original packing carton, or if it is not available, use any suitable container that is rigid and of adequate size. If a substitute container is used, the instrument should be wrapped in paper and surrounded with at least four inches of excelsior or similar shock-absorbing material.

CLAIM FOR DAMAGE IN SHIPMENT TO ORIGINAL PURCHASER

The instrument should be thoroughly inspected immediately upon original delivery to purchaser. All material in the container should be checked against the enclosed packing list. The manufacturer will not be responsible for shortages against the packing sheet unless notified immediately. If the instrument is damaged in any way, a claim should be filed with the carrier immediately. (To obtain a quotation to repair shipment damage, contact the nearest Fluke Technical Center.) Final claim and negotiations with the carrier must be completed by the customer.

The JOHN FLUKE MFG. CO., INC., will be happy to answer all application or use questions, which will enhance your use of this instrument. Please address your requests or correspondence to JOHN FLUKE MFG. CO., INC., P.O. BOX 43210, MOUNTLAKE TERRACE, WASHINGTON 98043. ATTEN: Sales Dept. For European Customers: Fluke (Nederland) B.V., Zevenheuveienweg 53, Tilburg, The Netherlands.

John Fluke Mfg. Co., Inc., • P.O. Box 43210 • Mountlake Terrace, Washington 98043

www.manualsplus.com
1028579

P/N 583617
October 1980
Litho in U.S.A.

John Fluke Mfg. Co., Inc.
P.O. Box 43210
Mountlake Terrace, WA 98043

SE Laboratories
LOC. GG2
MAN – 06479